 




SERVICE BULLETIN

PUBLICATION GROUP, AFTER SALES SERVICE DEP.
MITSUBISHI MOTOR SALES EUROPE BV

SERVICE BULLETIN		No.: ESB-98E34-001	
		Date: 1999-09-30	<Model> (EC,EXP) ECLIPSE (D30)
Subject: CHANGE IN REAR SUSPENSION LOWER ARM MOUNTING NUT		<M/Y> 96-10	
Group: REAR SUSPENSION			
INFORMATION		 O. Kai - E.V.P. & G.M. After Sales Service Dept.	
1. Description: With change of the nut for mounting the rear suspension lower arm to a self-locking nut, a mark indicating that the nut is not reusable has, been added and the tightening torque changed.			
2. Applicable Manuals:			
Manual	Pub. No.	Language	Page(s)
'96 ECLIPSE Workshop Manual chassis	PWUE95E1	(English)	34-10
	PWUS95E1	(Spanish)	
	PWUF95E1	(French)	
	PWUG95E1	(German)	
	PWUD95E1	(Dutch)	
3. Details:			

LOWER ARM AND TOE CONTROL ARM ASSEMBLIES




34100450062

REMOVAL AND INSTALLATION

Post-installation Operation

- Wheel alignment Check and Adjustment
(Refer to P. 34-4.)

<New>

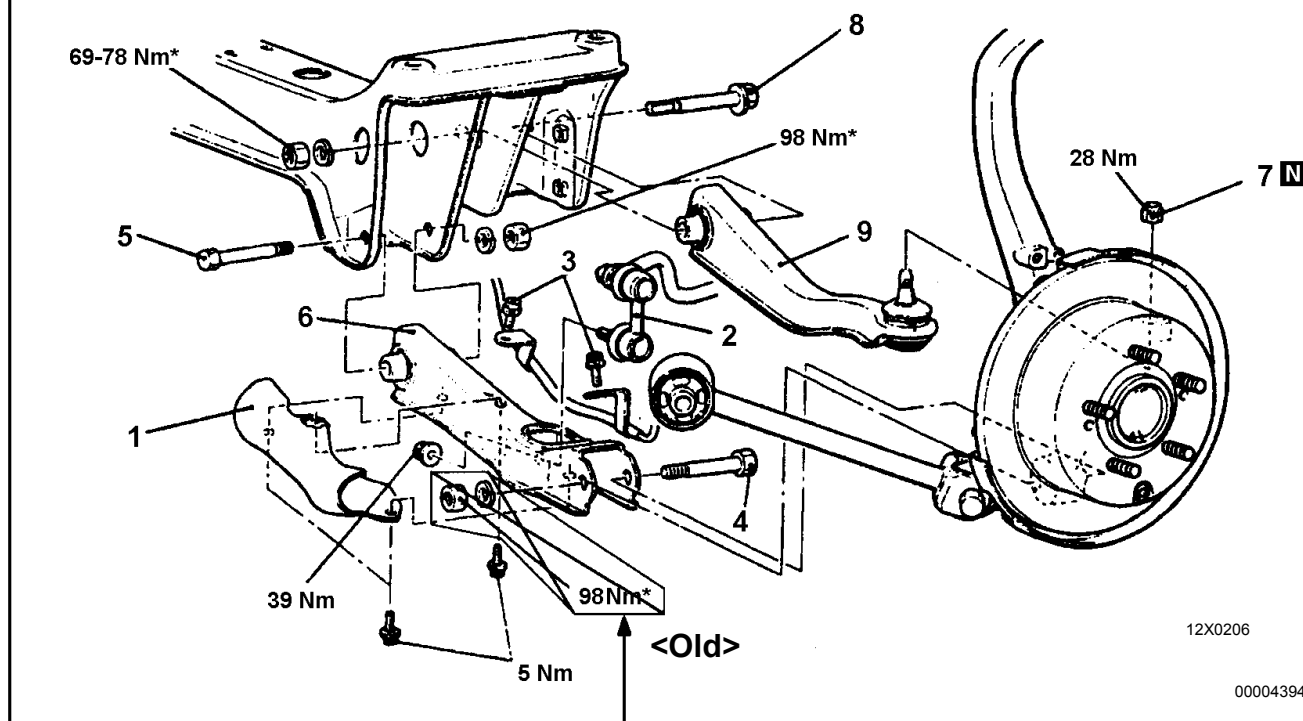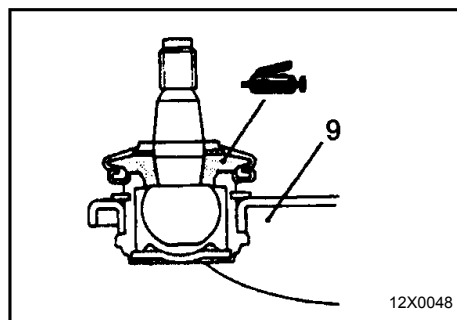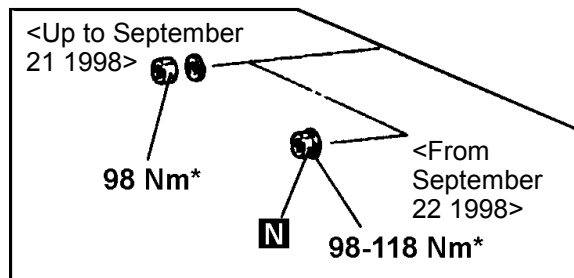

Lower arm assembly removal steps

1. Lower arm cover
2. Stabilizer link ball joint and lower arm connection
3. ABS wheel-speed sensor clamp bolts
4. Lower arm assembly and knuckle connection bolt
5. Lower arm assembly mounting bolt
6. Lower arm assembly

Toe control arm assembly removal steps

7. Toe control arm ball joint and knuckle connection
8. Toe control arm assembly mounting bolt
9. Toe control arm assembly

Caution

*: Indicates parts which should be temporarily tightened, and then fully tightened with the vehicles on the ground in the unladen condition.