

SECTION 3


WIRING DIAGRAM FOR POWER SUPPLIES

CONTENTS

1.	IGNITION SWITCH CIRCUIT	3-2
2.	30 TER "BAT+" POWER SUPPLY CIRCUIT(I.P FUSE BLOCK)	3-2
3.	15 TER "IGN 1" POWER SUPPLY CIRCUIT(I.P FUSE BLOCK)	3-3
4.	15A TER "IGN2", 15C TER "ACC" POWER SUPPLY CIRCUIT(I.P FUSE BLOCK)	3-4
5.	ENGINE FUSE BLOCK & RELAY CIRCUIT	3-5




J3B13002

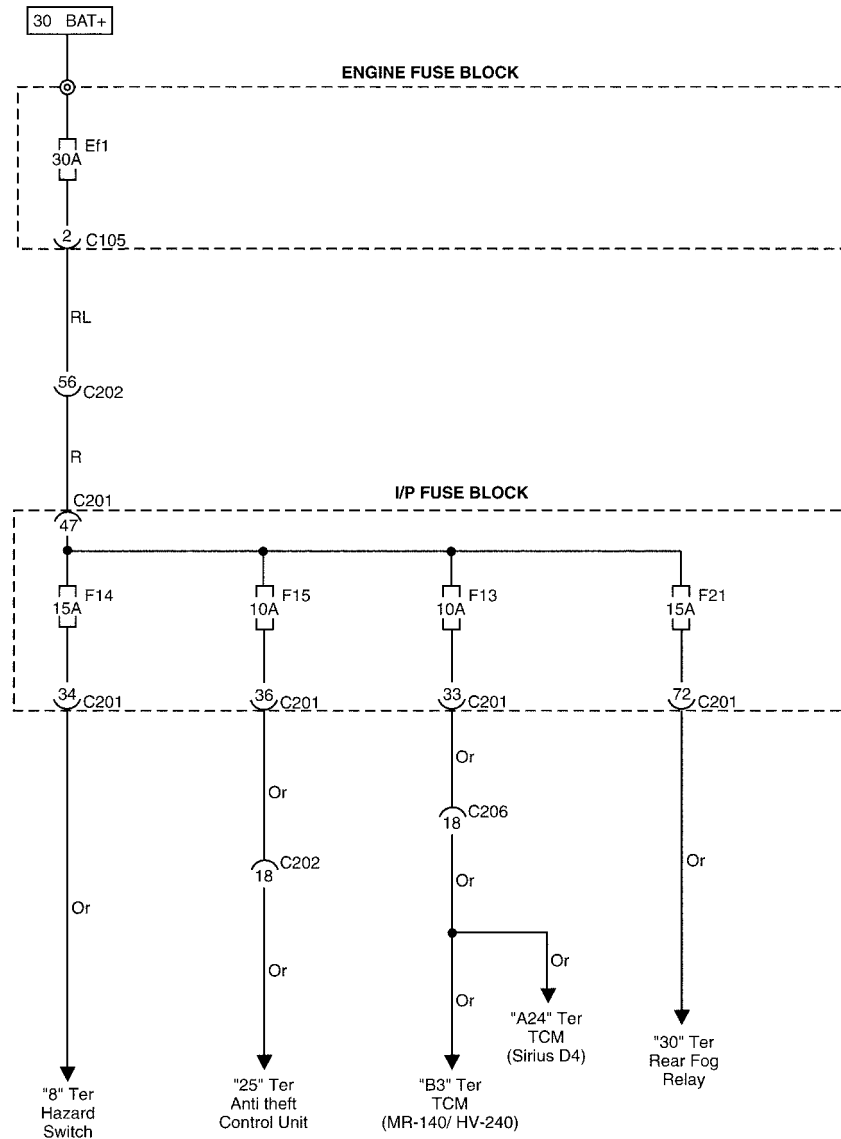


J3B13003

3. 15 TER "IGN1" POWER SUPPLY CIRCUIT (I.P FUSE BLOCK)

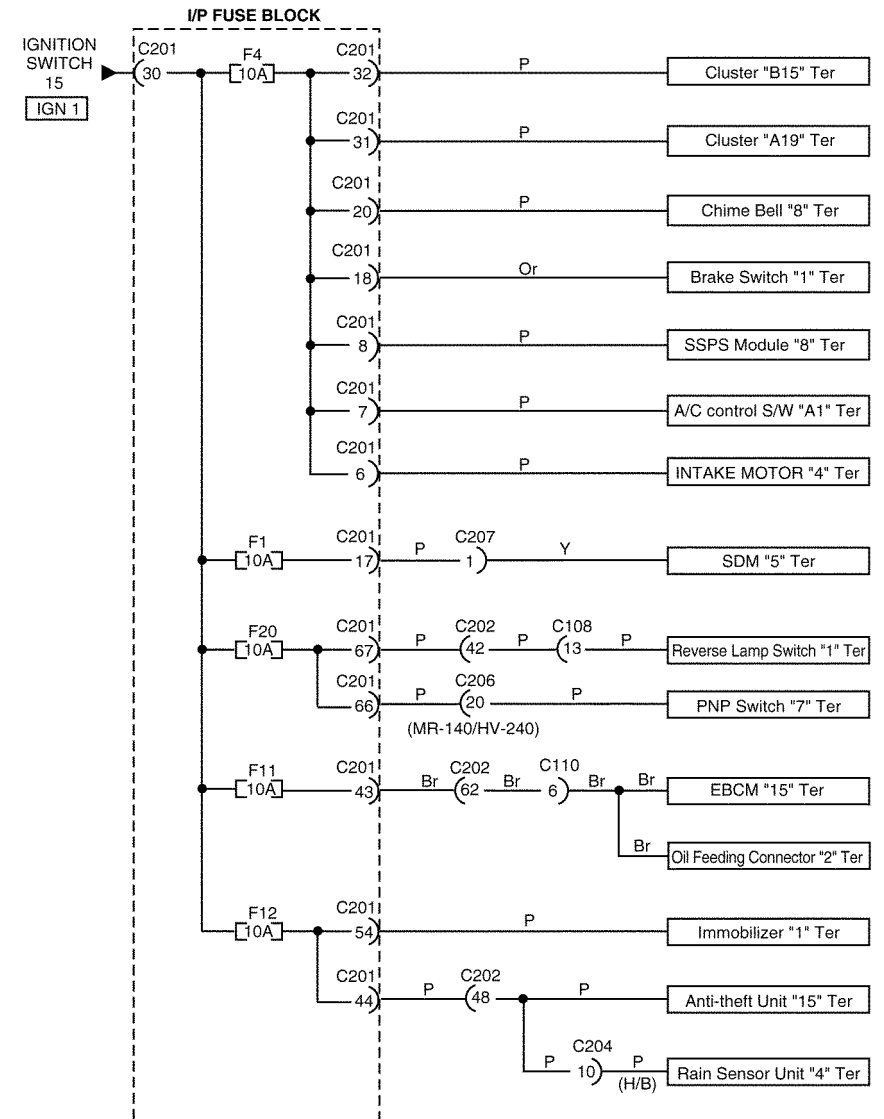


J3D13015

4. 15A TER "IGN2", 15C TER "ACC" POWER SUPPLY CIRCUIT (I.P FUSE BLOCK)

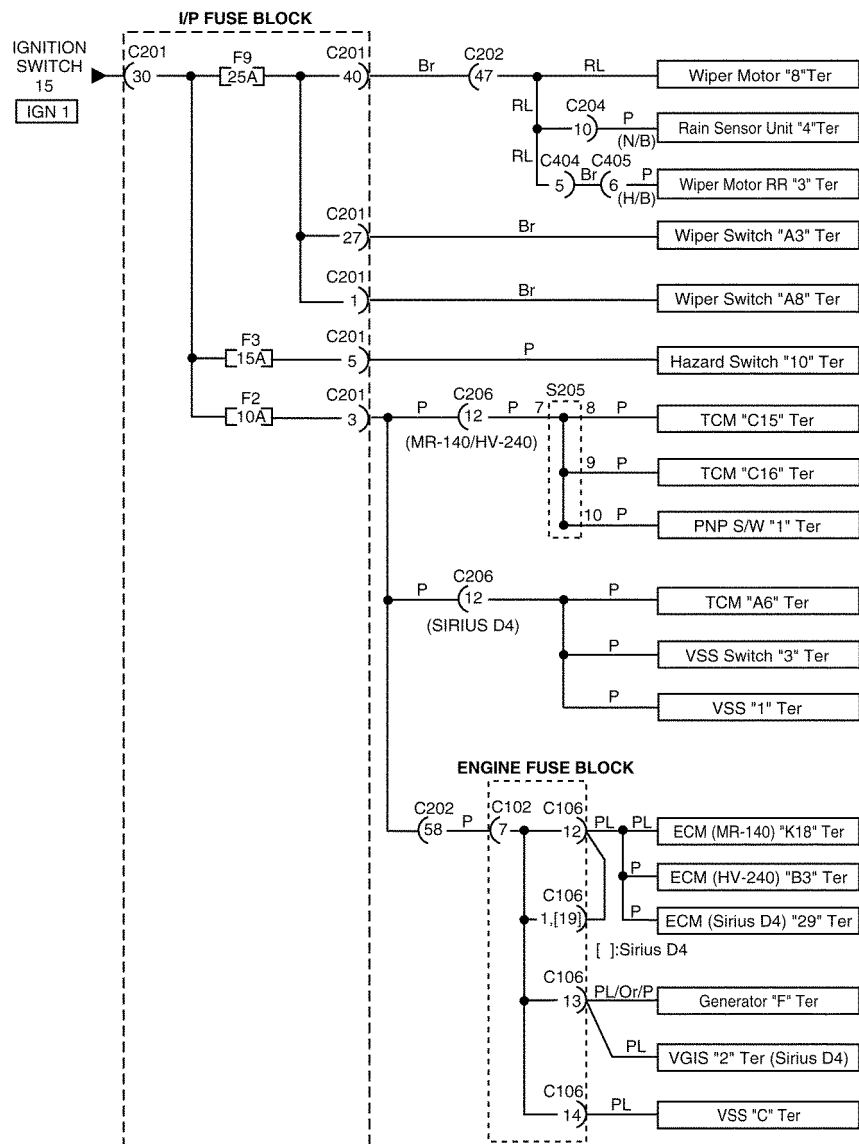


J3D13016

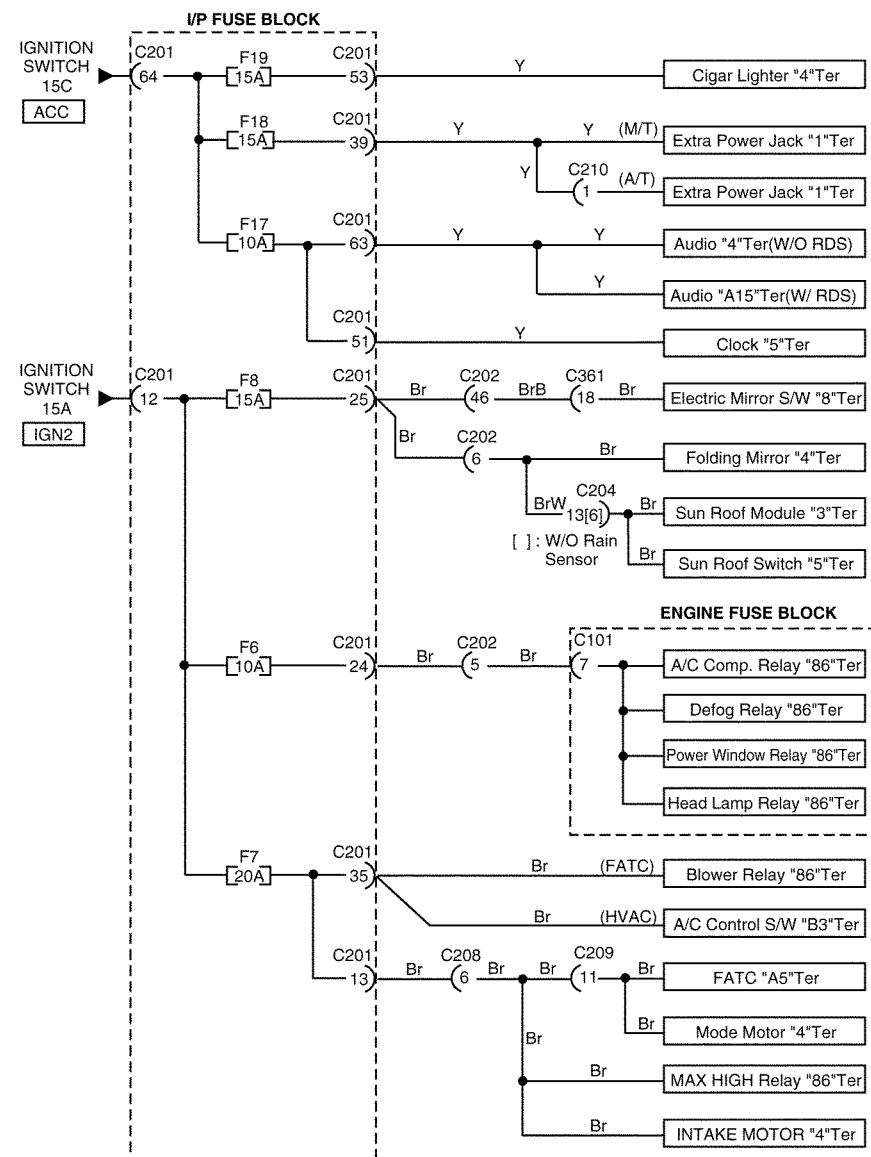



J3D13017

5. ENGINE FUSE BLOCK & RELAY CIRCUIT

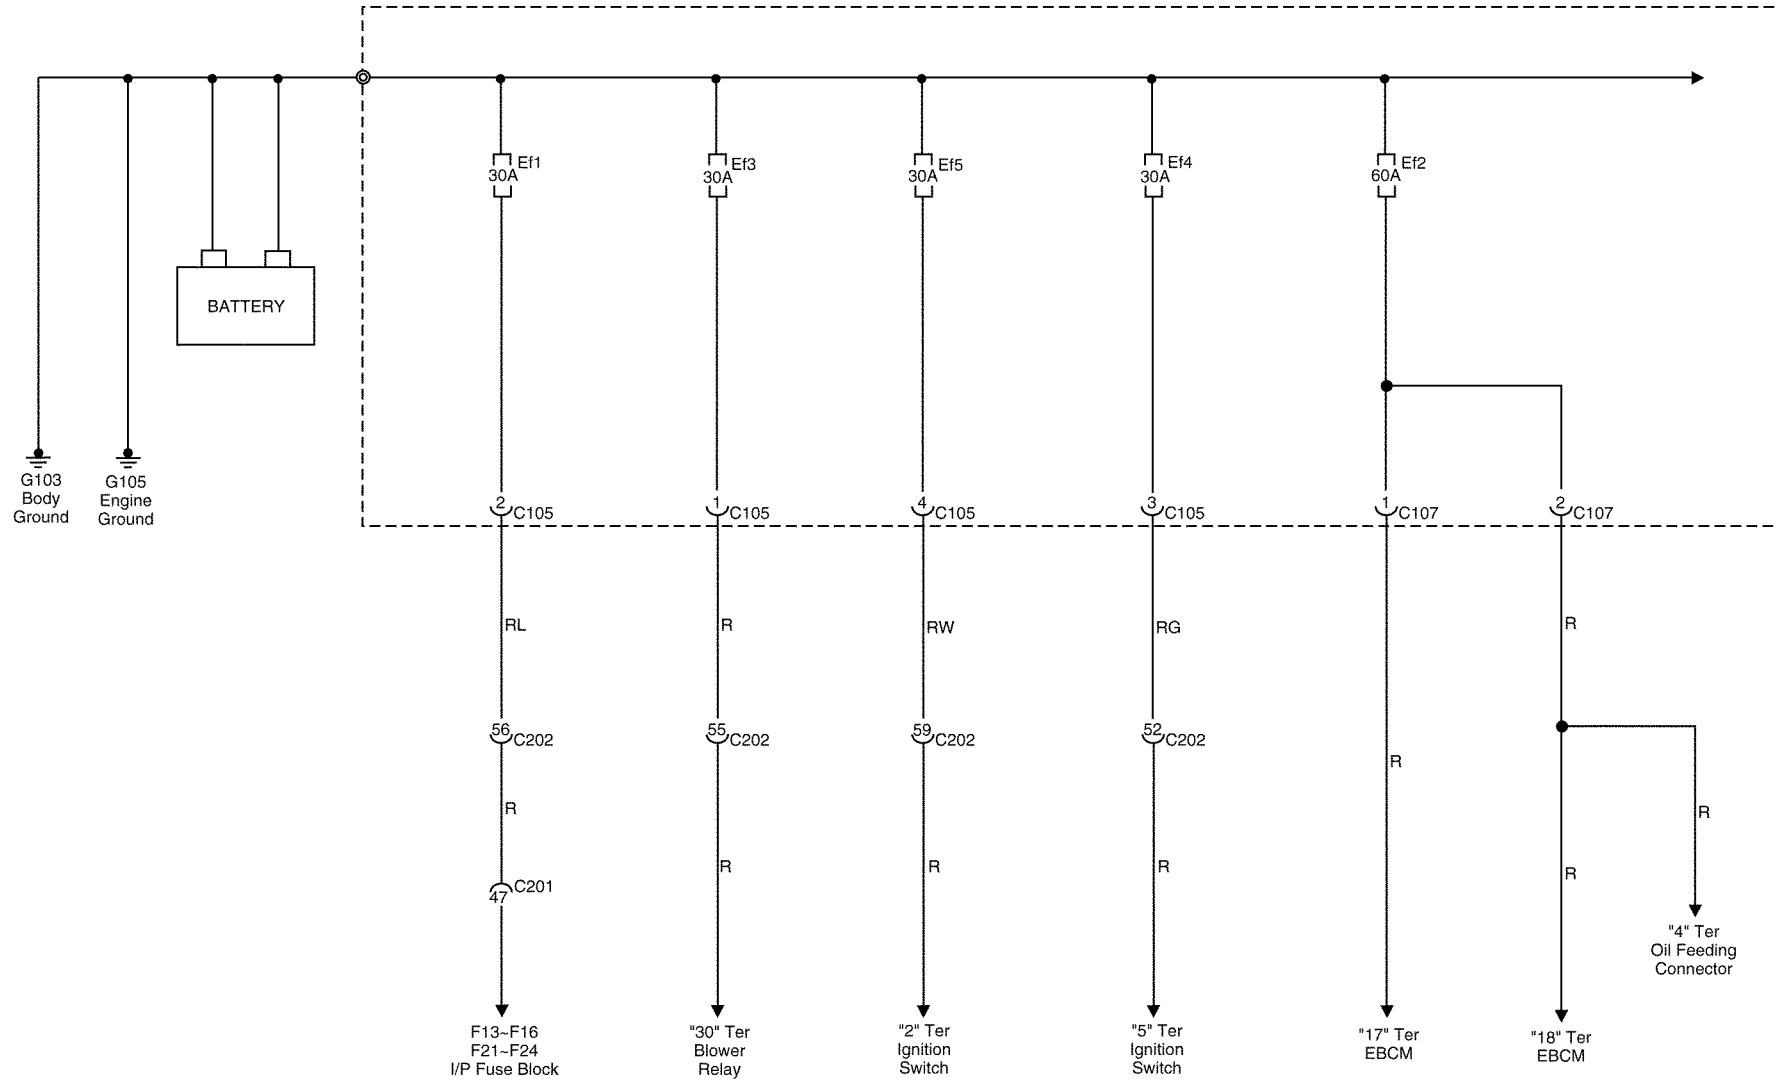



3-6 WIRING DIAGRAM FOR POWER SUPPLIES

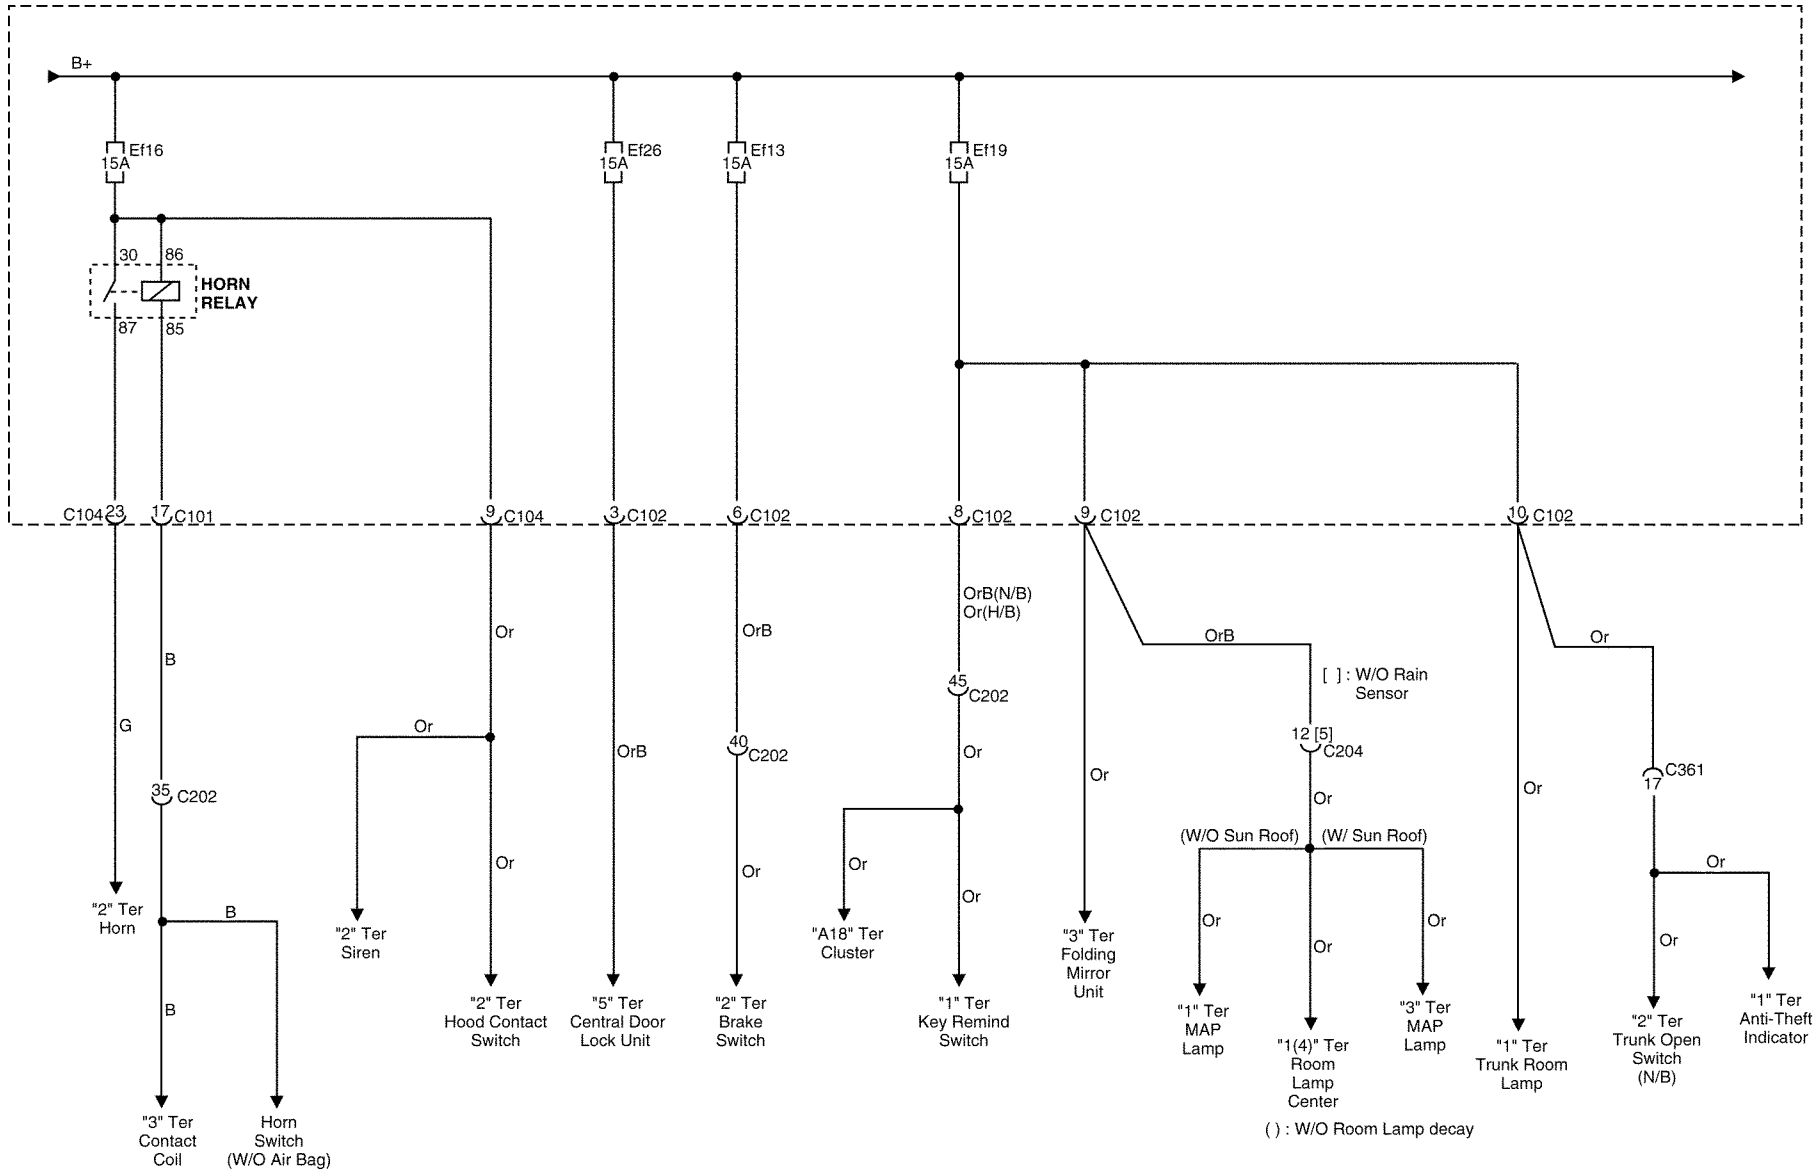


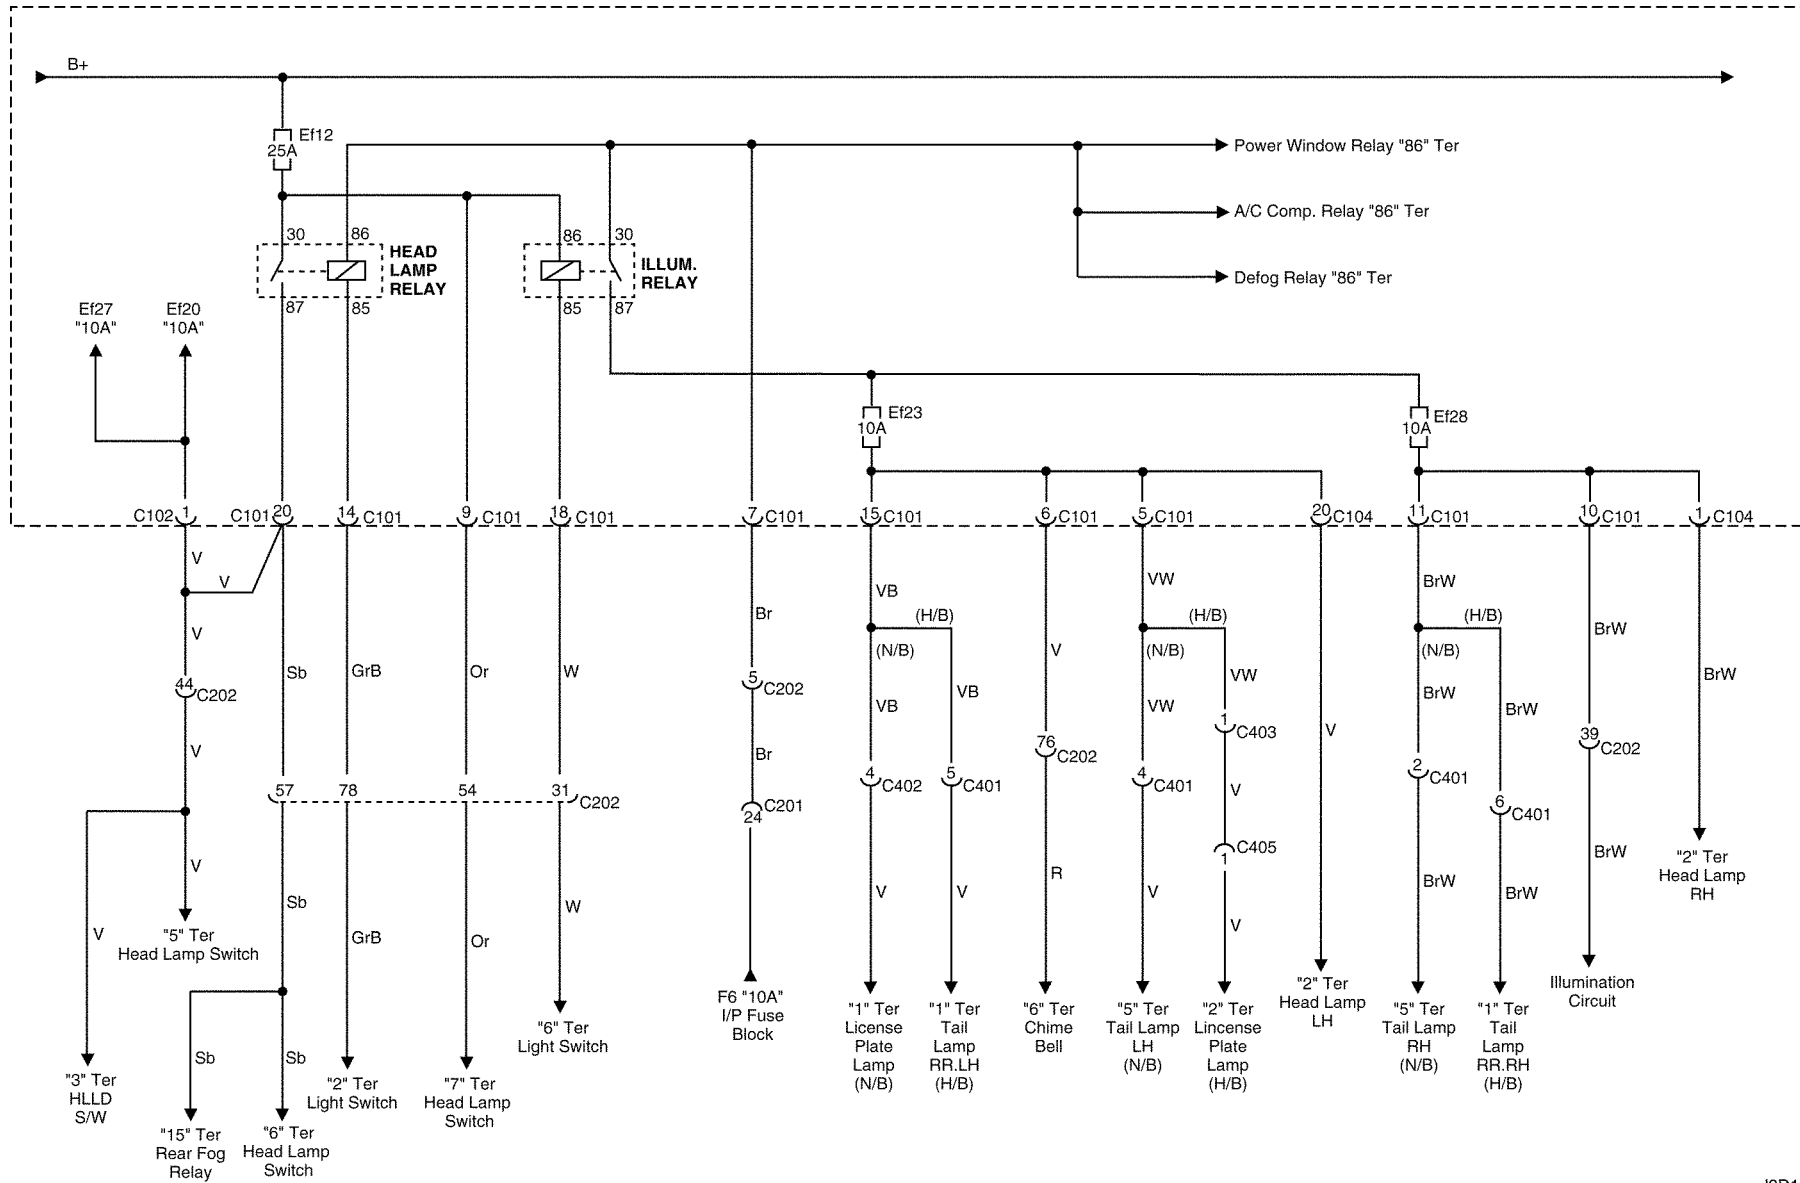



3-8 WIRING DIAGRAM FOR POWER SUPPLIES

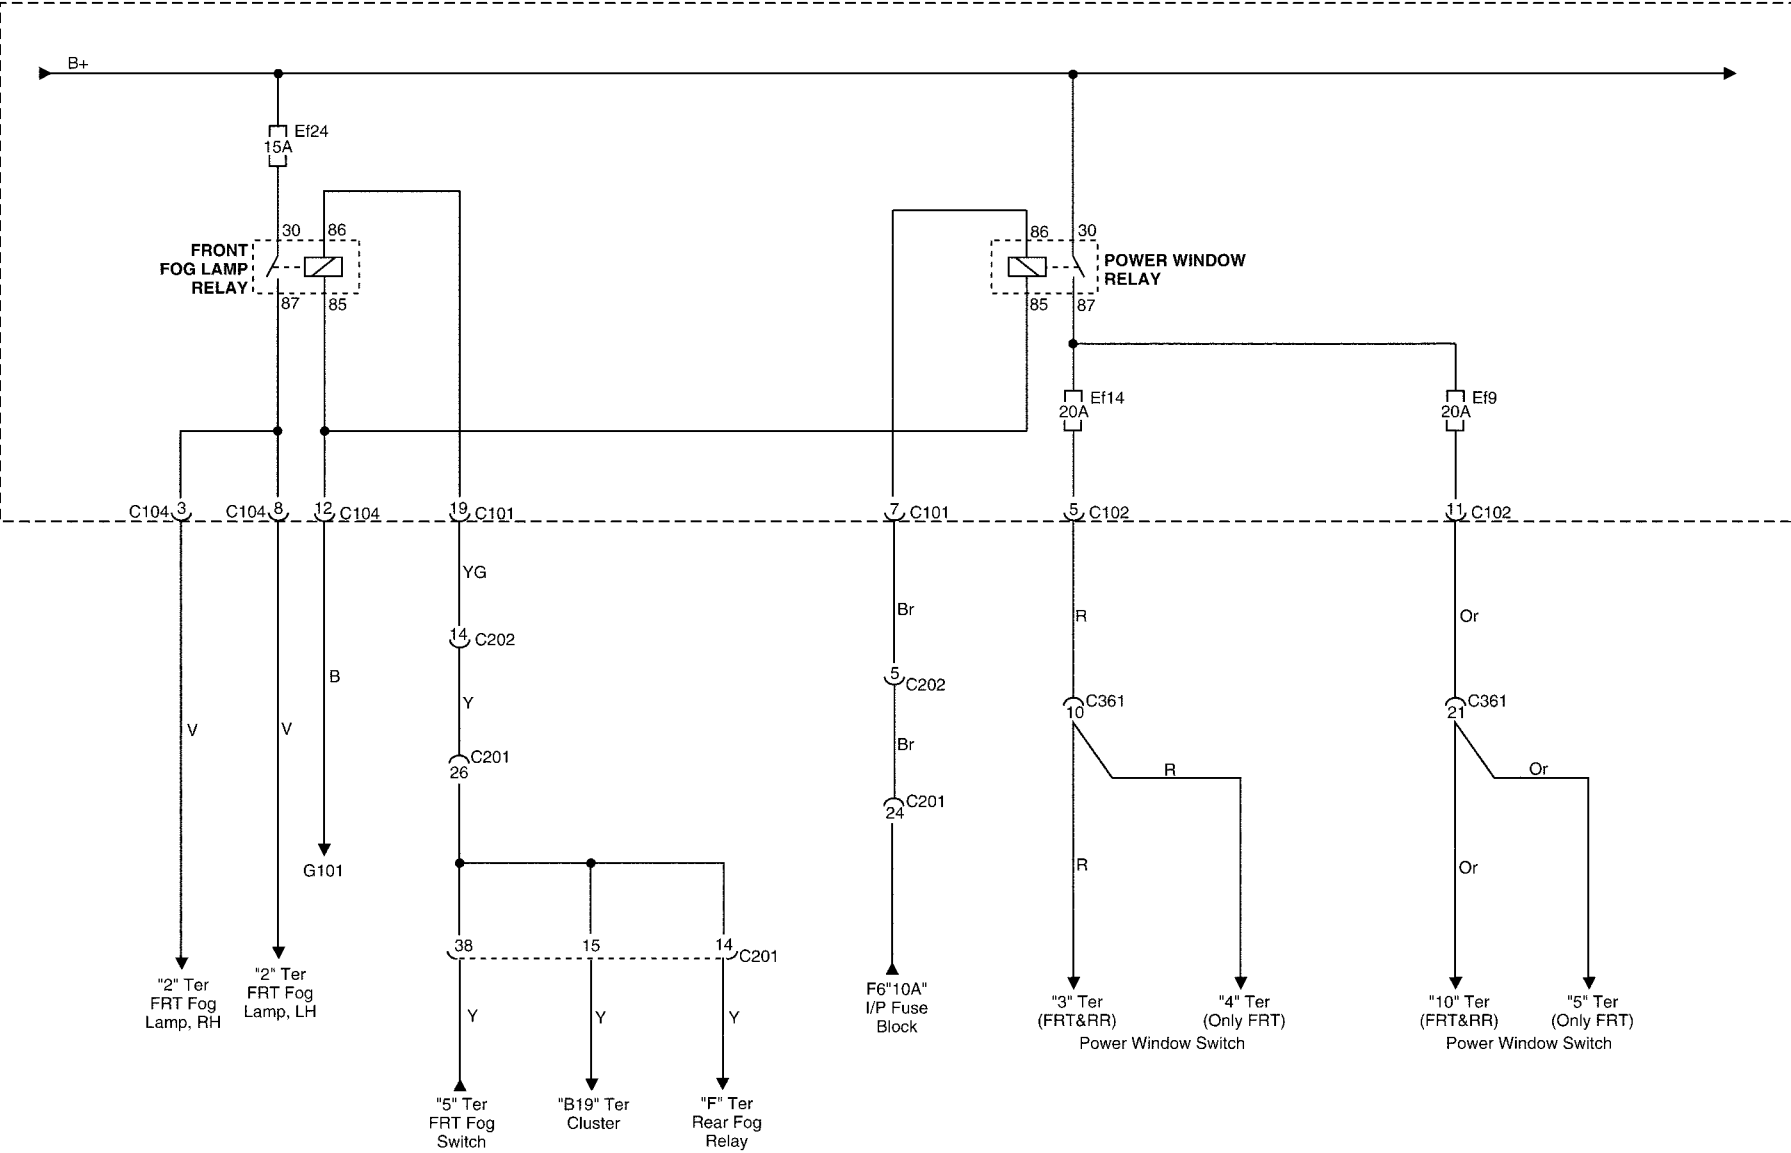


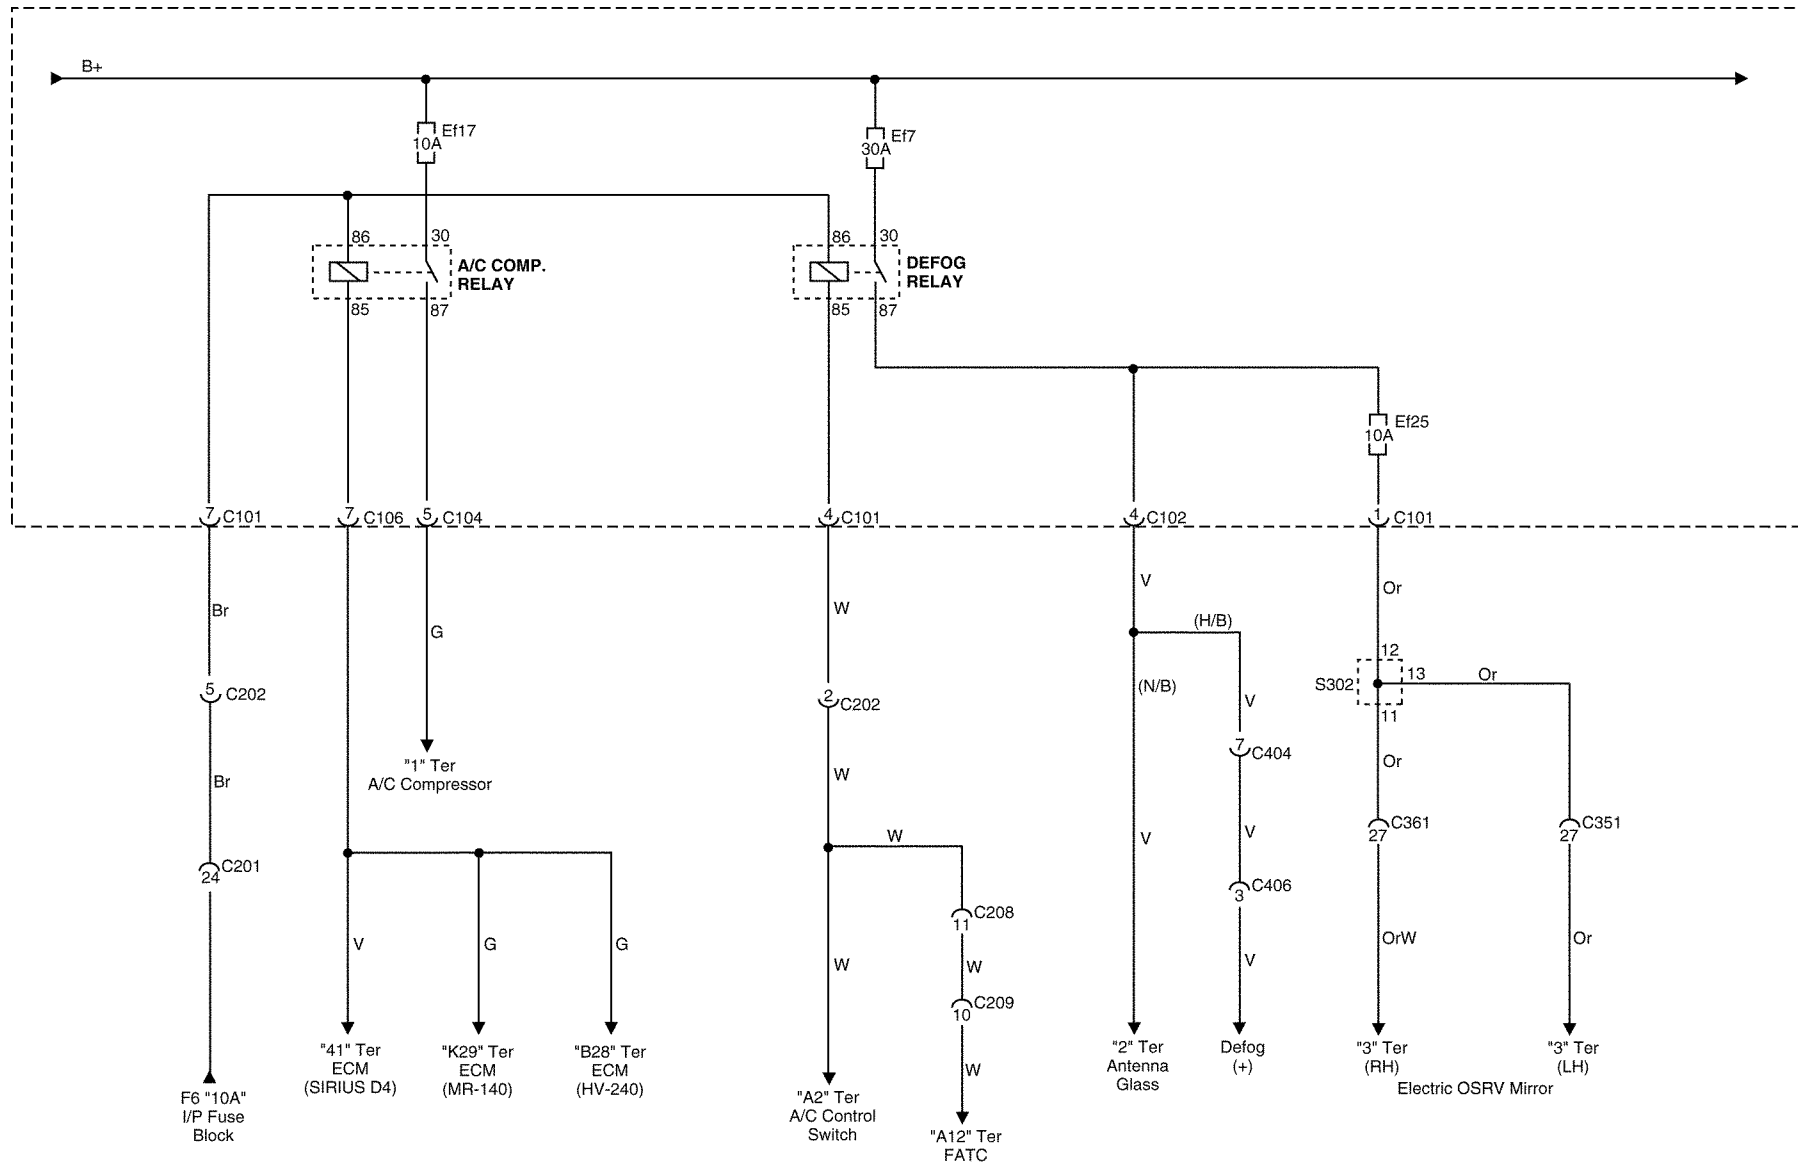

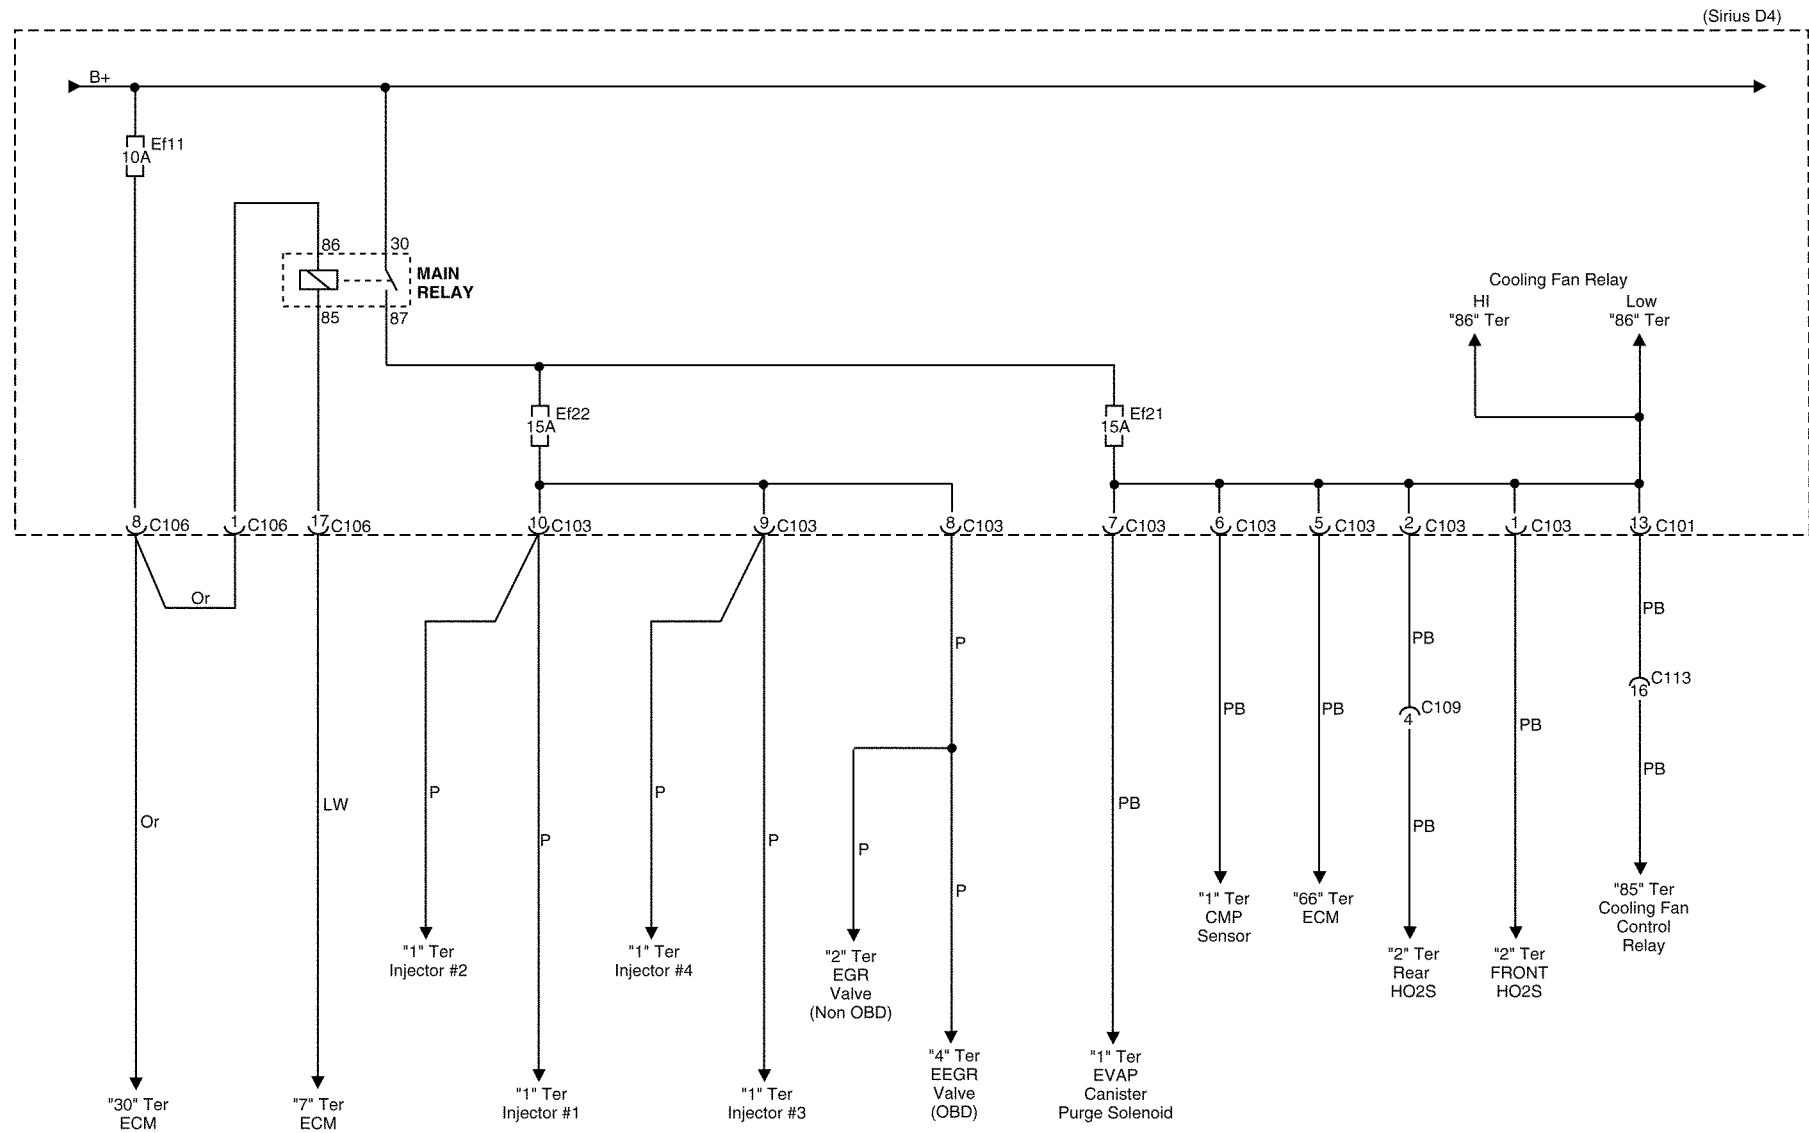


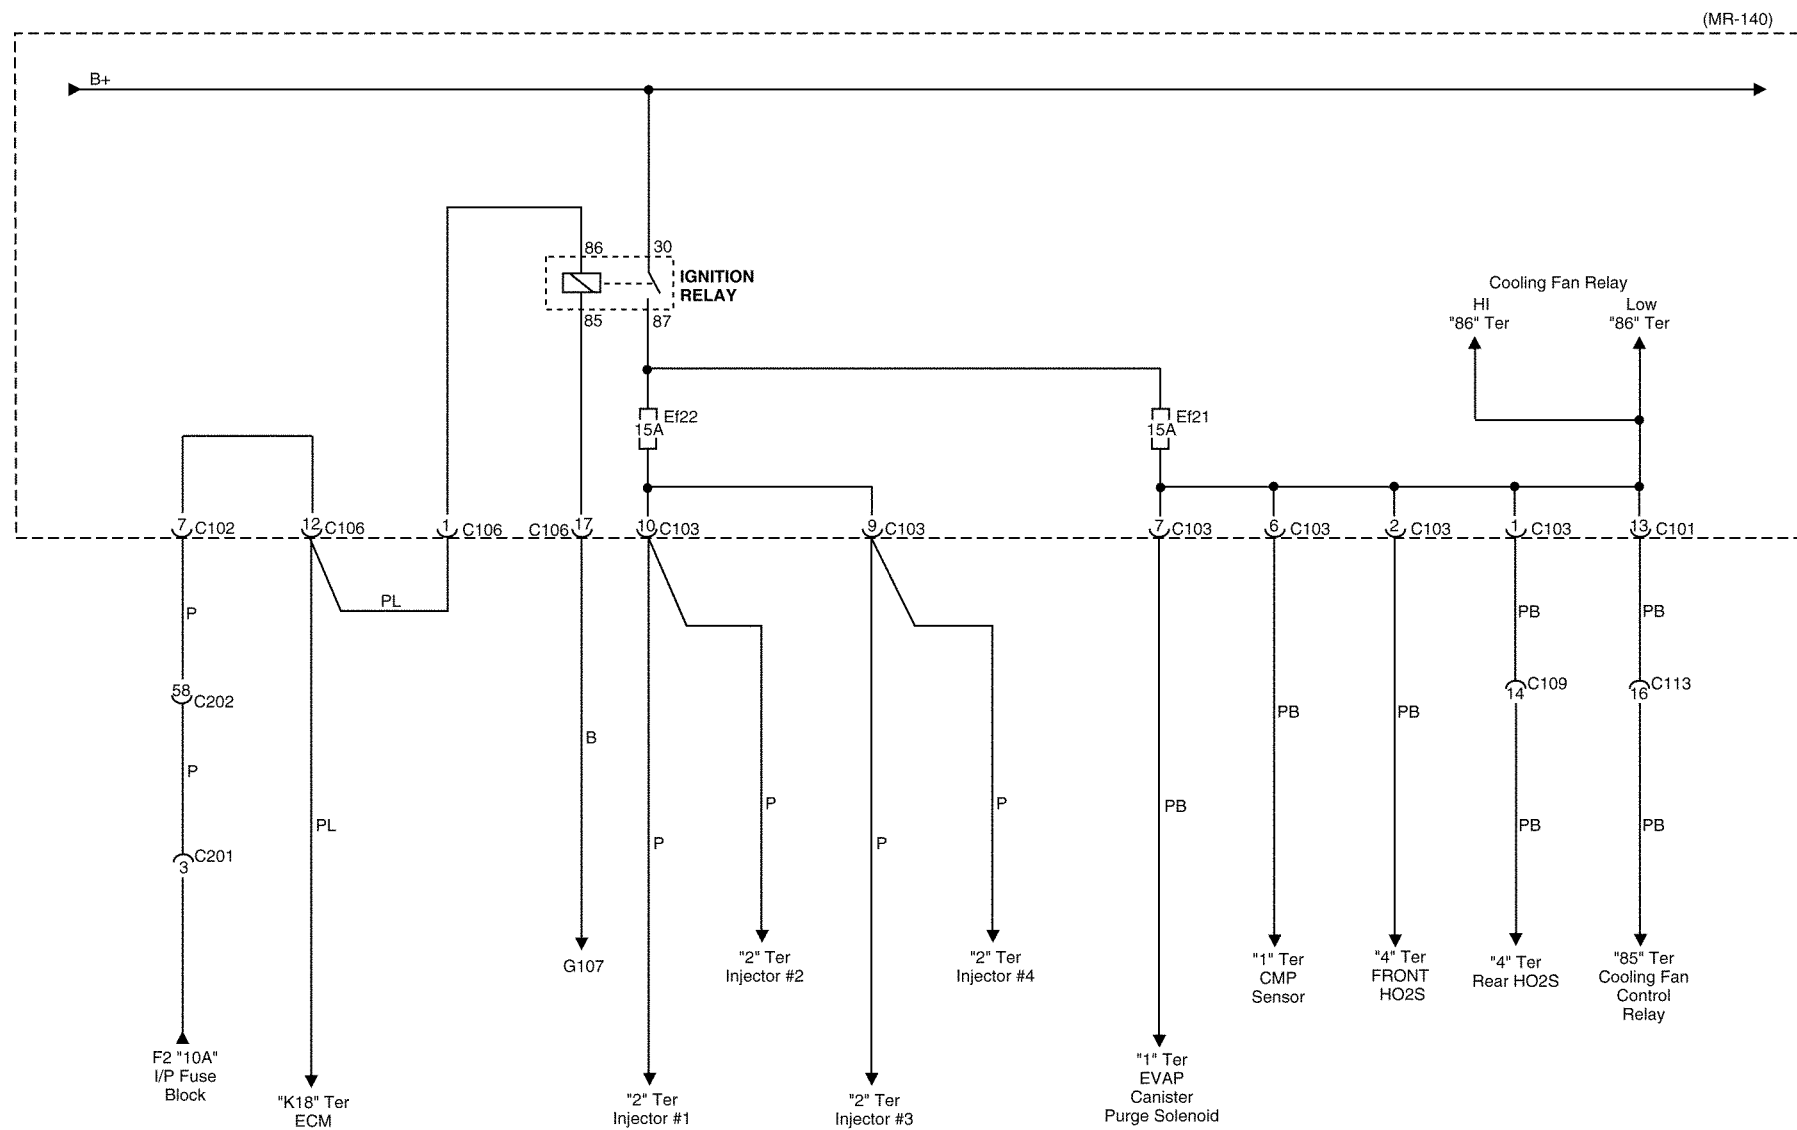

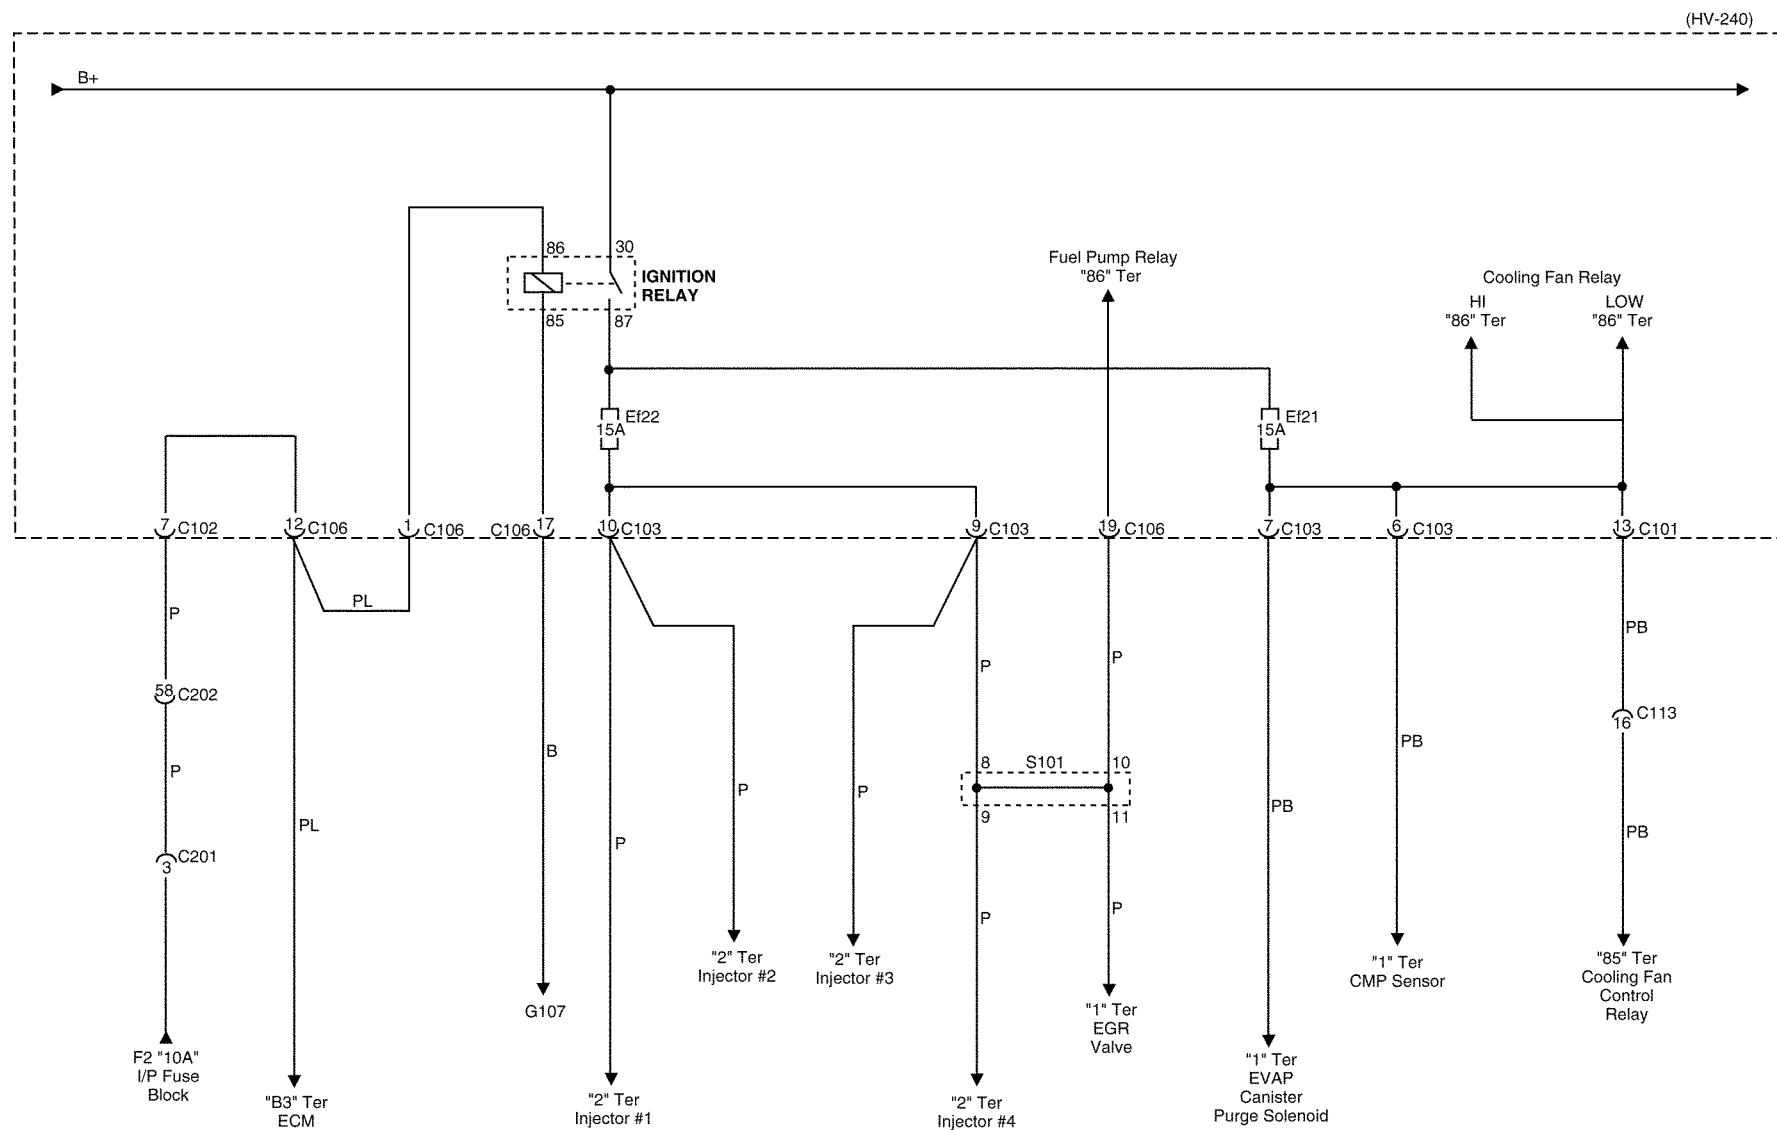

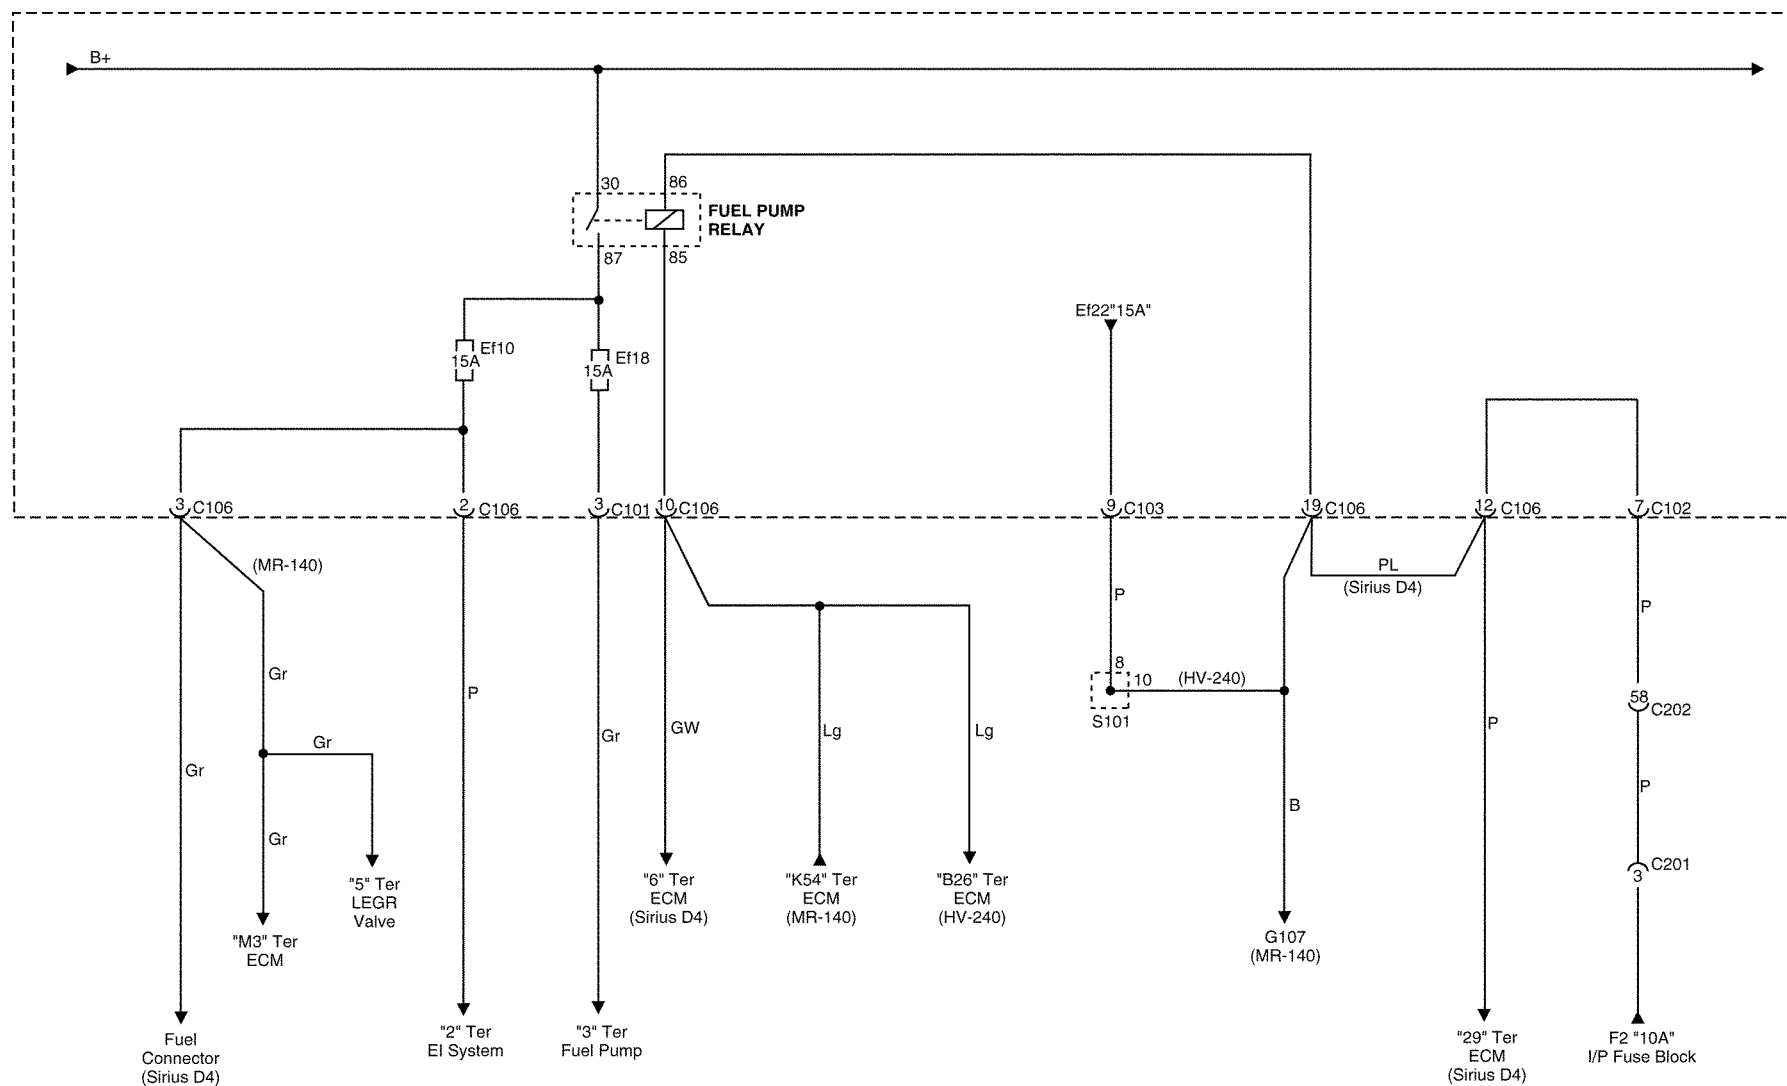

3-14 WIRING DIAGRAM FOR POWER SUPPLIES

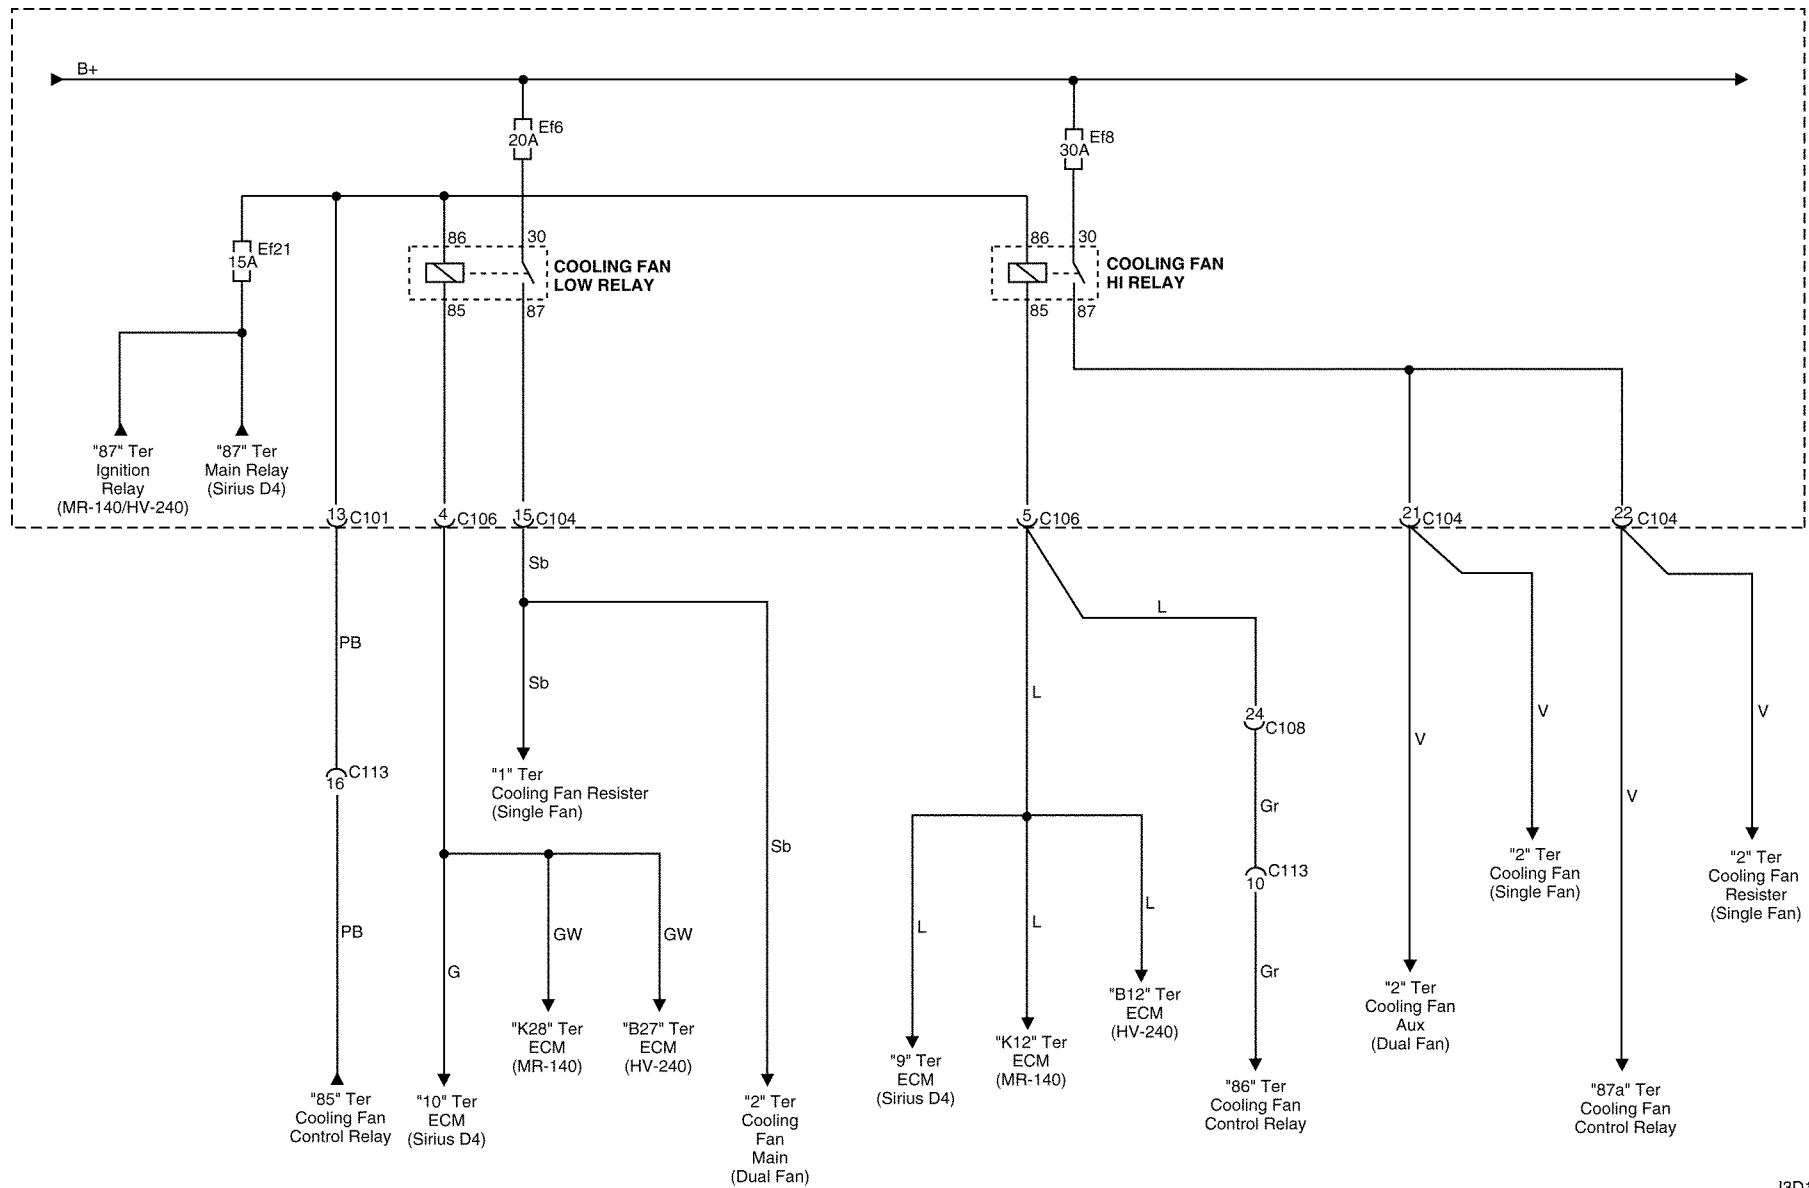

J3D13012

