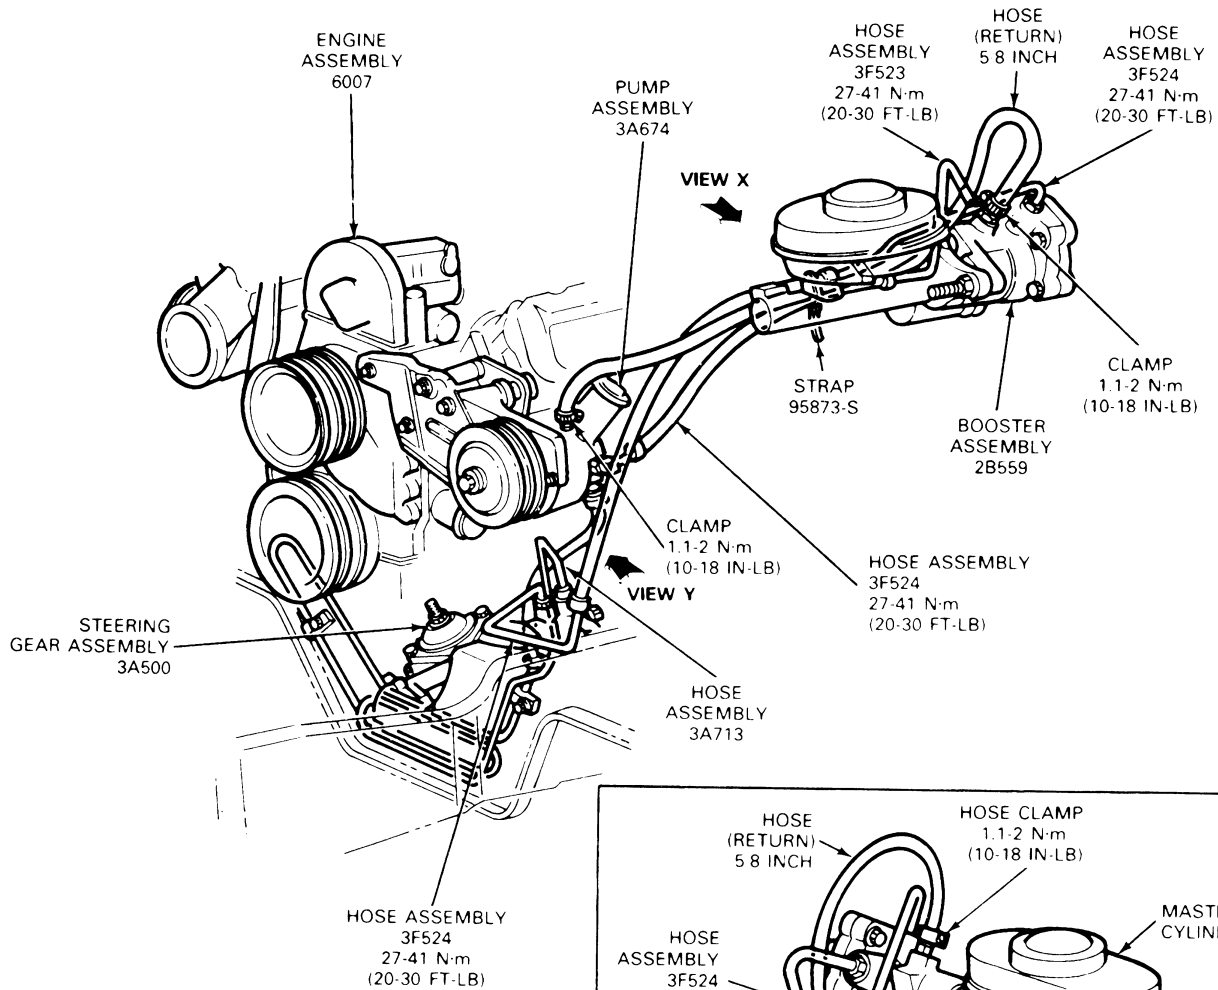

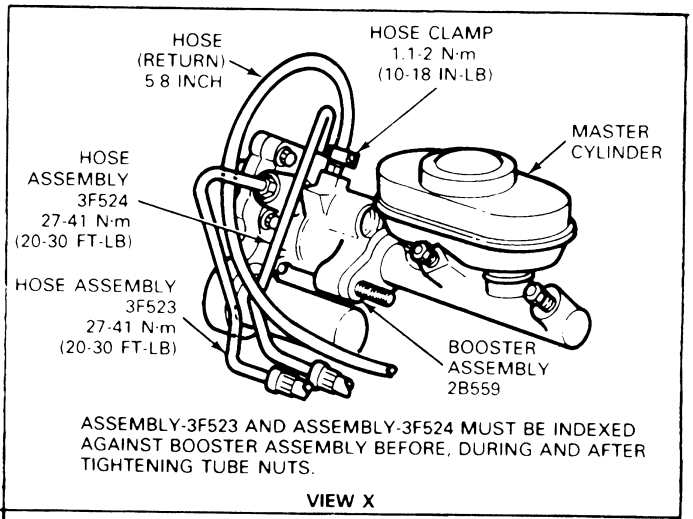

ASSEMBLY-3F523 AND ASSEMBLY-3F524 MUST BE INDEXED AGAINST BOOSTER ASSEMBLY BEFORE, DURING AND AFTER TIGHTENING TUBE NUTS.

VIEW X

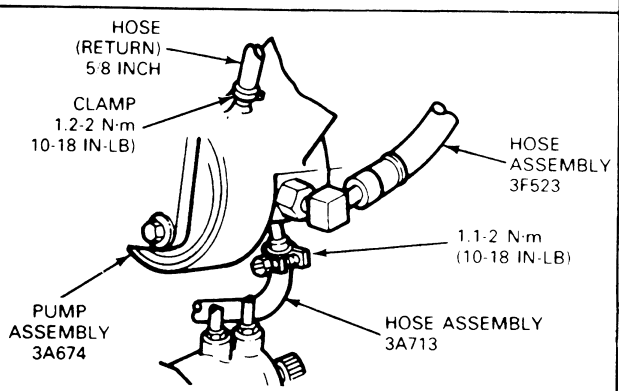

INSTALLATION – 7.5L ENGINE ONLY
VIEW Y

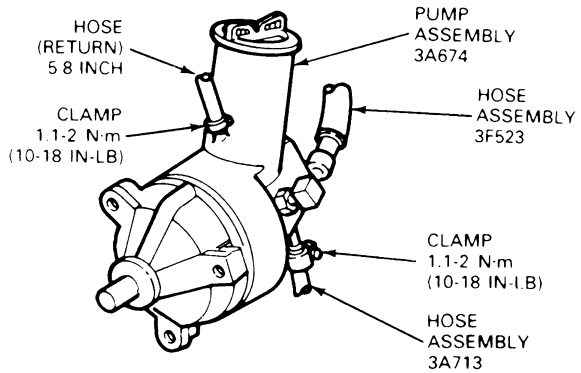

7.3L DIESEL ONLY
VIEW Y