

Bumpers and Fascias


cardiagn.com

Repair Instructions

cardiagn.com

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Energy Absorber Replacement

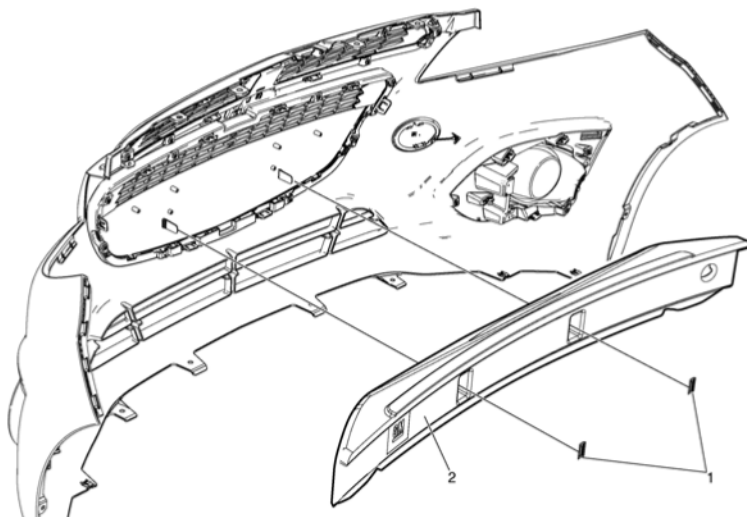



cardiagn.com

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement .	
1	Front Bumper Energy Absorber Clip
2	Front Bumper Energy Absorber

Related Part Information

Part Name	Catalog Name	Part Code
Front Bumper Energy Absorber	ABSORBER,FRT BPR ENGY 5750A	
Front Bumper Energy Absorber	ABSORBER,FRT BPR ENGY 5750B	

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Impact Bar Replacement

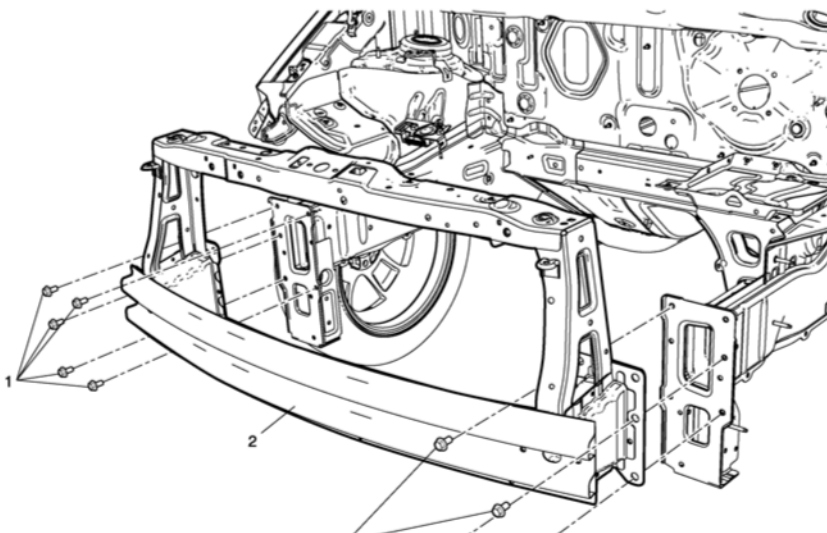



[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
1. Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement .	
2. Remove the headlamp. Refer to Front Headlamp Replacement .	
3. Remove the air cleaner assembly. Refer to Air Cleaner Assembly Replacement .	
4. Remove the hood primary and secondary latch. Refer to Hood Primary and Secondary Latch Replacement .	
5. Remove the radiator support bracket. Refer to Radiator Support Bracket Replacement .	
6. Remove the horn. Refer to Horn Replacement .	

Callout	Component Name
1	Front Bumper Impact Bar Bolt (Qty:â€‰9) Caution: Refer to Fastener Caution . Tighten 22â€‰N-m (16 lbâ€‰ft)
2	Front Bumper Impact Bar


Related Part Information

Part Name	Catalog Name	Part Code
Front Bumper Impact Bar	BAR KIT,FRT BPR IMP	0124Z
Front Bumper Impact Bar	BAR,FRT BPR IMP	0125A
Front Bumper Impact Bar	BAR,FRT BPR IMP	0150A
Front Bumper Impact Bar	BAR,FRT BPR IMP	0150B
Front Bumper Impact Bar	BAR,FRT BPR IMP (W/ F/END PNL)	0152A
Front Bumper Impact Bar Bumper	BUMPER,FRT BPR IMP BAR	2625A
Front Bumper Impact Bar	BAR PKG,FRT BPR IMP	SJ134

cardiagn.com

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Lower Impact Bar Replacement

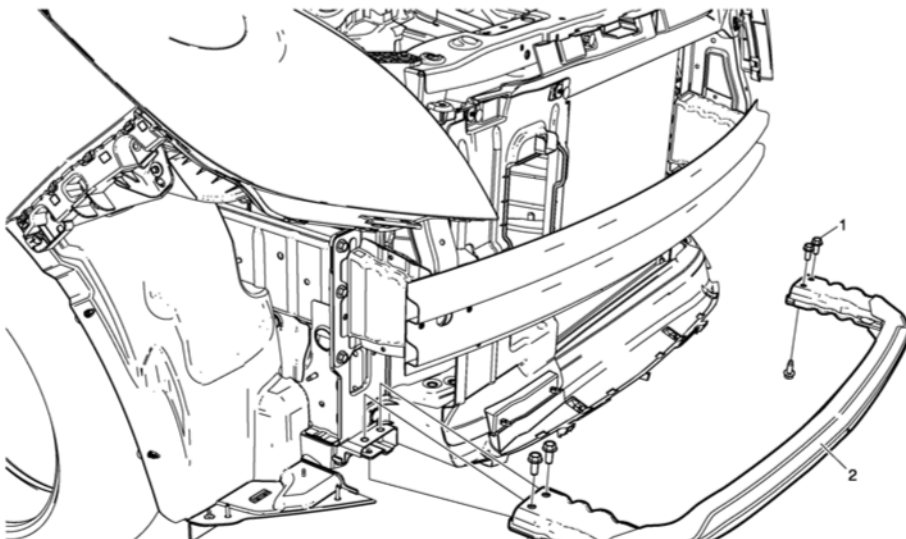



cardiagn.com

[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement .	
1	Front Bumper Lower Impact Bar Bolt (Qty:6)
	Caution:
	Refer to Fastener Caution .
	Tighten
2	25 N-m (18 lb-ft)
	Front Bumper Lower Impact Bar

Related Part Information

Part Name	Catalog Name	Part Code
Front Bumper Lower Impact Bar	BAR,FRT BPR LWR IMP	0098Y


Part Name	Catalog Name	Part Code
Front Bumper Lower Impact Bar	BAR,FRT BPR LWR IMP	0099A
Front Bumper Lower Impact Bar	BAR,FRT BPR LWR IMP	0100A

cardiagn.com


1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Replacement (PMC)


Removal Procedure

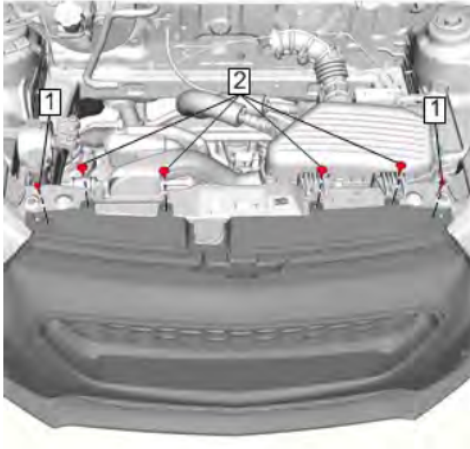


1.
[Click here for full size](#)
2. Front Bumper Fascia Upper Bolt (1>) >> Remove [2>x]
3. Front Bumper Fascia Retainer (2>) >> Remove [4>x]

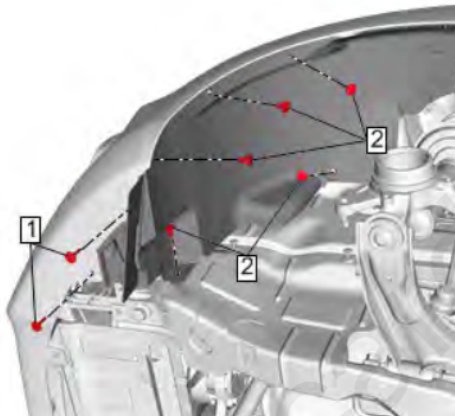

4.
[Click here for full size](#)
5. Front Wheelhouse Liner Bolt (1>) >> Remove [2>x]
6. Front Wheelhouse Liner Retainer (2>) >> Remove [5>x]

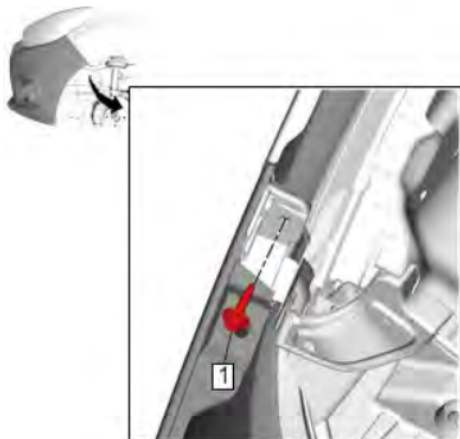

7.
[Click here for full size](#)
8. Front Bumper Fascia Guide Bolt (1>) >> Remove [2>x]

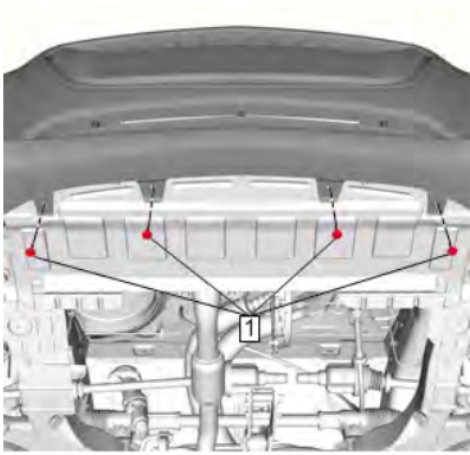

9.

[Click here for full size](#)

10. Front Bumper Fascia Lower Bolt (1>) >> Remove [4>x]



11.

[Click here for full size](#)

12. Release the integral retainers at both fenders and headlamps.

13. Lift fascia off of headlamp retaining tabs, then Carefully pull the front bumper fascia outward to remove.

14. Disconnect all electrical connectors.

Installation Procedure



1.


[Click here for full size](#)

2. Transfer components as necessary.

3. Connect all electrical connectors.

4. Front Bumper Fascia (1>) >> Install

5. Carefully push in the retaining tabs of the front bumper fascia into the front bumper fascia guides.

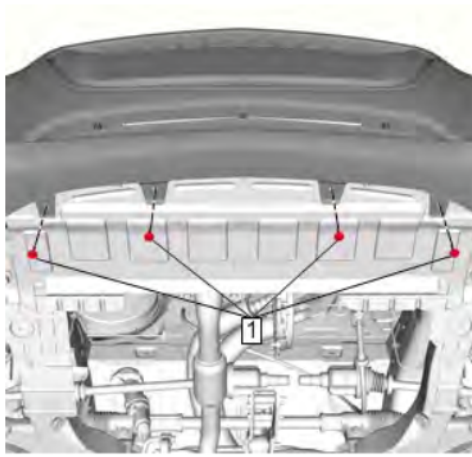


6.

[Click here for full size](#)

7. Caution :

[Fastener Caution](#)


8. Front Bumper Fascia Lower Bolt (1>) >> Install and tighten [4>x]1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)

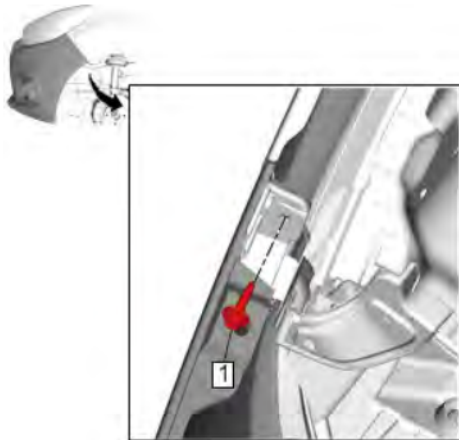

9.

[Click here for full size](#)

10. Front Bumper Fascia Guide Bolt (1>) >> Install and tighten [2>x]2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)

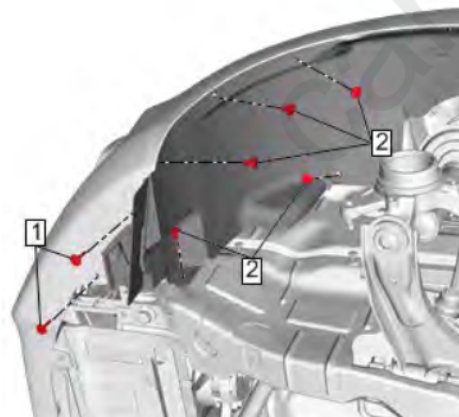


11.

[Click here for full size](#)

12. Front Wheelhouse Liner Bolt (1>) >> Install and tighten [2>x]1.5N-m (13 lb in)

13. Front Wheelhouse Liner Retainer (2>) >> Install [5>x]

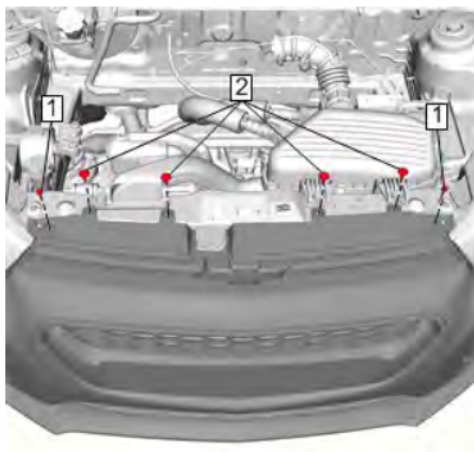

14.

[Click here for full size](#)

15. Front Bumper Fascia Upper Bolt (1>) >> Install and tighten [2>x]2.5â€%N-mâ€%(22â€%lbâ€%in)


16. Front Bumper Fascia Retainer (2>) >> Install [4>x]

Related Part Information

Part Name	Catalog Name	Part Code
Front Bumper Fascia	FASCIA,FRT BPR (W/IMP BAR)	2874B
Front Bumper Fascia	FASCIA,FRT BPR (W/FRT LWR GRL)	2874C
Front Bumper Fascia	FASCIA KIT,FRT BPR	2874Z
Front Bumper Fascia	FASCIA,FRT BPR	2875A
Front Bumper Fascia	FASCIA PKG,FRT BPR	2876A
Front Bumper Fascia	FASCIA,FRT BPR	2900A

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Replacement

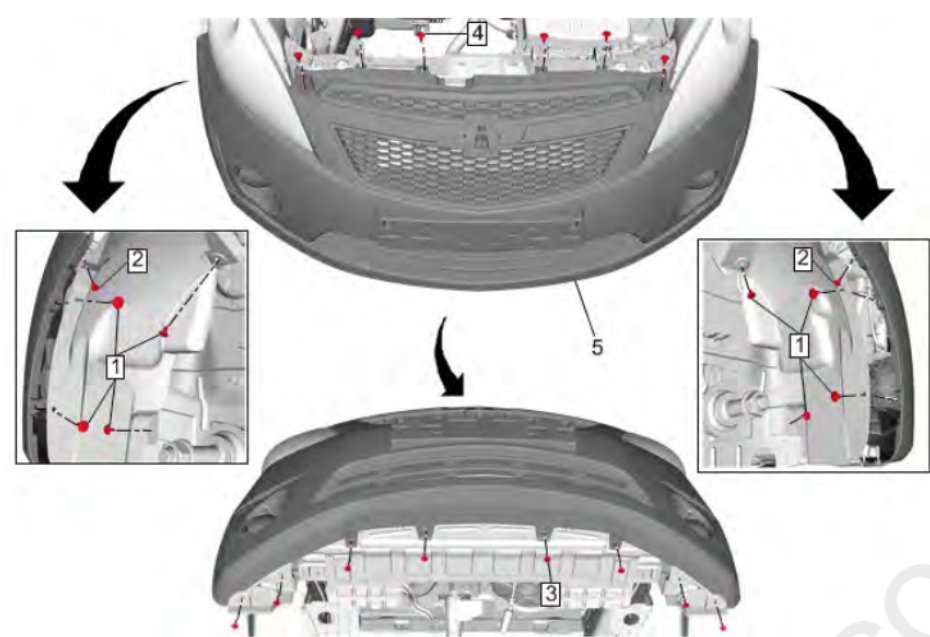


[Click here for full size](#)

Callout	Component Name
1	Front Wheelhouse Liner Retainer (Qty:â€™%08)
2	Front Bumper Fascia Side Screw (Qty:â€™%02) Caution: Refer to Fastener Caution . Tighten 2.5â€™%N-m (22 lbâ€™%in)
3	Front Bumper Fascia Screw (Qty:â€™%08) Tighten 1.5â€™%N-m (13 lbâ€™%in)
4	Front Bumper Fascia Retainer (Qty:â€™%06)
5	Front Bumper Fascia Procedure 1. Unclip from front bumper fascia guides. 2. Pull forward to remove the front bumper fascia. 3. Disconnect any electrical connectors. 4. Transfer parts as needed.

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Guide Replacement

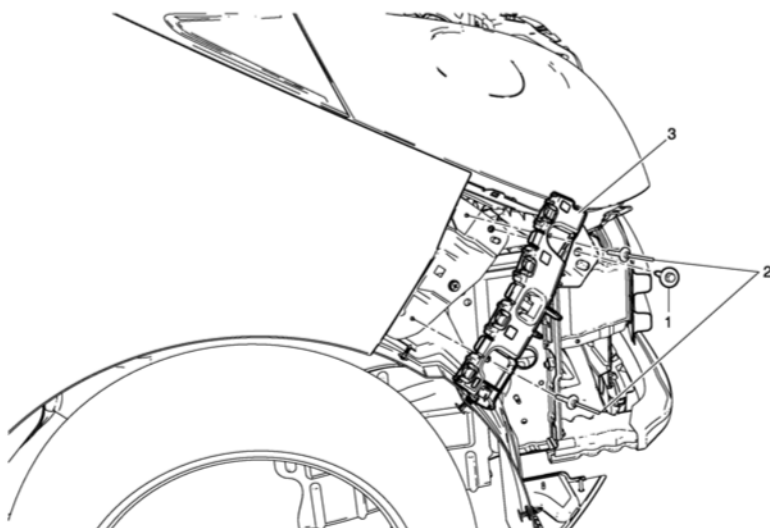




cardiagn.com

[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement .	
1	Headlamp Screw Caution: Refer to Fastener Caution . Tighten 2.5â€”N-m (22â€”lbâ€”in)
2	Front Bumper Fascia Guide Rivet (Qty:â€”2) Special Tools <i>BO-594-A</i> Hand Rivet Tongs For equivalent regional tools, refer to Special Tools .
3	Front Bumper Fascia Guide

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Guide Replacement (PMC)

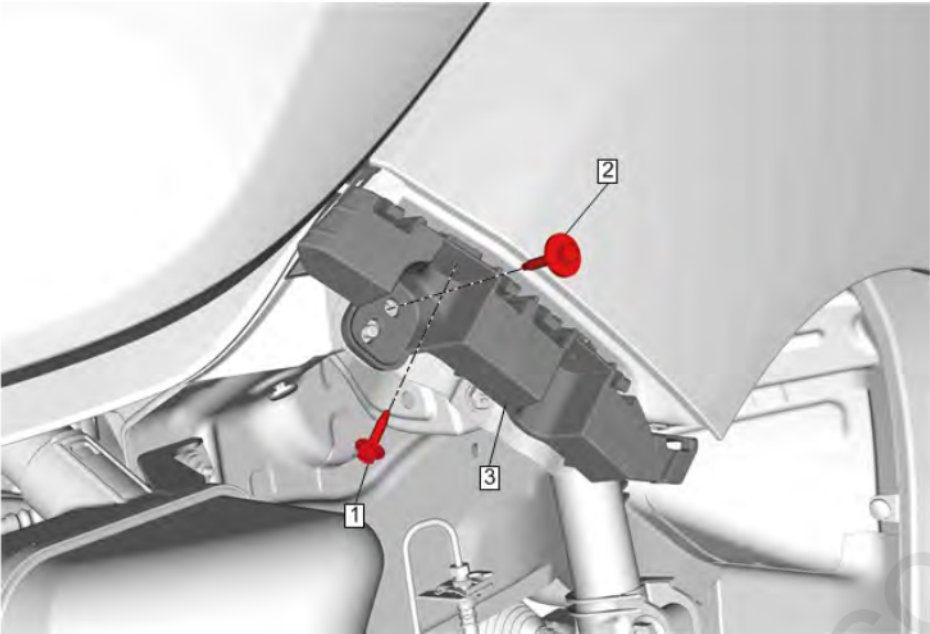

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Front Bumper Fascia Replacement	
1	Front Bumper Fascia Guide Bolt Caution: Refer to Fastener Caution . Tighten 2.5N-m (22 lb in)
2	Headlamp Bolt Tighten 2.5N-m (22 lb in)
3	Front Bumper Fascia Guide

Related Part Information

Part Name	Catalog Name	Part Code
Front Bumper Fascia Guide	GUIDE,FRT BPR FASCIA	2964A
Front Bumper Fascia Guide	GUIDE,FRT BPR FASCIA	2965A

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Lower Fascia Replacement (Activ)

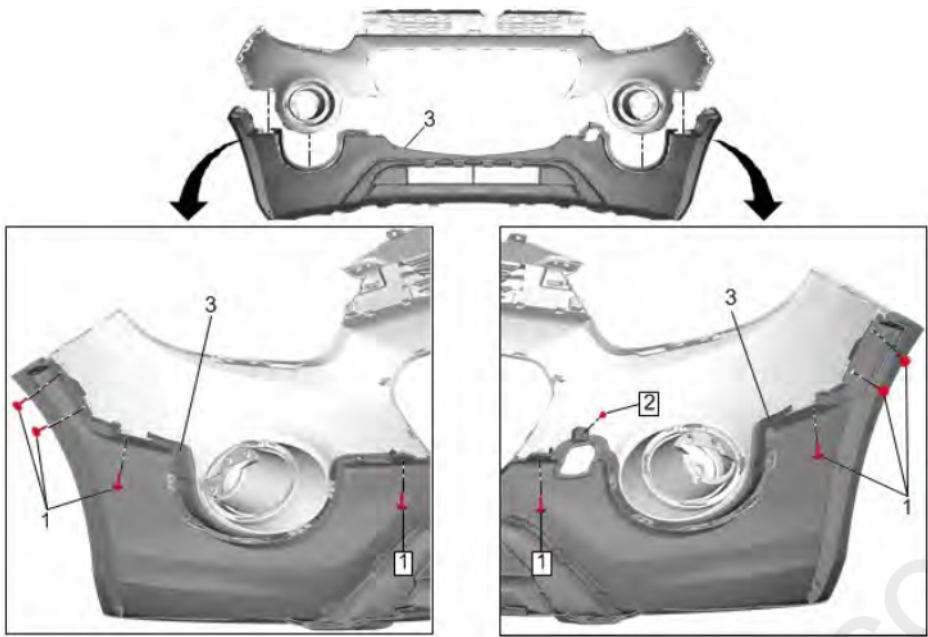

[Click here for full size](#)

Callout	Component Name
Preliminary Procedures	
1. Front Bumper Fascia Replacement	
2. Front Lower Grille Replacement	
1	Front Bumper Fascia Bolt [8>x] Caution : Fastener Caution Tighten 1.5N-m (13 lb in)
2	Front Bumper Fascia Bolt Tighten 1.5N-m (13 lb in)
3	Front Bumper Lower Fascia Procedure 1. Transfer components as necessary. 2. Release the retaining tabs. Note: Use care not to damage the front bumper upper fascia during removal.

Related Part Information


Part Name Catalog Name Part Code

Part Name	Catalog Name	Part Code
Front Bumper Lower Fascia	FASCIA PKG,FRT BPR LWR	2914A
Front Bumper Lower Fascia	FASCIA,FRT BPR LWR	2914B
Front Bumper Lower Fascia	FASCIA,FRT BPR LWR	2915A

cardiagn.com

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Upper Fascia Replacement (Activ)

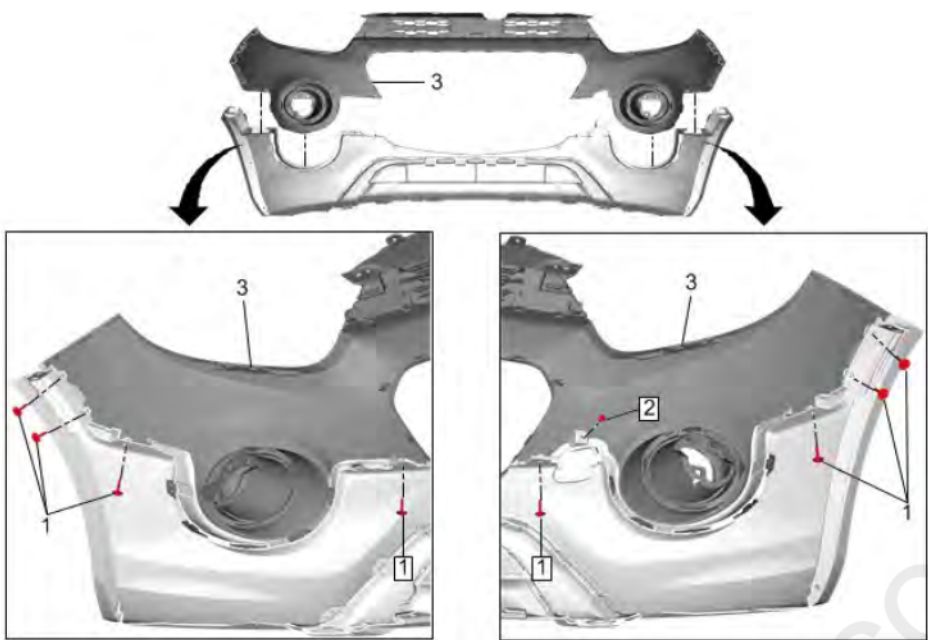

[Click here for full size](#)

Callout	Component Name
Preliminary Procedures	
1. Front Bumper Fascia Replacement	
2. Front Lower Grille Replacement	
1	Front Bumper Fascia Bolt [8>x] Caution : Fastener Caution Tighten 1.5N-m (13 lb in)
2	Front Bumper Fascia Bolt Tighten 1.5N-m (13 lb in)
3	Front Bumper Upper Fascia Procedure 1. Transfer components as necessary. 2. Release the retaining tabs. Note: Use care not to damage the front bumper lower fascia during removal.

Related Part Information


Part Name Catalog Name Part Code

Part Name	Catalog Name	Part Code
Front Bumper Upper Fascia	FASCIA,FRT BPR UPR 2910A	
Front Bumper Upper Fascia	FASCIA,FRT BPR UPR 2910B	

cardiagn.com

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Opening Lower Cover Replacement

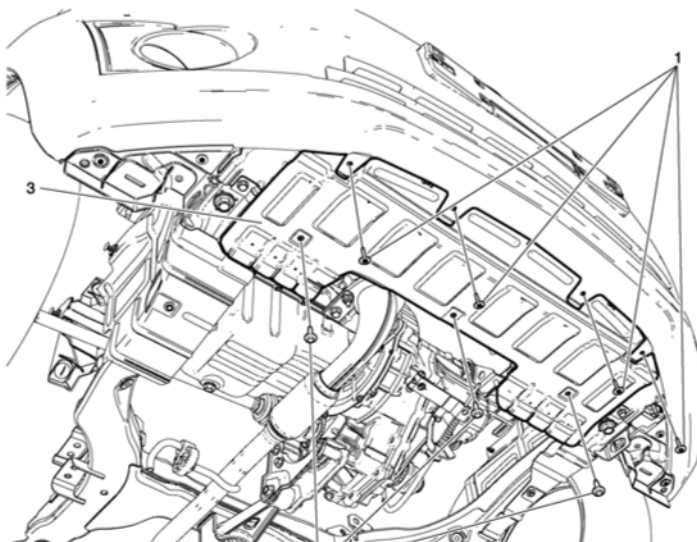




[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Remove the drivetrain and front suspension skid plate. Refer to Drivetrain and Front Suspension Frame Skid Plate Replacement .	
1	Front Bumper Fascia Screw (Qty: 4) Caution: Refer to Fastener Caution . Tighten 1.8 N-m (16 lb-in)
2	Front Bumper Opening Lower Bolt (Qty: 3) Tighten 9 N-m (80 lb-in)
3	Front Bumper Fascia Opening Lower Cover

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Air Deflector Replacement - Outer (PMC)

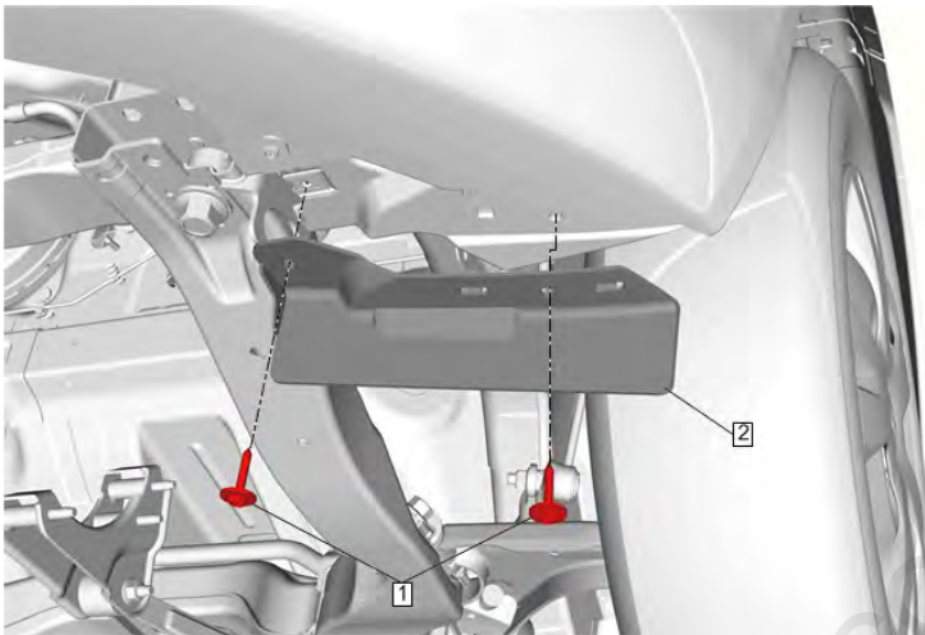


[Click here for full size](#)

Callout	Component Name
1	Front Wheelhouse Liner Bolt [2>x] Caution: Refer to Fastener Caution . Tighten 1.5N-m (13 lb in)
2	Front Bumper Fascia Air Deflector

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Air Deflector Replacement - Center

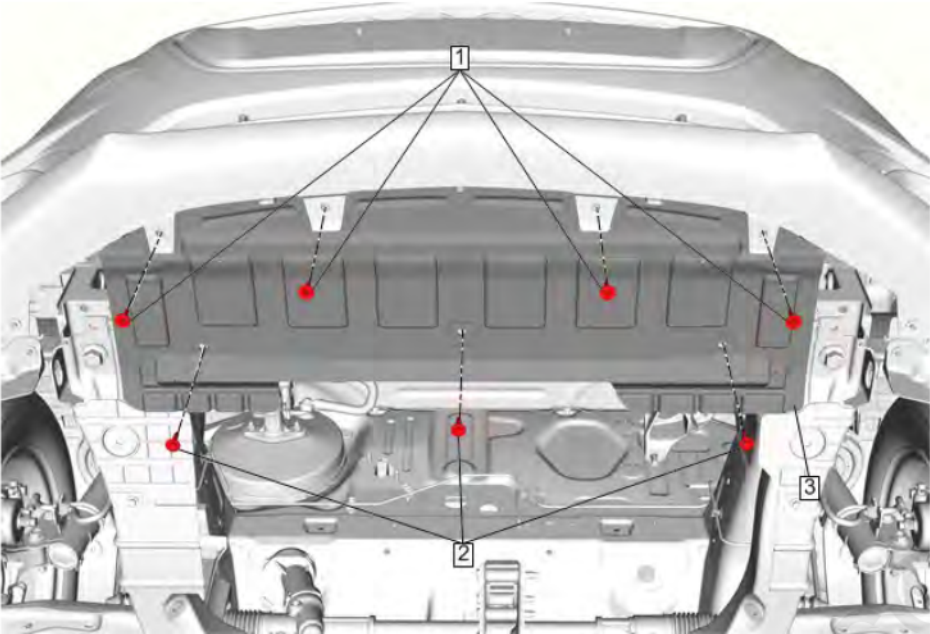

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Raise and support the vehicle. Lifting and Jacking the Vehicle	
1	Front Bumper Fascia Lower Bolt [4>x] Caution: Refer to Fastener Caution . Tighten 1.5N-m (13 lb in)
2	Front Compartment Air Deflector Bolt [3>x] Tighten 9.5N-m (84 lb in)
3	Front Bumper Fascia Air Deflector Procedure Lower the vehicle. Lifting and Jacking the Vehicle

Related Part Information

Part Name	Catalog Name	Part Code
Front Bumper Fascia Air Deflector	DEFLECTOR PKG,FRT BPR FASCIA AIR	2899Y
Front Bumper Fascia Air Deflector	DEFLECTOR,FRT BPR FASCIA AIR	2900L
Front Bumper Fascia Air Deflector	DEFLECTOR,FRT BPR FASCIA AIR	2900M

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Front Bumper Fascia Skid Plate Replacement (Activ)

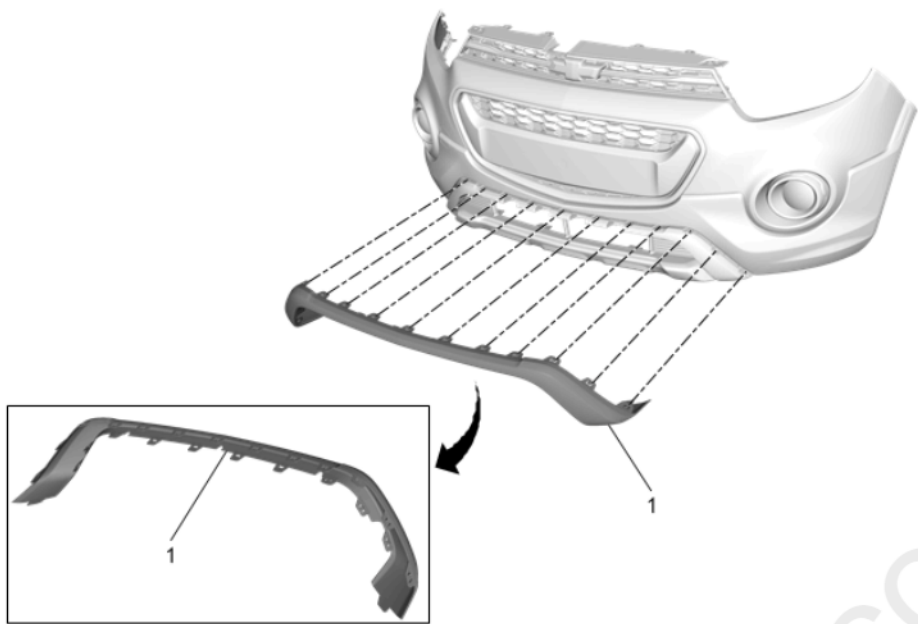


[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Front Bumper Fascia Replacement	
1	Front Bumper Fascia Skid Plate
	Procedure
	Release the retaining tabs.

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Lower Skid Plate Replacement

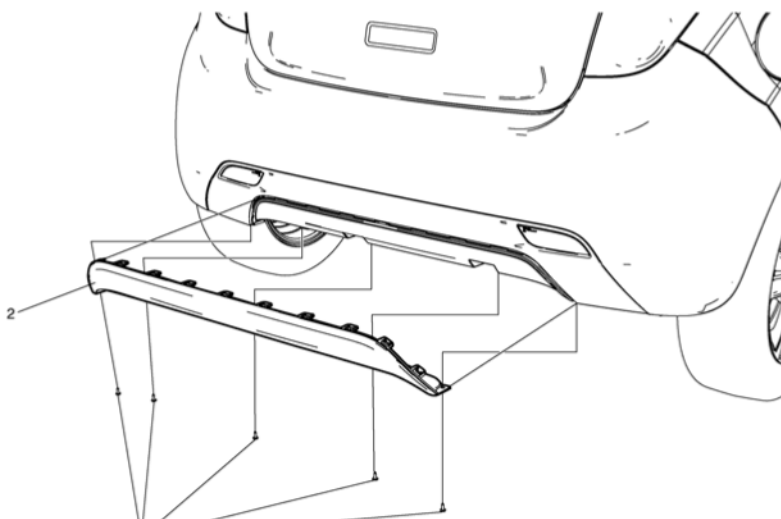




cardiagn.com

[Click here for full size](#)

Callout	Component Name
1	Rear Bumper Fascia Lower Skid Plate Screw (Qty:â€%5)
2	Rear Bumper Fascia Lower Skid Plate

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Molding Replacement (Activ)

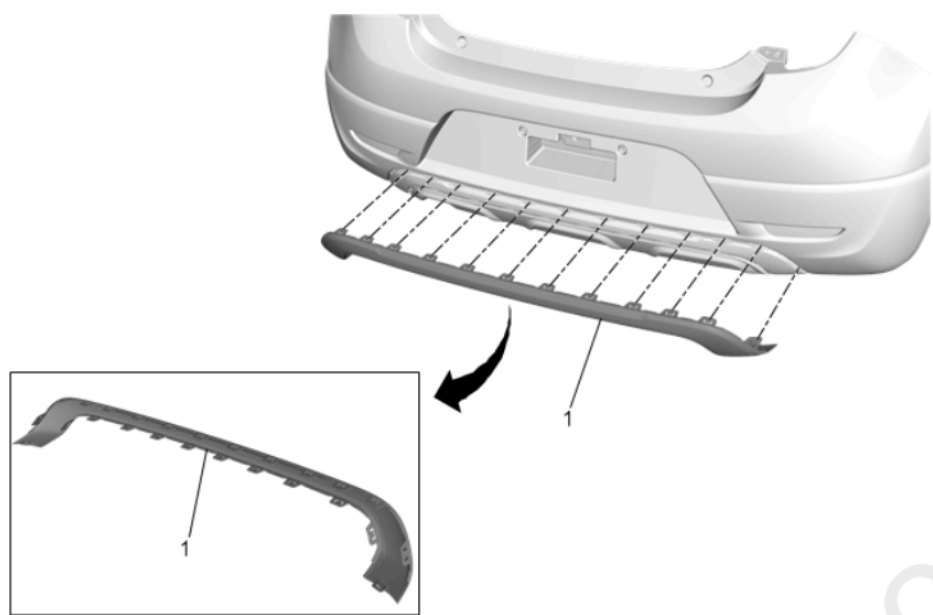

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Rear Bumper Fascia Reinforcement Replacement	
1	Rear Bumper Fascia Molding Procedure Release the retaining tabs.

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Fascia Molding	MOLDING KIT,RR BPR FASCIA	0055Z
Rear Bumper Fascia Molding	MOLDING,RR BPR FASCIA	0056A
Rear Bumper Fascia Molding	MOLDING,RR BPR FASCIA	0056B
Rear Bumper Fascia Molding	MOLDING KIT,RR BPR FASCIA	6874A
Rear Bumper Fascia Molding	MOLDING,RR BPR FASCIA	6875A
Rear Bumper Fascia Molding	MOLDING,RR BPR FASCIA	6876A
Rear Bumper Fascia Molding	MOLDING,RR BPR FASCIA	SJ553

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Replacement

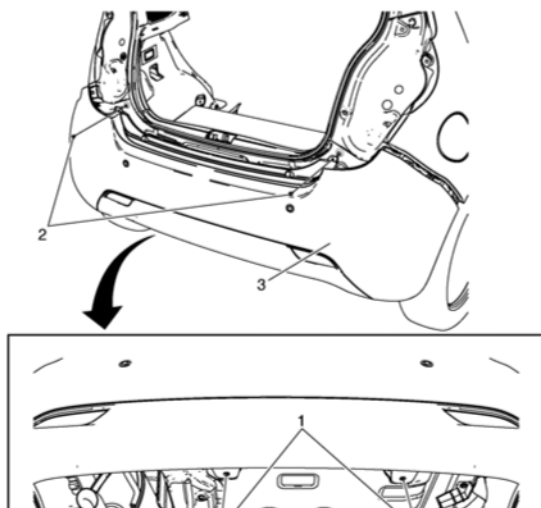



cardiagn.com

[Click here for full size](#)

Callout	Component Name
Preliminary Procedures	
1. Remove the tail lamps. Refer to Tail Lamp Replacement .	
2. Remove the rear wheelhouse liner. Refer to Rear Wheelhouse Liner Replacement .	
1	Rear Bumper Fascia Retainer (Qty:â€™%2)
2	Rear Bumper Fascia Screw (Qty:â€™%2) Caution: Refer to Fastener Caution . Tighten 1.8â€™%N-m (16 lbâ€™%in)


Callout	Component Name
3	Rear Bumper Fascia Procedure 1. Unclip from rear bumper fascia guides. 2. Pull forward to remove the rear bumper fascia. 3. Disconnect any electrical connectors. 4. Transfer parts as needed.

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Fascia	FASCIA,RR BPR (W/RR LIC PLT LP)	0024A
Rear Bumper Fascia	FASCIA,RR BPR(W/ B/U & RR LIC PLT LP)	0024B
Rear Bumper Fascia	FASCIA,RR BPR (W/IMP BAR)	0024C
Rear Bumper Fascia	FASCIA,RR BPR (W/ RR TOW EYE ACC HOLE CVR)	0024D
Rear Bumper Fascia	FASCIA KIT,RR BPR	0024Z
Rear Bumper Fascia	FASCIA,RR BPR	0025A
Rear Bumper Fascia	FASCIA PKG,RR BPR	0026A
Rear Bumper Fascia	FASCIA,RR BPR	0050A
Rear Bumper Fascia	FASCIA,RR BPR (RPR)	0050G
Rear Bumper Fascia	FASCIA,RR BPR	SJ313
Rear Bumper Fascia	FASCIA,RR BPR	SS224

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Replacement (PMC with Hatchback)

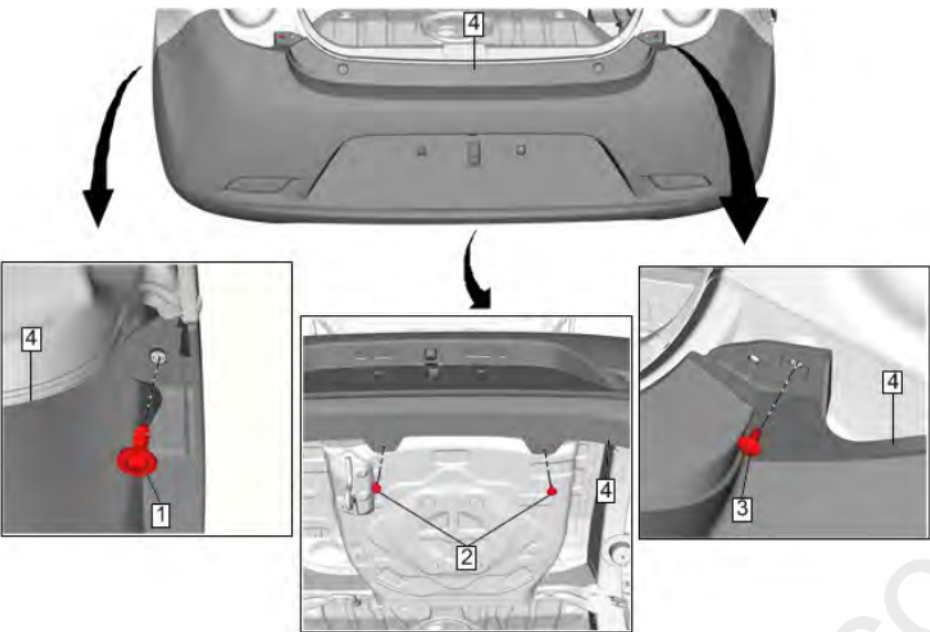

[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Tail Lamp Replacement	
1	Rear Bumper Fascia Guide Bolt [2>x]
	Caution:
	Refer to Fastener Caution .
	Tighten 2.5N-m (22 lb in)
2	Rear Bumper Fascia Retainer [2>x]
3	Rear Bumper Fascia Bolt [2>x]
	Tighten
	1.8N-m (16 lb in)
4	Rear Bumper Fascia
	Procedure
	Disconnect all electrical connectors.

Related Part Information


Part Name	Catalog Name	Part Code
Rear Bumper Fascia FASCIA,RR BPR (W/RR LIC PLT LP)		0024A
Rear Bumper Fascia FASCIA,RR BPR(W/ B/U & RR LIC PLT LP)		0024B
Rear Bumper Fascia FASCIA,RR BPR (W/IMP BAR)		0024C
Rear Bumper Fascia FASCIA,RR BPR (W/ RR TOW EYE ACC HOLE CVR)		0024D
Rear Bumper Fascia FASCIA KIT,RR BPR		0024Z
Rear Bumper Fascia FASCIA,RR BPR		0025A

Part Name	Catalog Name	Part Code
Rear Bumper Fascia	FASCIA PKG,RR BPR	0026A
Rear Bumper Fascia	FASCIA,RR BPR	0050A
Rear Bumper Fascia	FASCIA,RR BPR (RPR)	0050G
Rear Bumper Fascia	FASCIA,RR BPR	SJ313
Rear Bumper Fascia	FASCIA,RR BPR	SS224

cardiagn.com

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Replacement (Notchback)

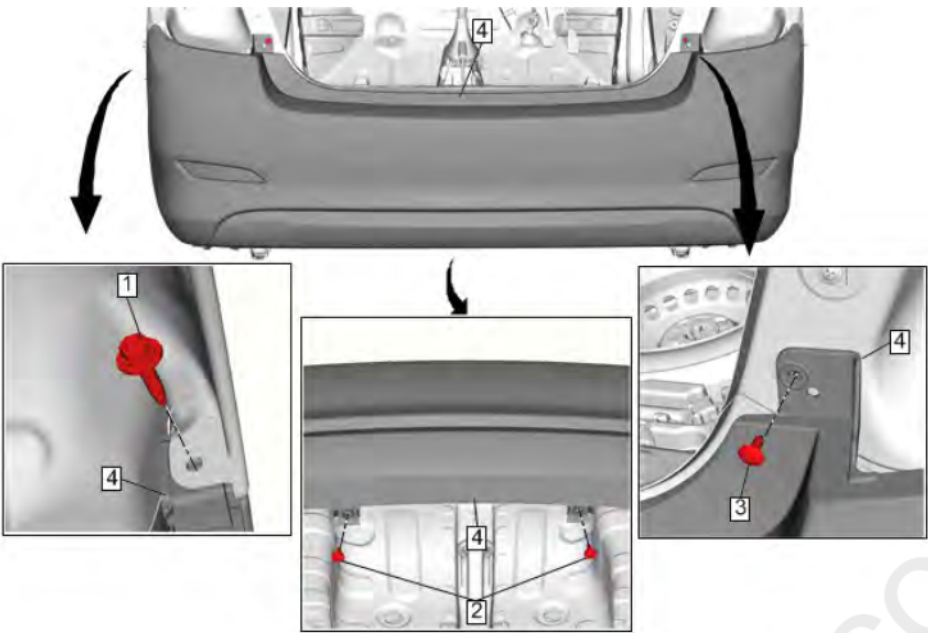

[Click here for full size](#)

Callout	Component Name
Preliminary Procedures	
1. Tail Lamp Replacement	
2. Rear Wheelhouse Liner Replacement	
1	Rear Bumper Fascia Guide Bolt [2>x] Caution: Refer to Fastener Caution . Tighten 2.5N-m (22 lb in)
2	Rear Bumper Fascia Retainer [2>x]
3	Rear Bumper Fascia Screw [2>x] Tighten 1.8N-m (16 lb in)
4	Rear Bumper Fascia Procedure 1. Unclip and disconnect the electrical connector. 2. Transfer components as necessary.

Related Part Information


Part Name	Catalog Name	Part Code
Rear Bumper Fascia	FASCIA,RR BPR (W/RR LIC PLT LP)	0024A

Part Name	Catalog Name	Part Code
Rear Bumper Fascia	FASCIA,RR BPR(W/ B/U & RR LIC PLT LP)	0024B
Rear Bumper Fascia	FASCIA,RR BPR (W/IMP BAR)	0024C
Rear Bumper Fascia	FASCIA,RR BPR (W/ RR TOW EYE ACC HOLE CVR)	0024D
Rear Bumper Fascia	FASCIA KIT,RR BPR	0024Z
Rear Bumper Fascia	FASCIA,RR BPR	0025A
Rear Bumper Fascia	FASCIA PKG,RR BPR	0026A
Rear Bumper Fascia	FASCIA,RR BPR	0050A
Rear Bumper Fascia	FASCIA,RR BPR (RPR)	0050G
Rear Bumper Fascia	FASCIA,RR BPR	SJ313
Rear Bumper Fascia	FASCIA,RR BPR	SS224

cardiagn.com

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Guide Replacement (Notchback)

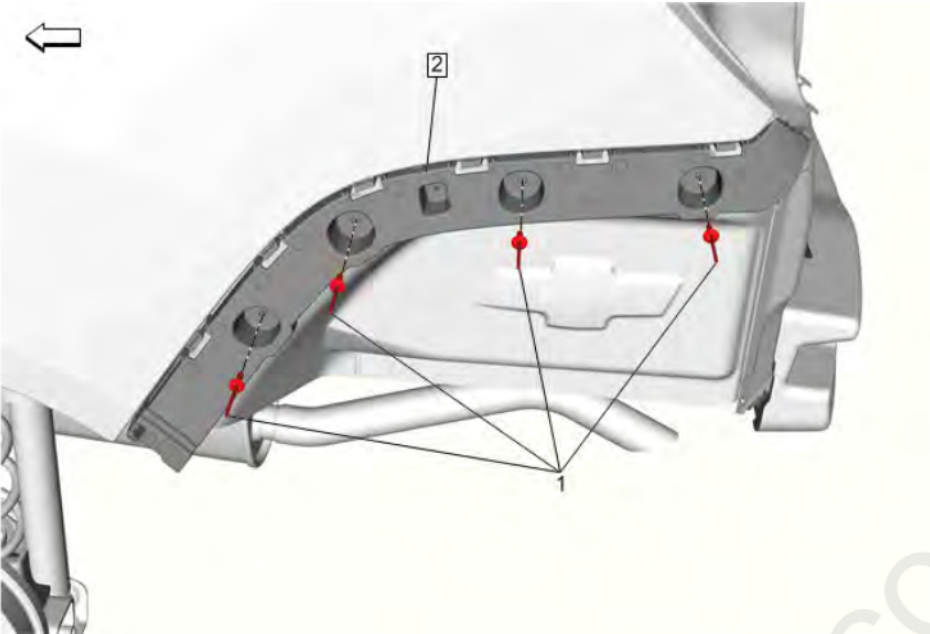

[Click here for full size](#)


Callout	Component Name
Warning :	
Eye Protection Warning	
Preliminary Procedure	
Rear Bumper Fascia Replacement	
1	Rear Bumper Fascia Guide Rivet [4>x]
2	Rear Bumper Fascia Guide

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Fascia Guide	GUIDE,RR BPR FASCIA	0055A
Rear Bumper Fascia Guide	GUIDE,RR BPR FASCIA	0055B

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Guide Replacement (Hatchback)

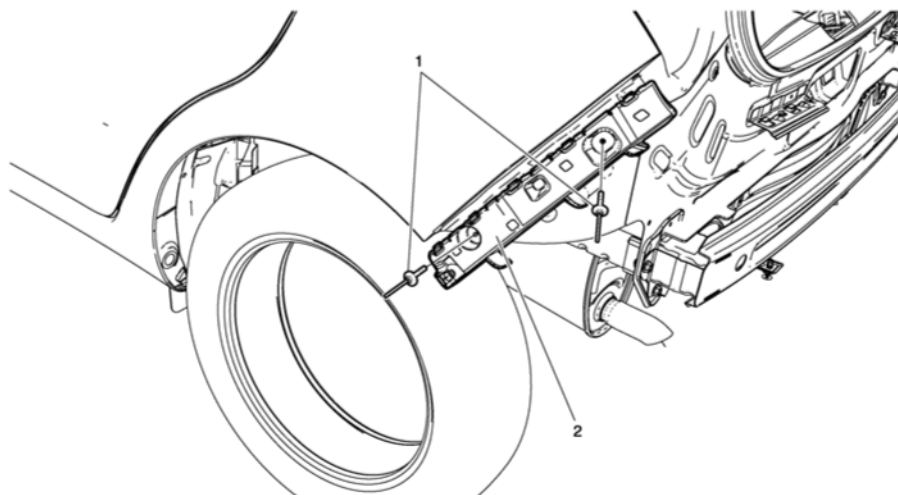



cardiagn.com

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Remove the rear bumper fascia. Refer to Rear Bumper Fascia Replacement .	
1	Rear Bumper Fascia Guide Rivet (Qty:â€%2) Special Tools <i>BO-594-A</i> Hand Rivet Tongs For equivalent regional tools, refer to Special Tools .
2	Rear Bumper Fascia Guide

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Fascia Guide GUIDE,RR BPR FASCIA		0055A
Rear Bumper Fascia Guide GUIDE,RR BPR FASCIA		0055B

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Upper Fascia Replacement (Activ)

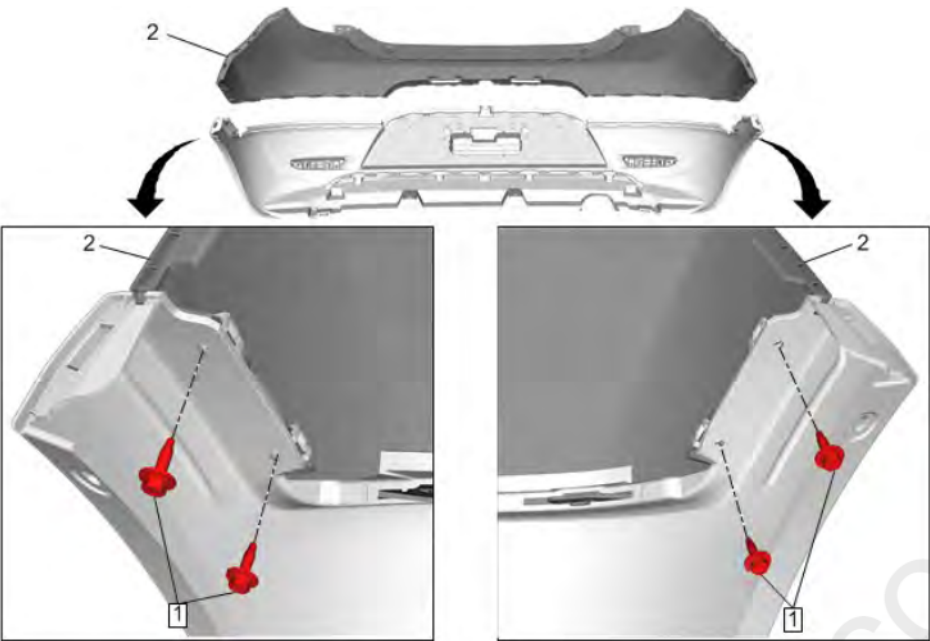

[Click here for full size](#)


Callout	Component Name
Preliminary Procedures	
1. Rear Bumper Fascia Replacement	
2. Release the rear license plate lamp wiring harness retainers from the rear bumper lower fascia.	
1	Rear Bumper Fascia Bolt [4>x] Caution : Fastener Caution Tighten 1.5N-m (13 lb in)
2	Rear Bumper Upper Fascia Procedure 1. Transfer components as necessary. 2. Release the retaining tabs. Note: Use care not to damage the rear bumper lower fascia during removal.

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Upper Fascia	FASCIA,RR BPR UPR 0060A	
Rear Bumper Upper Fascia	FASCIA,RR BPR UPR 0060B	

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Lower Fascia Replacement

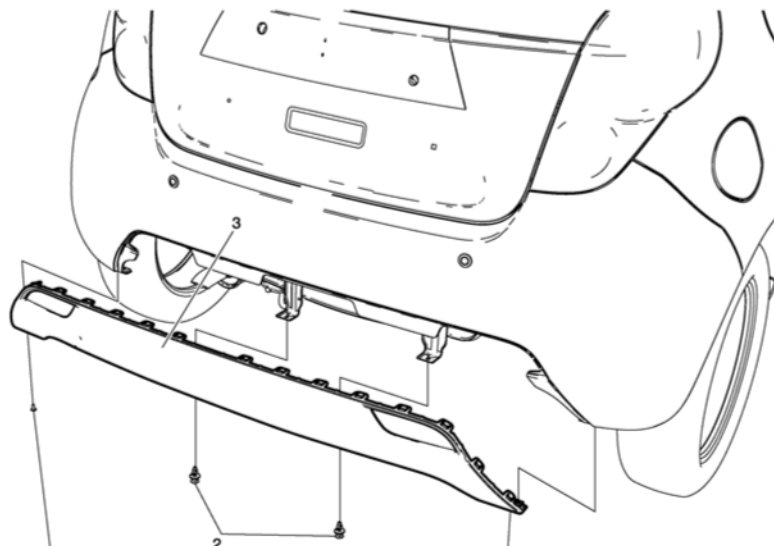



cardiagn.com

[Click here for full size](#)


Callout	Component Name
1	Rear Bumper Lower Fascia Screw (Qty:â€™%02)
2	Rear Bumper Fascia Retainer (Qty:â€™%02)
3	Rear Bumper Lower Fascia Procedure 1. Unclip from rear bumper fascia. 2. Pull forward to remove the rear bumper lower fascia. 3. Transfer parts as needed.

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Lower Fascia FASCIA,RR BPR LWR		0070A
Rear Bumper Lower Fascia FASCIA,RR BPR LWR		0070B

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Lower Fascia Replacement (Activ)

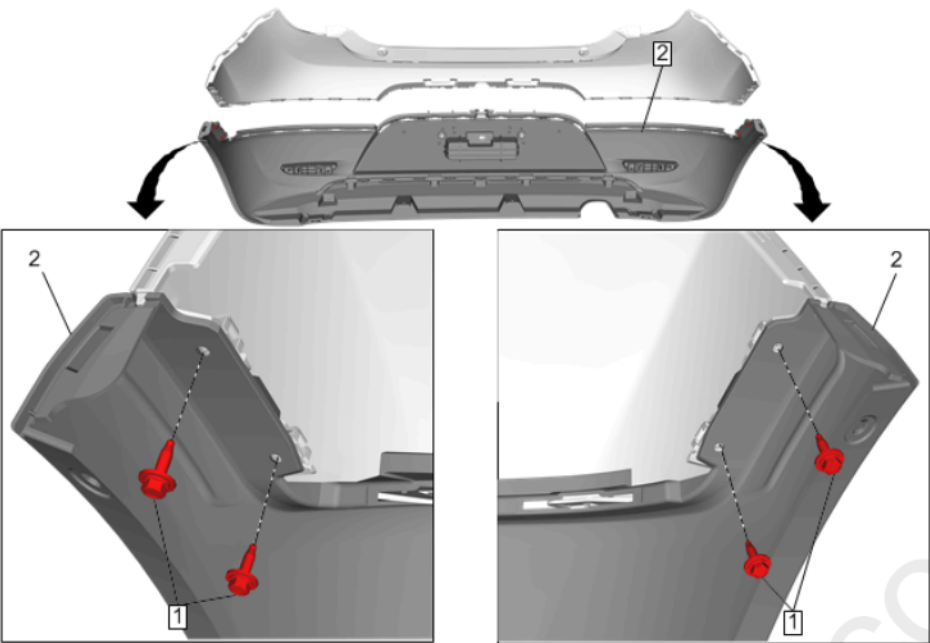

[Click here for full size](#)


Callout	Component Name
Preliminary Procedures	
1. Rear Bumper Fascia Replacement	
2. Release the rear license plate lamp wiring harness retainers from the rear bumper lower fascia.	
1	Rear Bumper Fascia Bolt [4>x] Caution : Fastener Caution Tighten 1.5N-m (13 lb in)
2	Rear Bumper Lower Fascia Procedure 1. Transfer components as necessary. 2. Release the retaining tabs. Note: Use care not to damage the rear bumper upper fascia during removal.

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Lower Fascia	FASCIA,RR BPR LWR 0070A	
Rear Bumper Lower Fascia	FASCIA,RR BPR LWR 0070B	

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Center Bracket Replacement (PMC with Hatchback)

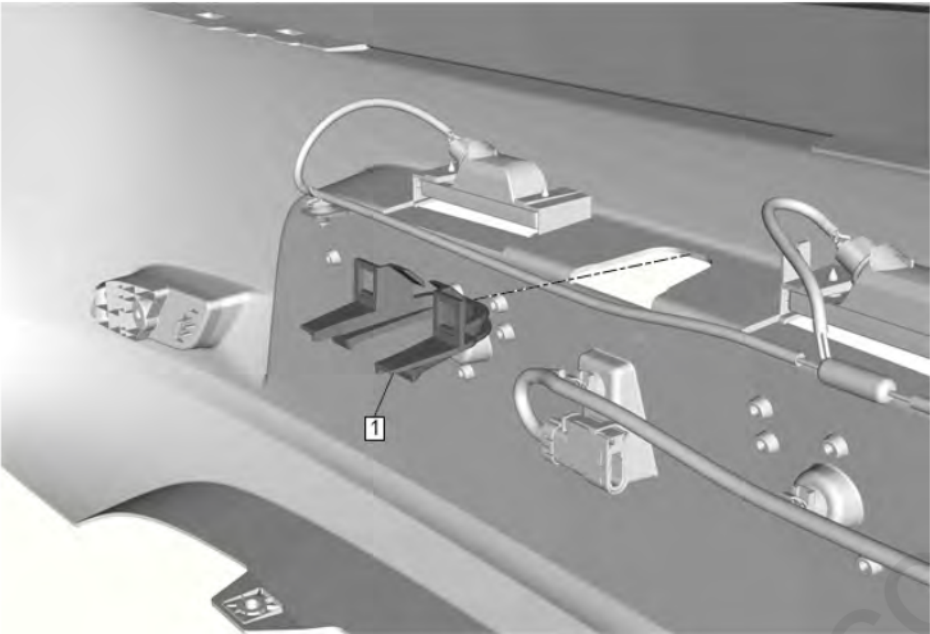

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Rearview Driver Information Camera Replacement	
1	Rear Bumper Fascia Center Bracket

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Fascia Center Bracket	BRACKET,RR BPR FASCIA CTR 0278A	
Rear Bumper Fascia Center Bracket	BRACKET,RR BPR FASCIA CTR 0278B	

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Fascia Reinforcement Replacement (Activ)

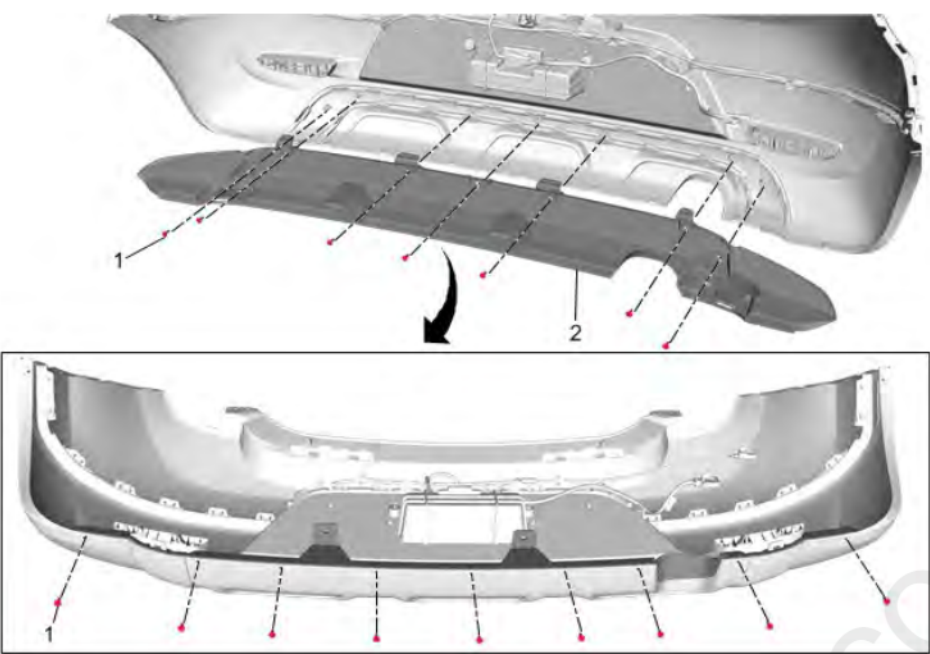


[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Rear Bumper Fascia Replacement	
1	Rear Bumper Fascia Screw [16x] Caution : Fastener Caution Tighten 1.5N-m (13 lb in)
2	Rear Bumper Fascia Reinforcement

- 1. BODY REPAIR
- 2. BUMPERS AND FASCIAS
- 3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Energy Absorber Replacement (Notchback)

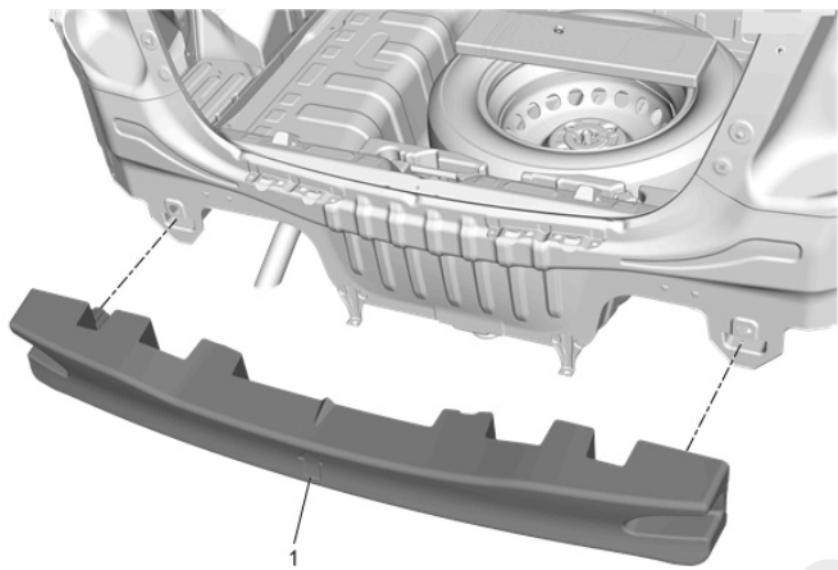

[Click here for full size](#)


Callout	Component Name
Preliminary Procedure	
Rear Bumper Fascia Replacement	
1	Rear Bumper Energy Absorber

Related Part Information

Part Name	Catalog Name	Part Code
Rear Bumper Energy Absorber	ABSORBER,RR BPR ENGY 3425A	
Rear Bumper Energy Absorber	ABSORBER,RR BPR ENGY 3425B	

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. REPAIR INSTRUCTIONS
- 4.

Rear Bumper Impact Bar Replacement

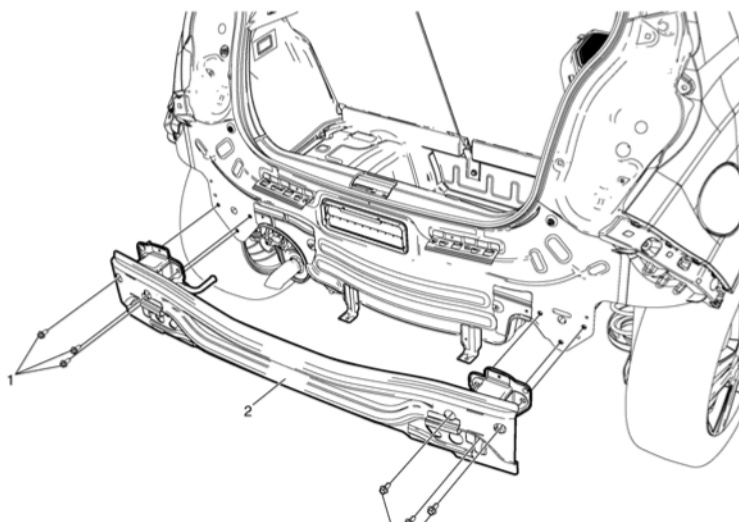



cardiagn.com

[Click here for full size](#)

Callout	Component Name
Preliminary Procedure	
Remove the rear bumper fascia. Refer to Rear Bumper Fascia Replacement .	
1	Rear Bumper Impact Bar Bolt (Qty: 6) Caution: Refer to Fastener Caution . Tighten 22 N-m (16 lb-ft)
2	Rear Bumper Impact Bar

Specifications

cardiagn.com

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. SPECIFICATIONS
- 4.

Fastener Specifications

Reusable Threaded Fastener Tightening Specifications


Application	Specification
	Metric (English)
Note:	
All fasteners listed in this table can be reused after removal.	
Front Bumper Fascia Bolt (front upper and lower fascia mounting)	1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)
Front Bumper Fascia Guide Bolt	2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)
Front Bumper Fascia Lower Bolt	1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)
Front Bumper Fascia Screw	1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)
Front Bumper Fascia Screw	1.8â€‰N-mâ€‰(16â€‰lbâ€‰in)
Front Bumper Fascia Side Screw	2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)
Front Bumper Fascia Upper Bolt	2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)
Front Bumper Impact Bar Bolt	22â€‰N-mâ€‰(16â€‰lbâ€‰ft)
Front Bumper Lower Impact Bar Bolt	25â€‰N-mâ€‰(18â€‰lbâ€‰ft)
Front Bumper Opening Lower Bolt	9â€‰N-mâ€‰(80â€‰lbâ€‰in)
Front Compartment Air Deflector Bolt	9.5â€‰N-mâ€‰(84â€‰lbâ€‰in)
Front Wheelhouse Liner Bolt	1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)
Headlamp Bolt	2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)
Headlamp Screw	2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)
Rear Bumper Fascia Bolt	1.8â€‰N-mâ€‰(16â€‰lbâ€‰in)
Rear Bumper Fascia Bolt (rear upper and lower fascia mounting)	1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)
Rear Bumper Fascia Guide Bolt	2.5â€‰N-mâ€‰(22â€‰lbâ€‰in)
Rear Bumper Fascia Screw	1.8â€‰N-mâ€‰(16â€‰lbâ€‰in)
Rear Bumper Fascia Screw (rear bumper fascia reinforcement and rear bumper fascia mounting)	1.5â€‰N-mâ€‰(13â€‰lbâ€‰in)
Rear Bumper Impact Bar Bolt	22â€‰N-mâ€‰(16â€‰lbâ€‰ft)

Special Tools and Equipment

cardiagn.com

1. BODY REPAIR
2. BUMPERS AND FASCIAS
3. SPECIAL TOOLS AND EQUIPMENT
- 4.

Special Tools

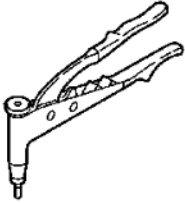Illustration	Tool Number/ Description
 Click here for full size	BO-594-A MKM-594-A Hand Rivet Tongs

cardiagn.com