

ACCESSORIES & EQUIPMENT**Luggage Rack and Roof Trim - Escalade, Suburban, Tahoe, Yukon****SPECIFICATIONS****FASTENER SPECIFICATIONS**

Application	Specification	
	Metric	English
Luggage Carrier Side Rail Nuts	9 N.m	80 lb in

REPAIR INSTRUCTIONS**LUGGAGE CARRIER SIDE RAIL REPLACEMENT (SHORT WHEELBASE, BUILT PRIOR TO 9/1/2014)**

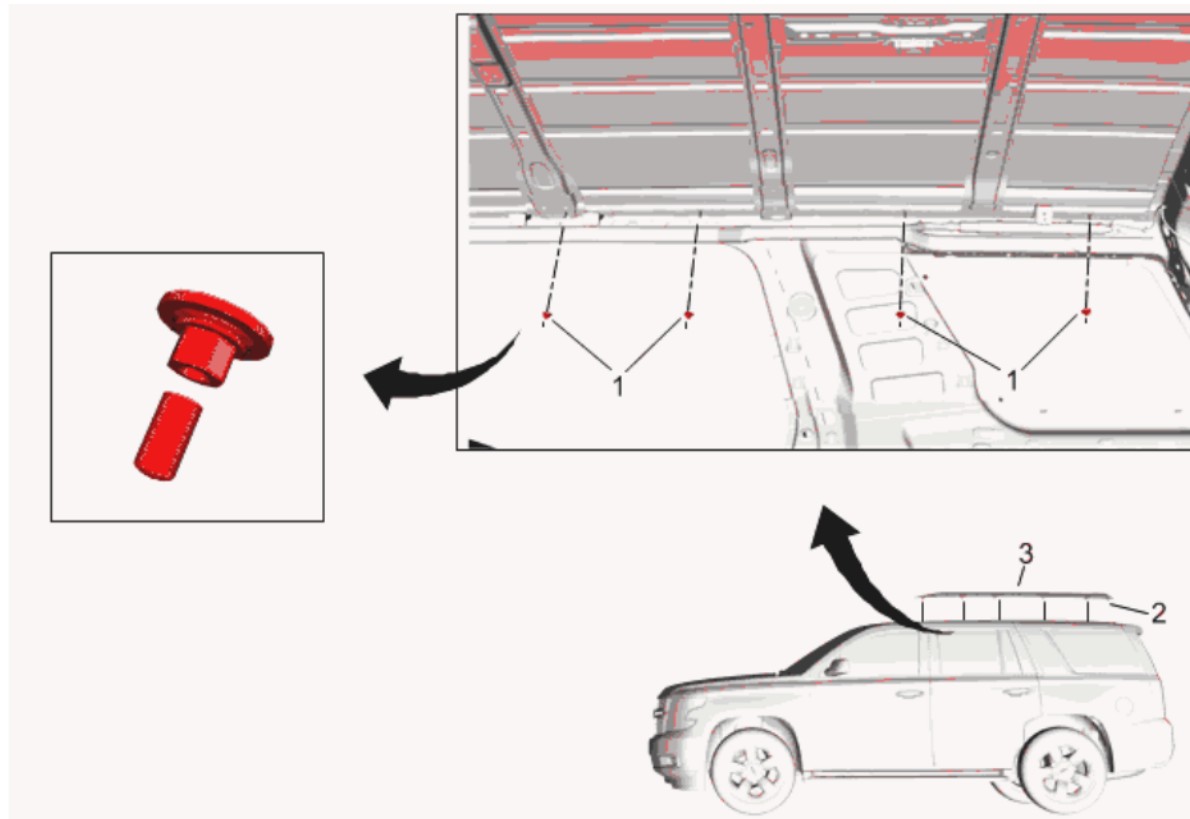


Fig. 1: Luggage Carrier Side Rail (Short Wheelbase, Built Prior to 9/1/2014)

Courtesy of GENERAL MOTORS COMPANY

Callout	Component Name
Preliminary Procedure It is only necessary to lower the headliner. Only do those steps in the headliner replacement procedure that will lower the headliner enough to gain access to the part. Refer to <u>Headlining Trim Panel Replacement (Standard Wheelbase)</u> .	
1	Luggage Carrier Side Rail Nut (Qty: 4) CAUTION: Refer to <u>Fastener</u> <u>Caution</u> .

Callout	Component Name
	Procedure 1. The fasteners are located on the underside of the side rail. 2. Clean all traces of the old gasket seal from all the fastener hole. Use a 50/50 mixture of isopropyl alcohol and water. 3. Ensure that the new side rail nuts have a gasket seal applied. This will prevent water leaks. 4. Ensure that the cap is replaced with the nut to cover the stud completely. Tighten 9 N.m (80 lb in)
2	Luggage Carrier Side Rail Retainer (Qty: 2)
3	Luggage Carrier Side Rail Procedure 1. Transfer all necessary components. 2. Water test the vehicle for leaks on the side rail that was replaced, install the headliner.

LUGGAGE CARRIER SIDE RAIL REPLACEMENT (LONG WHEELBASE, BUILT PRIOR TO 9/1/2014)

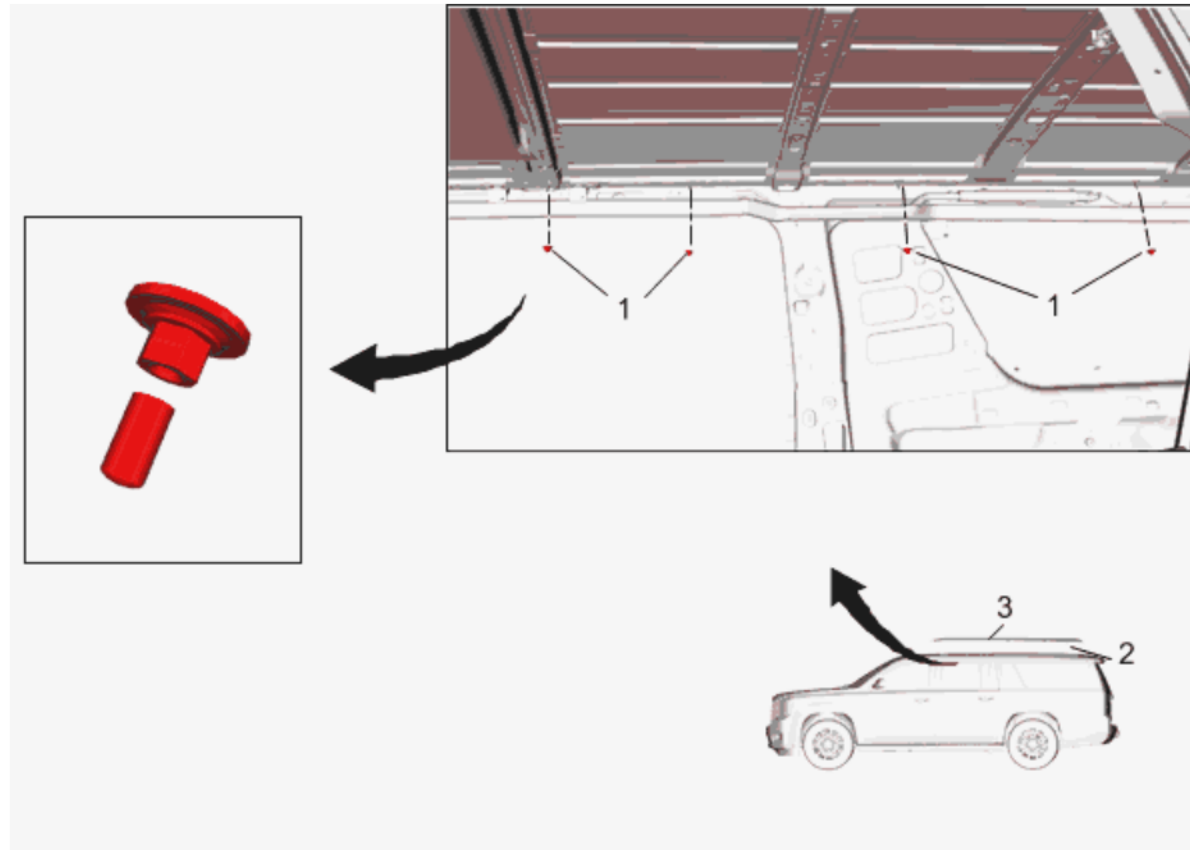


Fig. 2: Luggage Carrier Side Rail (Long Wheelbase, Built Prior to 9/1/2014)

Courtesy of GENERAL MOTORS COMPANY

Callout	Component Name
Preliminary Procedure It is only necessary to lower the headliners. Only do those steps in the headliner replacement procedure that will lower the headliner enough to gain access to the part. Refer to Headlining Trim Panel Replacement (Extended Wheelbase) , and Headlining Rear Trim Panel Replacement .	
1	Luggage Carrier Side Rail Nut (Qty: 5) CAUTION: Refer to Fastener

Callout	Component Name
	<u>Caution</u> . Procedure 1. The fasteners are located on the underside of the side rail. 2. Clean all traces of the old gasket seal from all the fastener hole. Use a 50/50 mixture of isopropyl alcohol and water. 3. Ensure that the new side rail nuts have a gasket seal applied. This will prevent water leaks. 4. Ensure that the cap is replaced with the nut to cover the stud completely. Tighten 9 N.m (80 lb in)
2	Luggage Carrier Side Rail Retainer (Qty: 2)
3	Luggage Carrier Side Rail Procedure 1. Transfer all necessary components. 2. Water test the vehicle for leaks on the side rail that was replaced, install the headliner.

LUGGAGE CARRIER SIDE RAIL REPLACEMENT (SHORT WHEELBASE, BUILT AFTER 9/2/2014)

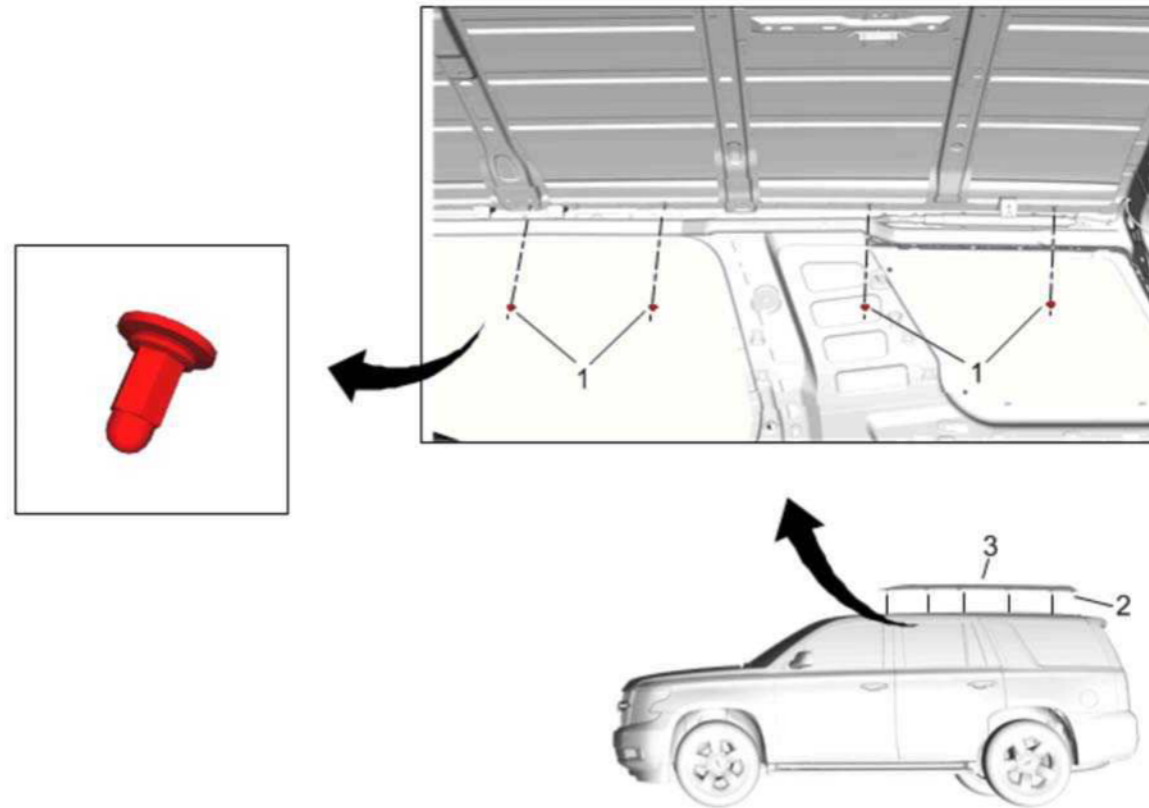


Fig. 3: Luggage Carrier Side Rail (Short Wheelbase, Built After 9/2/2014)

Courtesy of GENERAL MOTORS COMPANY

Callout	Component Name
Preliminary Procedure It is only necessary to lower the headliner. Only do those steps in the headliner replacement procedure that will lower the headliner enough to gain access to the part. Refer to Headlining Trim Panel Replacement (Standard Wheelbase) .	
1	Luggage Carrier Side Rail Nut (Qty: 4) CAUTION: Refer to Fastener Caution .

Callout	Component Name
	Procedure 1. The fasteners are located on the underside of the side rail. 2. Clean all traces of the old gasket seal from all the fastener hole. Use a 50/50 mixture of isopropyl alcohol and water. 3. Ensure that the new side rail nuts have a gasket seal applied. This will prevent water leaks. Tighten 9 N.m (80 lb in)
2	Luggage Carrier Side Rail Retainer (Qty: 2)
3	Luggage Carrier Side Rail Procedure 1. Transfer all necessary components. 2. Water test the vehicle for leaks on the side rail that was replaced, install the headliner.

LUGGAGE CARRIER SIDE RAIL REPLACEMENT (LONG WHEELBASE, BUILT AFTER 9/2/2014)

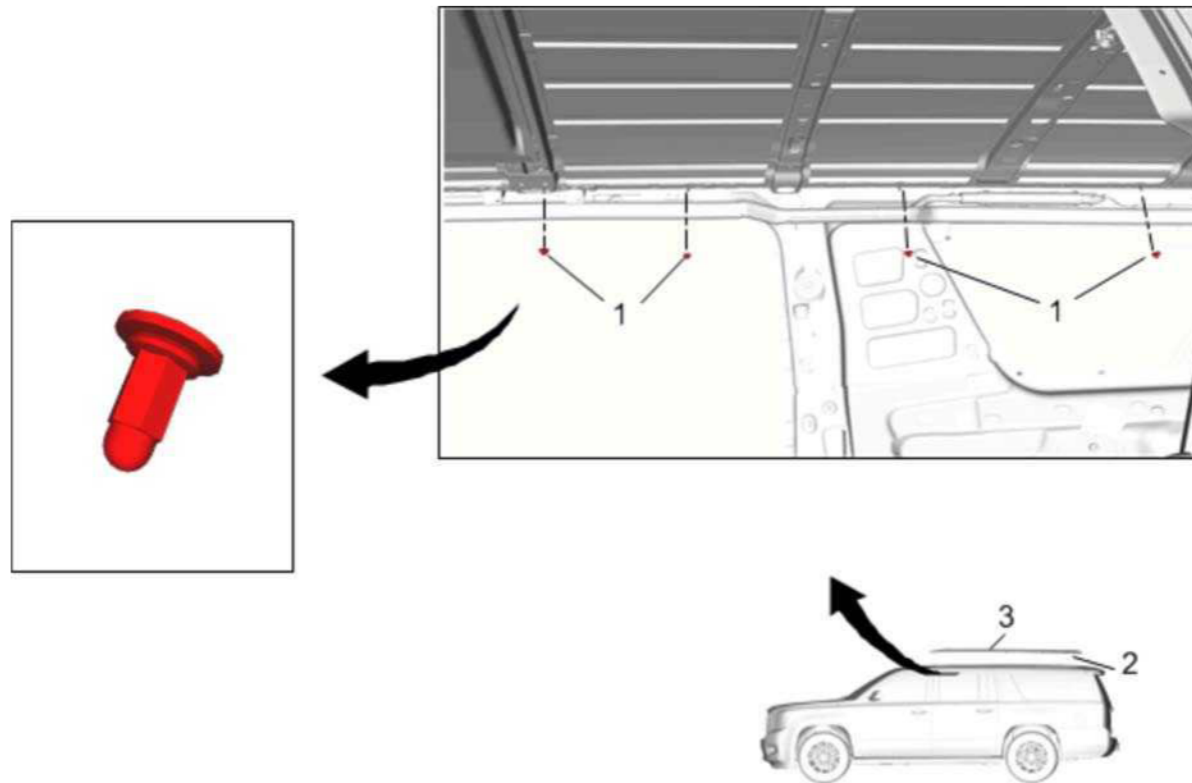


Fig. 4: Luggage Carrier Side (Long Wheelbase, Built After 9/2/2014)

Courtesy of GENERAL MOTORS COMPANY

Callout	Component Name
Preliminary Procedure It is only necessary to lower the headliners. Only do those steps in the headliner replacement procedure that will lower the headliner enough to gain access to the part. Refer to Headlining Trim Panel Replacement (Extended Wheelbase) , and Headlining Rear Trim Panel Replacement .	
1	Luggage Carrier Side Rail Nut (Qty: 5) CAUTION: Refer to Fastener

Callout	Component Name
	<u>Caution</u> . Procedure 1. The fasteners are located on the underside of the side rail. 2. Clean all traces of the old gasket seal from all the fastener hole. Use a 50/50 mixture of isopropyl alcohol and water. 3. Ensure that the new side rail nuts have a gasket seal applied. This will prevent water leaks. Tighten 9 N.m (80 lb in)
2	Luggage Carrier Side Rail Retainer (Qty: 2)
3	Luggage Carrier Side Rail Procedure 1. Transfer all necessary components. 2. Water test the vehicle for leaks on the side rail that was replaced, install the headliner.