

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

2007 ACCESSORIES & EQUIPMENT

Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

SPECIFICATIONS

FASTENER TIGHTENING SPECIFICATIONS

Fastener Tightening Specifications

Application	Specification	
	Metric	English
Belt Assembly Anchor Bolt	70 N.m	52 lb ft
Body Lock Pillar Garnish Molding Screws	2 N.m	18 lb in
Body Rear Corner Upper Garnish Molding Screws	2 N.m	18 lb in
Center Pillar Upper Assist Handle Screws	1.2 N.m	10 lb in
Center Pillar Upper Garnish Molding Screws	2 N.m	18 lb in
Coat Hook Screws	9 N.m	80 lb in
Floor Console Bolts	6 N.m	53 lb in
Front Floor Console Rear Cupholder Screw	2 N.m	18 lb in
Jack and Tool Stowage Container Retaining Nut	5 N.m	44 lb in
Liftgate Trim Finish Panel Screw	2 N.m	18 lb in
Overhead Console Screws	2 N.m	18 lb in
Quarter Panel Trim Armrest Screws	2 N.m	18 lb in
Quarter Panel Trim Screws	2 N.m	18 lb in
Rear Assist Handle Screws	6 N.m	53 lb in
Side Door Armrest Bolt	2 N.m	18 lb in
Side Door Trim Panel Bolt	2 N.m	18 lb in
Sunshade Screws	6 N.m	53 lb in
Tool Storage Compartment Bracket Nuts	50 N.m	36 lb ft
Tool Storage Compartment Nuts	10 N.m	88 lb in
Windshield Side Garnish Molding Screws	2 N.m	18 lb in
Windshield Side Pillar Assist Handle Screws	6 N.m	53 lb in

REPAIR INSTRUCTIONS

TRIM PANEL REPLACEMENT - UPPER EXTENSION (ESCALADE)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

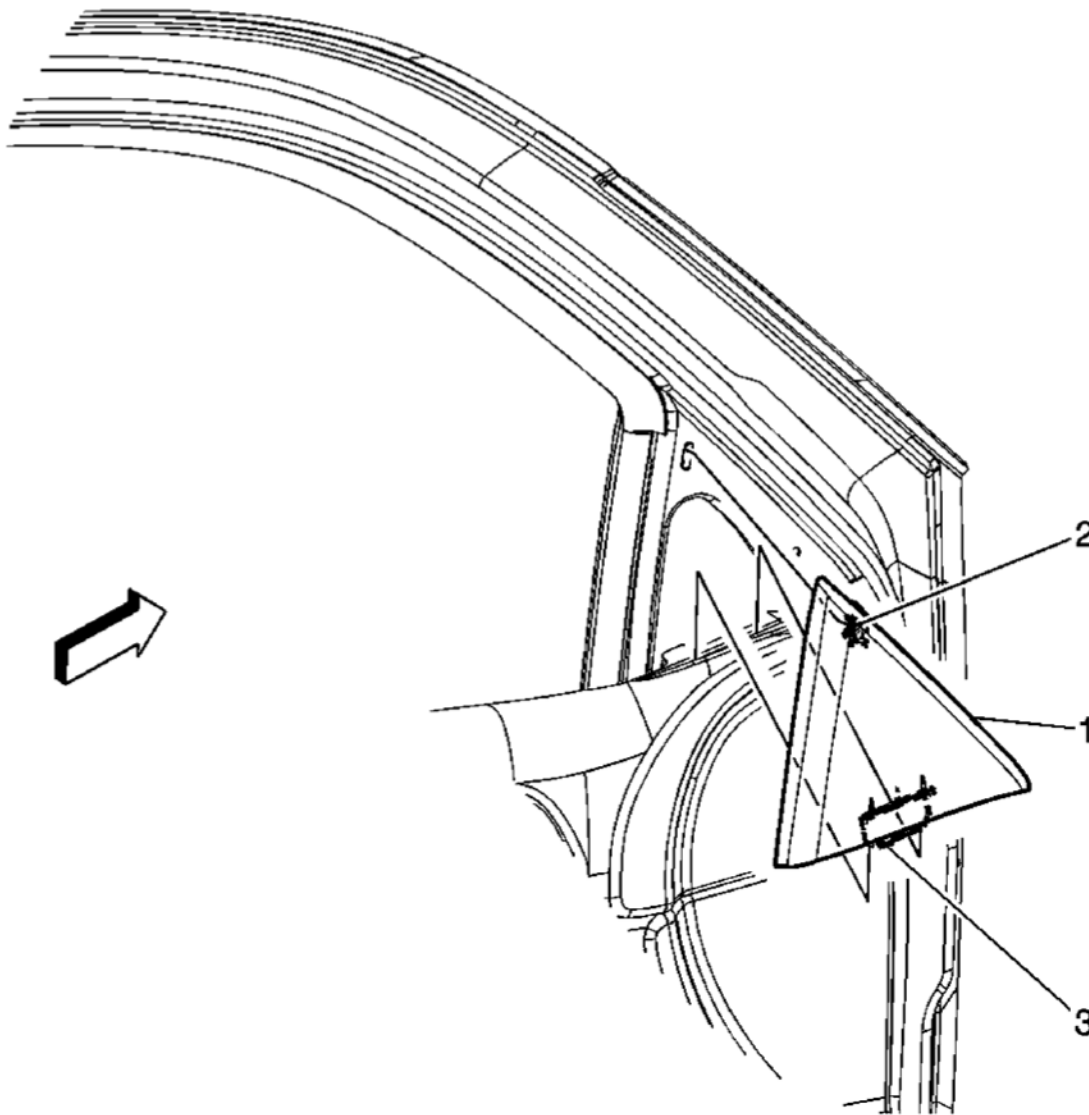


Fig. 1: View Of Front Side Door Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Upper Extension (Escalade)

Callout	Component Name
Fastener Tightening Specifications: Refer to Fastener Tightening Specifications .	
1	Front Side Door Upper Trim Panel Assembly Tip: 1. Tab must be installed prior to retainer. 2. Tab to be fully seated in front side door trim panel.
2	Front Side Door Upper Trim Panel Retainer (Qty: 1)
3	Front Side Door Upper Trim Panel Tab (Qty: 1)

TRIM PANEL REPLACEMENT - UPPER EXTENSION (TAHOE/YUKON)

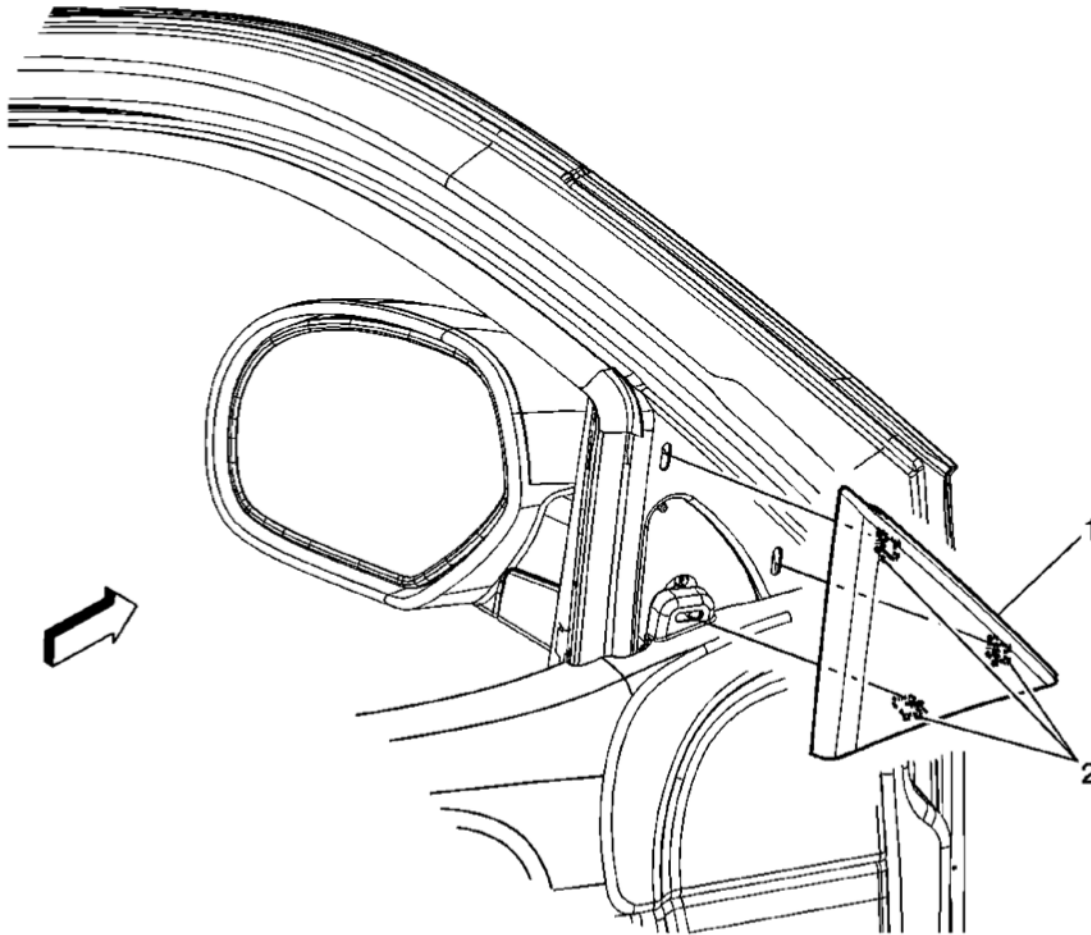


Fig. 2: View Of Front Side Door Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Upper Extension (Tahoe/Yukon)

Callout	Component Name
Fastener Tightening Specifications: Refer to Fastener Tightening Specifications .	
1	Front Side Door Upper Trim Panel Assembly
2	Front Side Door Upper Trim Panel Retainer (Qty: 3)

FRONT SIDE DOOR TRIM PANEL REPLACEMENT

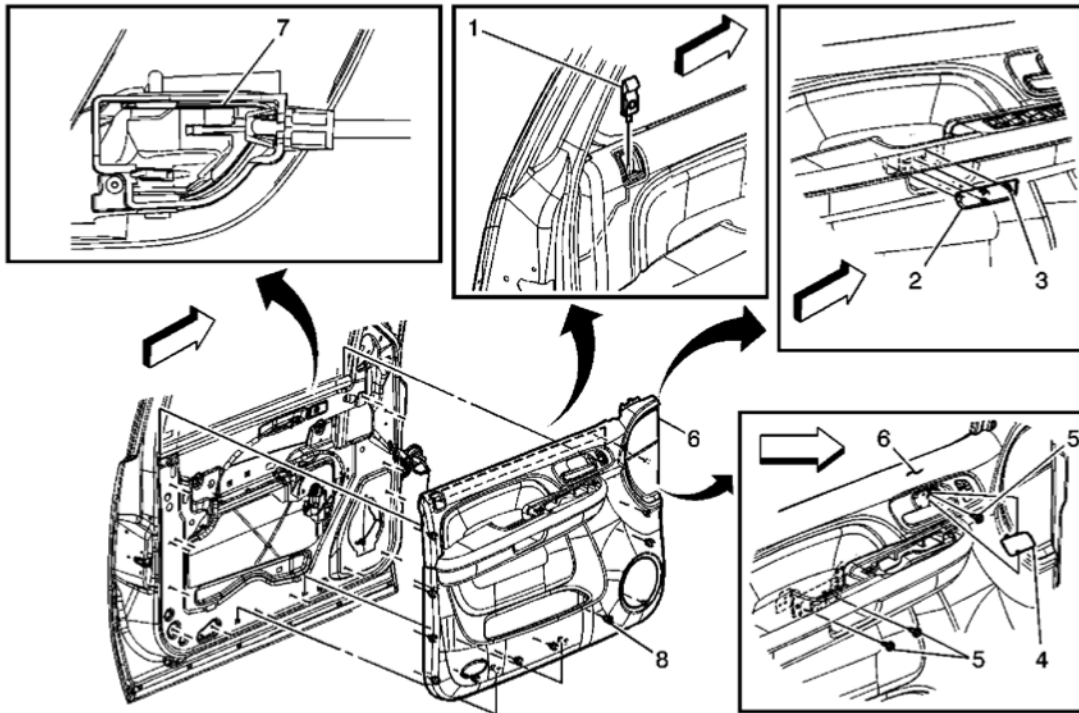


Fig. 3: View Of Front Side Door Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Front Side Door Trim Panel Replacement

Callout	Component Name
Preliminary Procedure	
1. Remove the door upper trim panel. Refer to <u>Trim Panel Replacement - Upper Extension (Escalade)</u> or <u>Trim Panel Replacement - Upper Extension (Tahoe/Yukon)</u>. 2. Remove the door window control switch. Refer to <u>Door Lock and Side Window Switch Replacement - Driver</u> and <u>Door Lock and Side Window Switch Replacement - Passenger</u>.	
1	Detent Tab
2	Front Side Door Locking Rod Knob Assembly Tip: 1. Lower the window. 2. Ensure the locking rod is in the unlocked position. 3. Use a flat-bladed tool to disengage the detent tab and then remove the knob by pulling upward. 4. When re-installing, push the knob down until the detent tab touches the locking rod opening cover. 5. Push the detent tab in to lock the knob to the locking rod.
3	Front Side Door Trim Panel Cover

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

4	Front Side Door Trim Panel Cover Retainers (Qty: 3)
5	Front Side Door Inside Handle Bezel Cover
6	Front Side Door Trim Panel Bolts (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
7	Front Side Door Trim Panel Assembly Tip: 1. Disconnect the electrical connectors. 2. There are 2 hooks located on the lower portion of the door trim panel that are being used for manufacturing installation ONLY. 3. If these hooks are damaged during either removal or installation of the door trim panel, replacement of the panel is not required. 4. When installing the trim panel start at the lock knob, pushing down and outward moving toward the upper front.
8	Front Side Door Cable Retainer Tip: Pull upward to disengage.
9	Front Side Door Trim Panel Retainers (Qty: 12)

REAR SIDE DOOR TRIM PANEL REPLACEMENT (SUBURBAN/YUKON XL/ESCALADE ESV)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

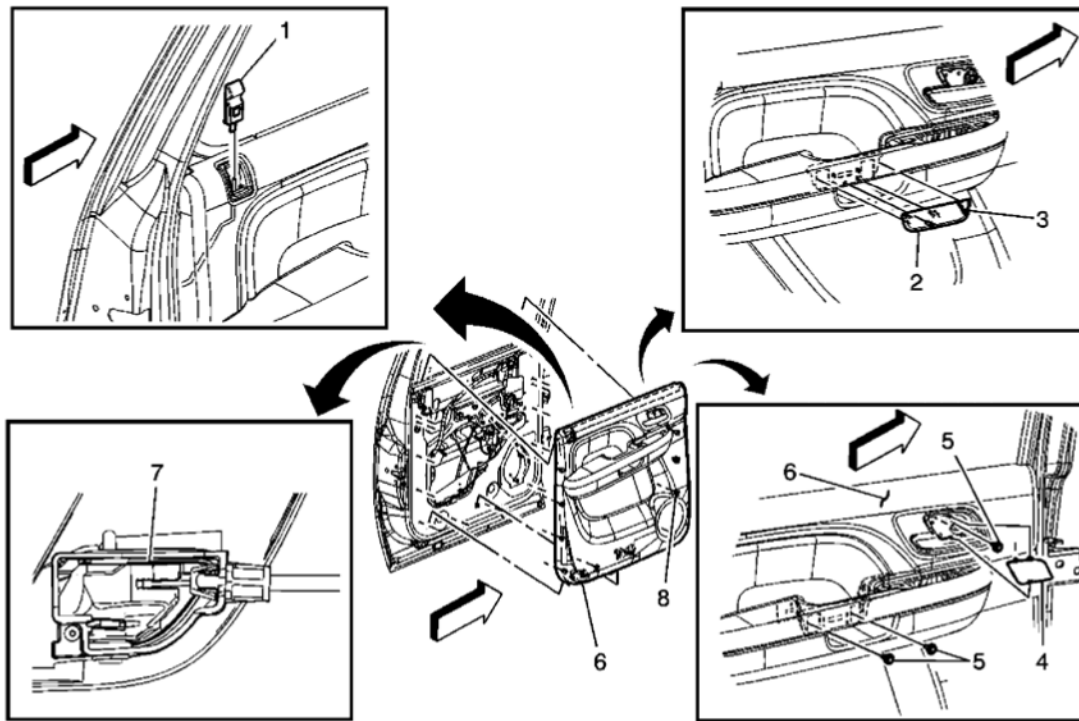


Fig. 4: View Of Rear Side Door Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Rear Side Door Trim Panel Replacement (Suburban/Yukon XL/Escalade ESV)

Callout	Component Name
Preliminary Procedure: Remove rear door window control switch. Refer to Rear Side Door Window Switch Replacement .	
1	Detent Tab
2	Rear Side Door Locking Rod Knob Assembly Tip: 1. Lower window. 2. Ensure locking rod is in the unlocked position. 3. Use a flat-bladed tool to disengage detent tab, then remove knob by pulling upward. 4. When re-installing, push knob down, until detent tab touches locking rod opening cover. 5. Push detent tab in to lock knob to locking rod.
3	Rear Side Door Trim Panel Cover
4	Rear Side Door Trim Panel Cover Retainer (Qty: 4)
5	Rear Side Door Inside Handle Bezel Cover
	Rear Side Door Trim Panel Bolt (Qty: 3)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

6	NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
7	Rear Side Door Trim Panel Assembly
8	Rear Side Door Cable Retainer Tip: Pull upward to disengage.
9	Rear Side Door Trim Panel Retainer (Qty: 10)

REAR SIDE DOOR TRIM PANEL REPLACEMENT (TAHOE/YUKON/ESCALADE)

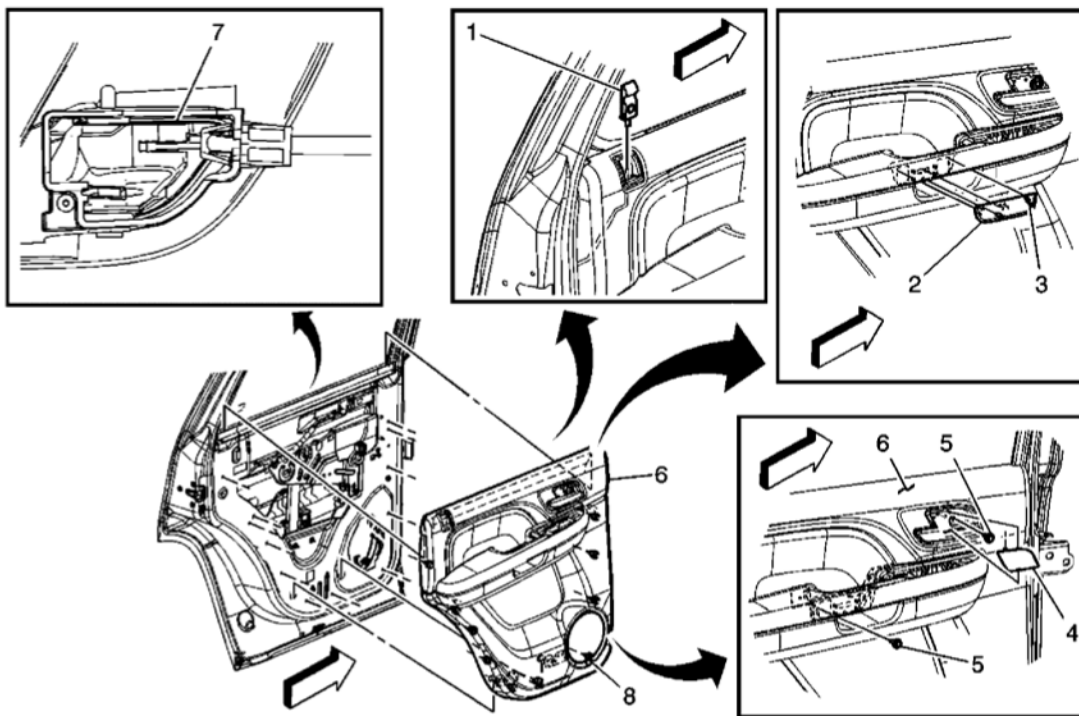


Fig. 5: View Of Rear Side Door Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Rear Side Door Trim Panel Replacement (Tahoe/Yukon/Escalade)

Callout	Component Name
Preliminary Procedure: Remove rear door window control switch. Refer to <u>Rear Side Door Window Switch Replacement</u> .	
1	Detent Tab
	Rear Side Door Locking Rod Knob Assembly Tip: 1. Lower window.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

2	2. Ensure locking rod is in the unlocked position. 3. Use a flat-bladed tool to disengage detent tab, then remove knob by pulling upward. 4. When re-installing, push knob down, until detent tab touches locking rod opening cover. 5. Push detent tab in to lock knob to locking rod.
3	Rear Side Door Trim Panel Cover
4	Rear Side Door Trim Panel Cover Retainer (Qty: 4)
5	Rear Side Door Inside Handle Bezel Cover
6	Rear Side Door Trim Panel Bolt (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
7	Rear Side Door Trim Panel Assembly
8	Rear Side Door Cable Retainer Tip: Pull upward to disengage.
9	Rear Side Door Trim Panel Retainer (Qty: 10)

FRONT SIDE DOOR WATER DEFLECTOR REPLACEMENT

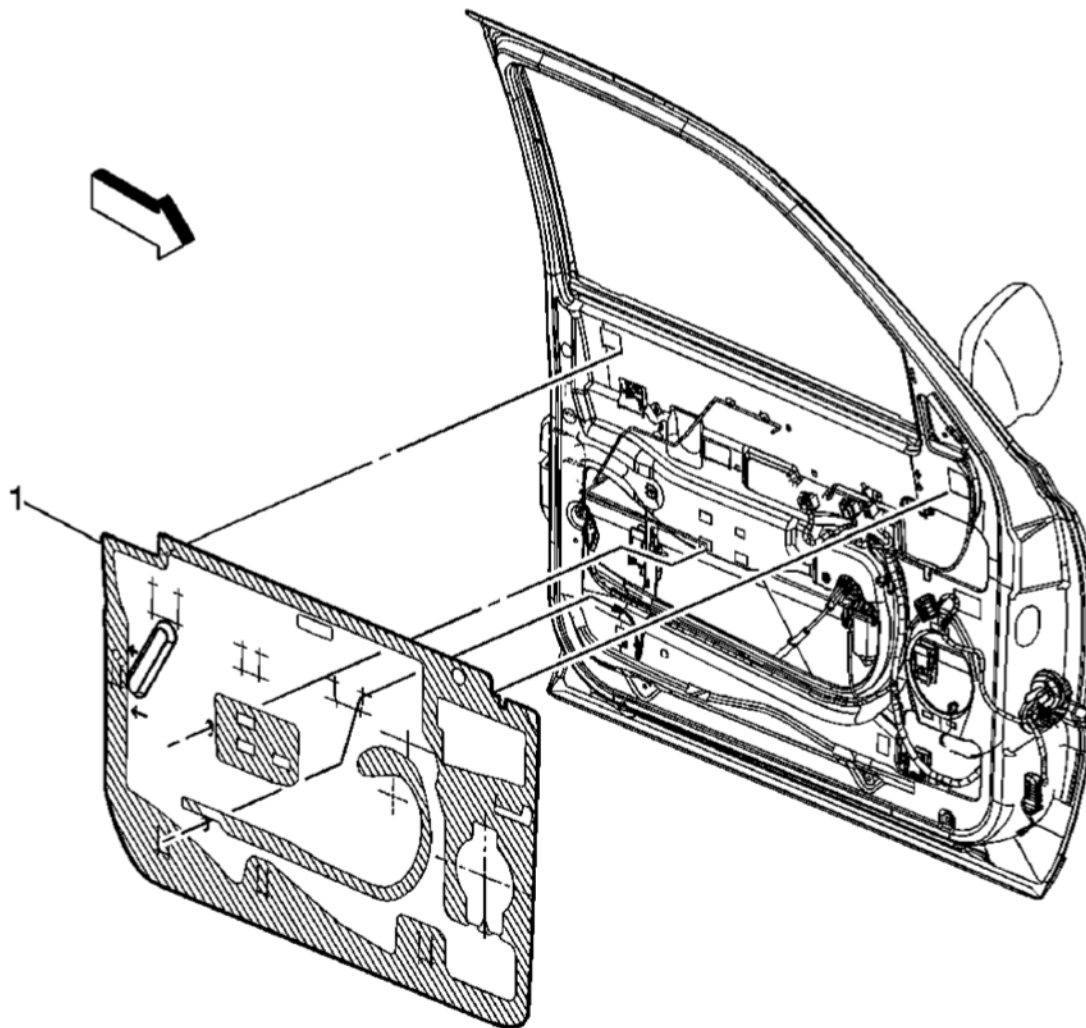


Fig. 6: View Of Front Side Door Water Deflector
Courtesy of GENERAL MOTORS CORP.

Front Side Door Water Deflector Replacement

Callout	Component Name
Preliminary Procedure: Remove the door trim panel. Refer to <u>Front Side Door Trim Panel Replacement</u> .	
1	Front Side Door Water Deflector Tip: 1. Use a flat-bladed tool to separate the bond between the sealer and the door. 2. Use waterproof tape, or 3M 777 or equivalent, if the water deflector is damaged. 3. It will be necessary to replace trim panel retaining clips, if broken.

REAR SIDE DOOR WATER DEFLECTOR REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

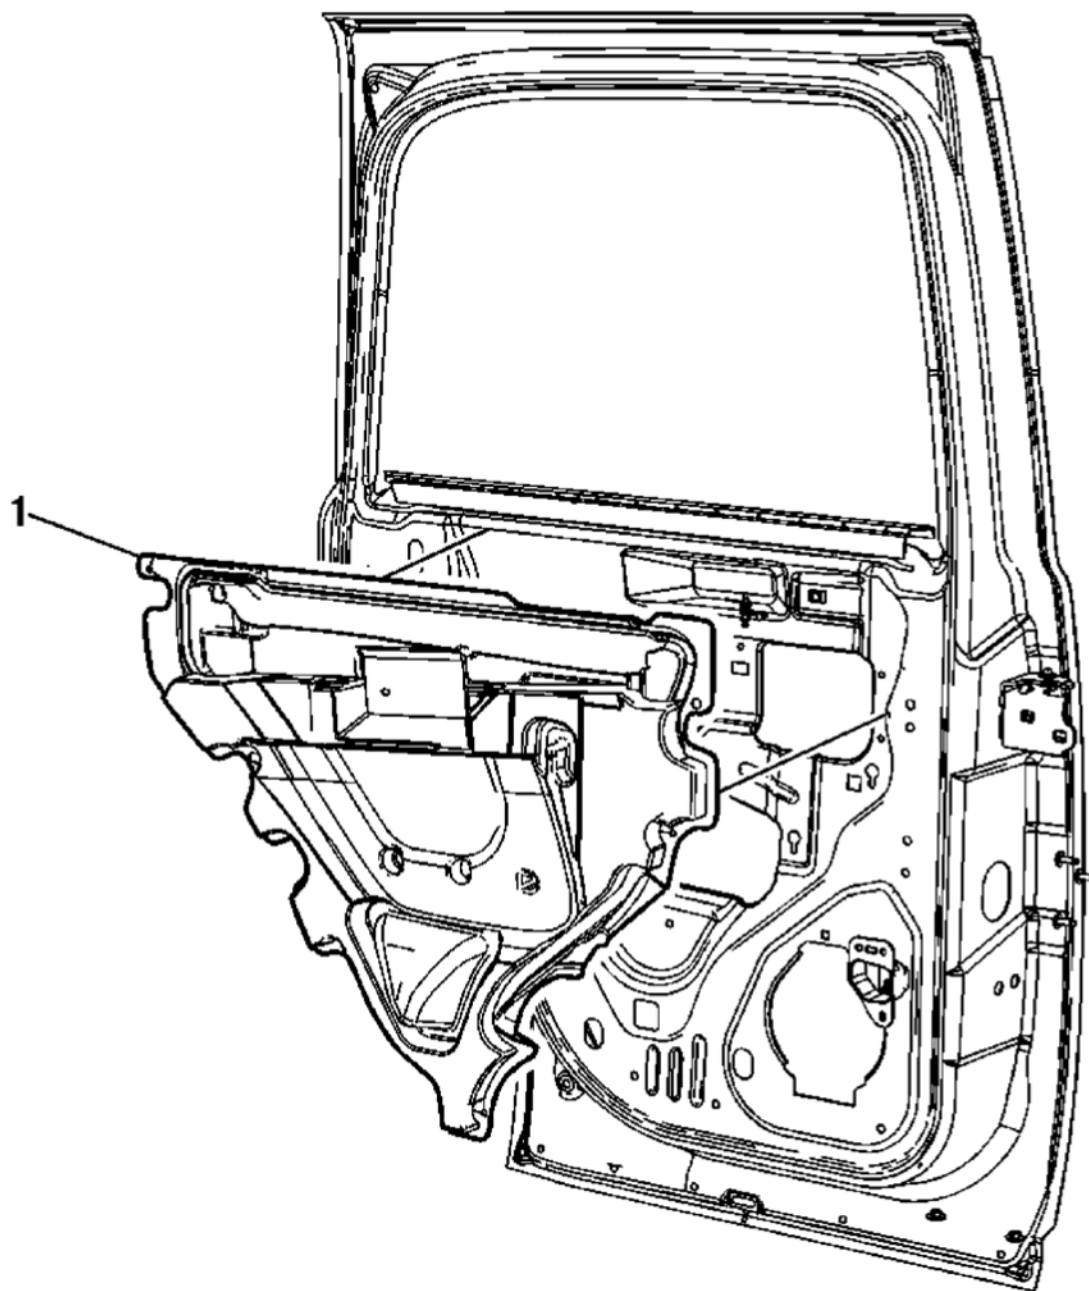


Fig. 7: View Of Rear Side Door Water Deflector
Courtesy of GENERAL MOTORS CORP.

Rear Side Door Water Deflector Replacement

Callout	Component Name
Preliminary Procedure: Remove the door trim panel. Refer to <u>Rear Side Door Trim Panel Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Rear Side Door Trim Panel Replacement (Tahoe/Yukon/Escalade)</u> .	

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

Rear Side Door Water Deflector

Tip:

1. Use a flat-bladed tool to separate the bond between the sealer and the door.
2. Use waterproof tape, or 3M 777 or equivalent, if the water deflector is damaged.
3. It will be necessary to replace trim panel retaining clips, if broken.

GARNISH MOLDING REPLACEMENT - FRONT DOOR FRAME

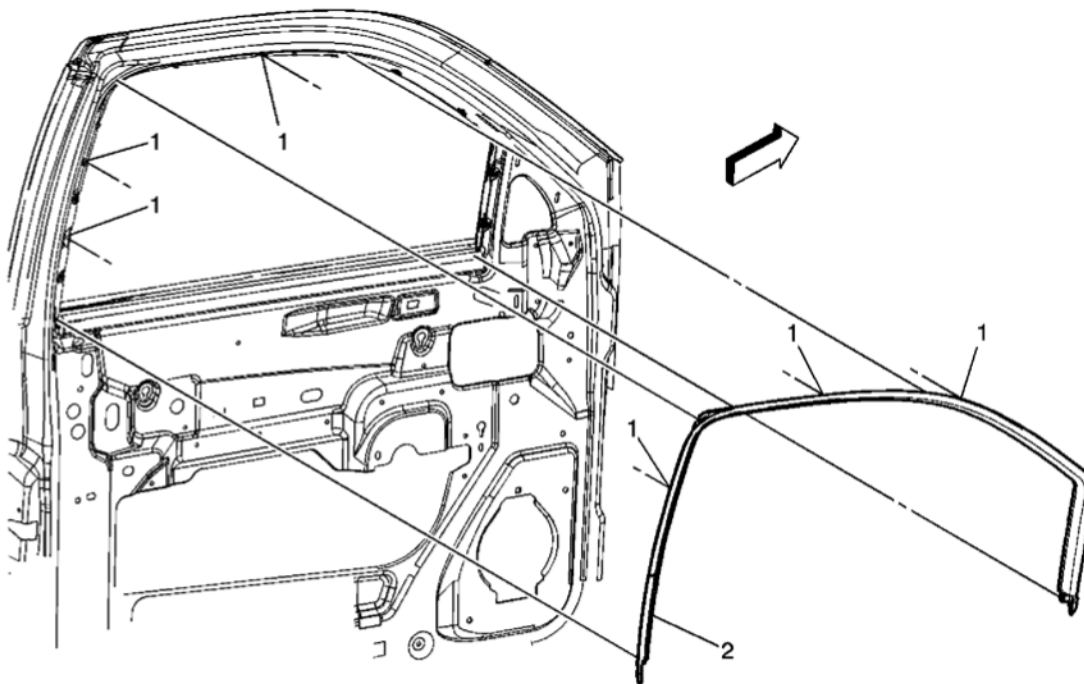


Fig. 8: View Of Front Side Door Window Garnish Molding & Retainers
Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Front Door Frame

Callout	Component Name
Preliminary Procedures: Remove the front door trim panel. Refer to Front Side Door Trim Panel Replacement .	
1	Front Side Door Window Garnish Molding Retainer (Qty: 6)
2	Front Side Door Window Garnish Molding Tip: 1. Install the 3 clips in the corners over the flange. 2. Install the tab at each end of the garnish molding between the flange and reveal molding. 3. Install the remaining 3 clips around the window flange.

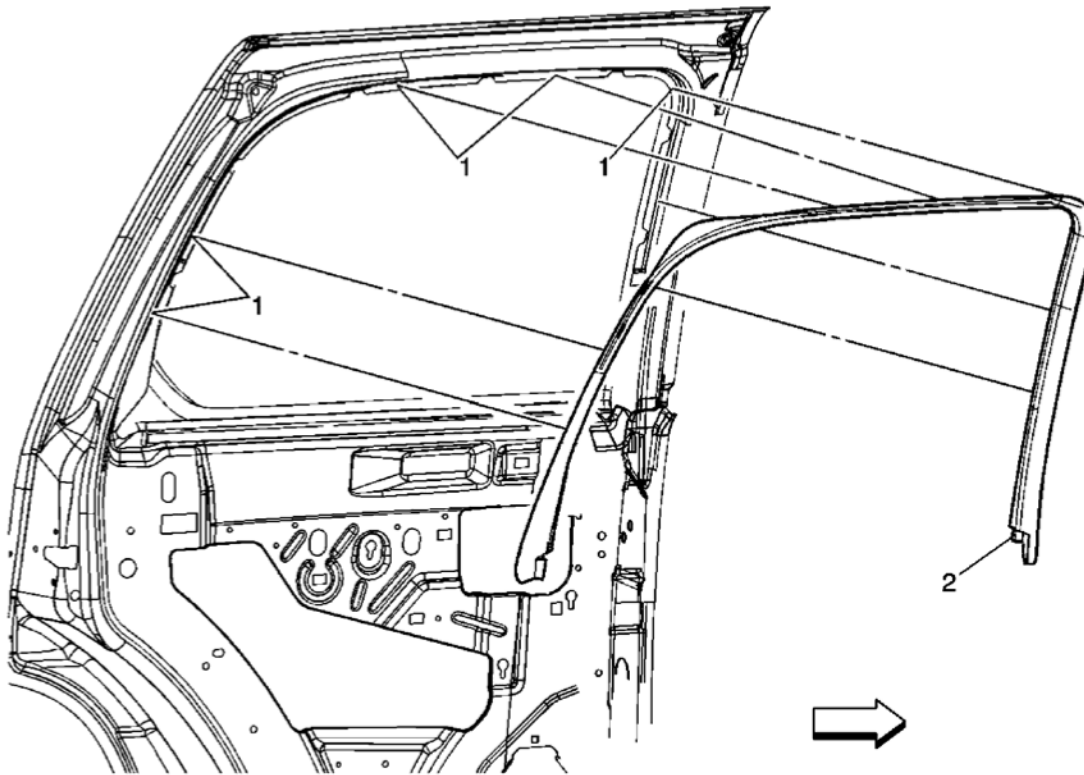
GARNISH MOLDING REPLACEMENT - REAR DOOR FRAME

Fig. 9: View Of Rear Side Door Window Garnish Molding & Retainers
 Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Rear Door Frame

Callout	Component Name
Preliminary Procedures: Remove the rear door trim panel. Refer to <u>Rear Side Door Trim Panel Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Rear Side Door Trim Panel Replacement (Tahoe/Yukon/Escalade)</u> .	
1	Rear Side Door Window Garnish Molding Retainer (Qty: 7)
2	Rear Side Door Window Garnish Molding Tip: 1. Install the 2 lower clips to the window flange between the corners. 2. Install the 2 side clips to the window flange between the corners. 3. Install the remaining 3 clips around the window flange.

ARMREST REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

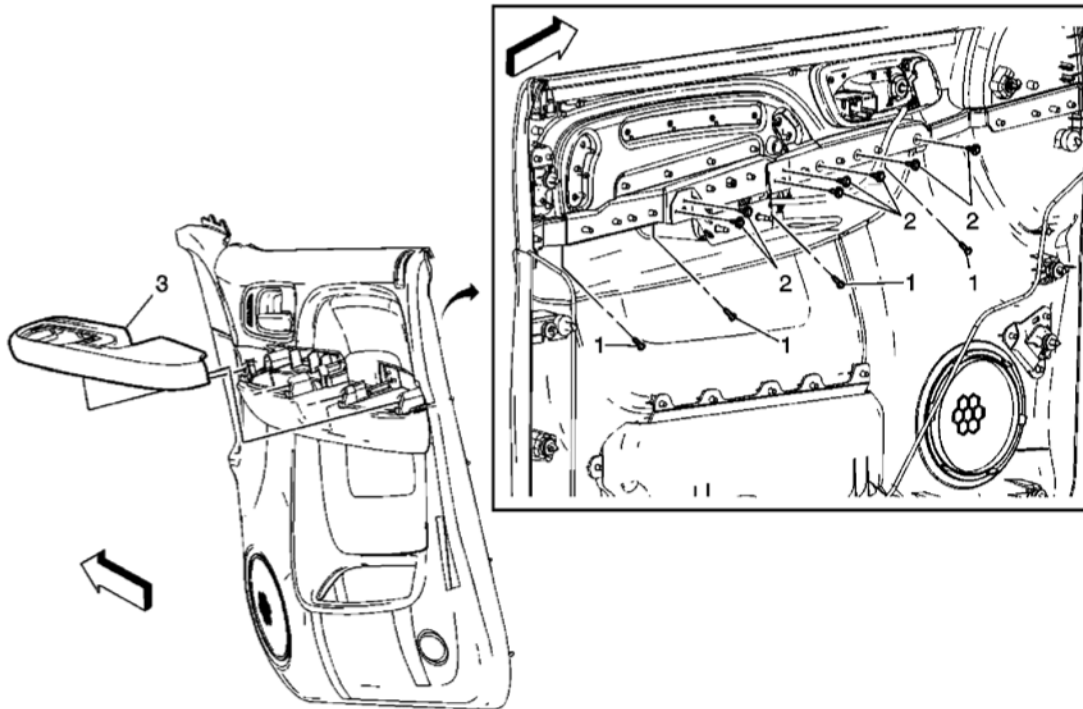


Fig. 10: View Of Frontside Door Armrest Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Armrest Replacement

Callout	Component Name
Preliminary Procedures	
1. Remove door upper trim panel. Refer to <u>Trim Panel Replacement - Upper Extension (Escalade)</u> or <u>Trim Panel Replacement - Upper Extension (Tahoe/Yukon)</u> .	
2. Remove door window control switch. Refer to <u>Door Lock and Side Window Switch Replacement - Driver</u> or <u>Door Lock and Side Window Switch Replacement - Passenger</u> .	
3. Remove door trim panel. Refer to <u>Front Side Door Trim Panel Replacement</u> .	
1	Front Side Door Armrest Bolts (Qty: 4) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Side Door Trim Panel Bolts (Qty: 7) Tighten: 2 N.m (18 lb in)
3	Front Side Door Armrest Assembly

FRONT SIDE DOOR SILL PLATE REPLACEMENT

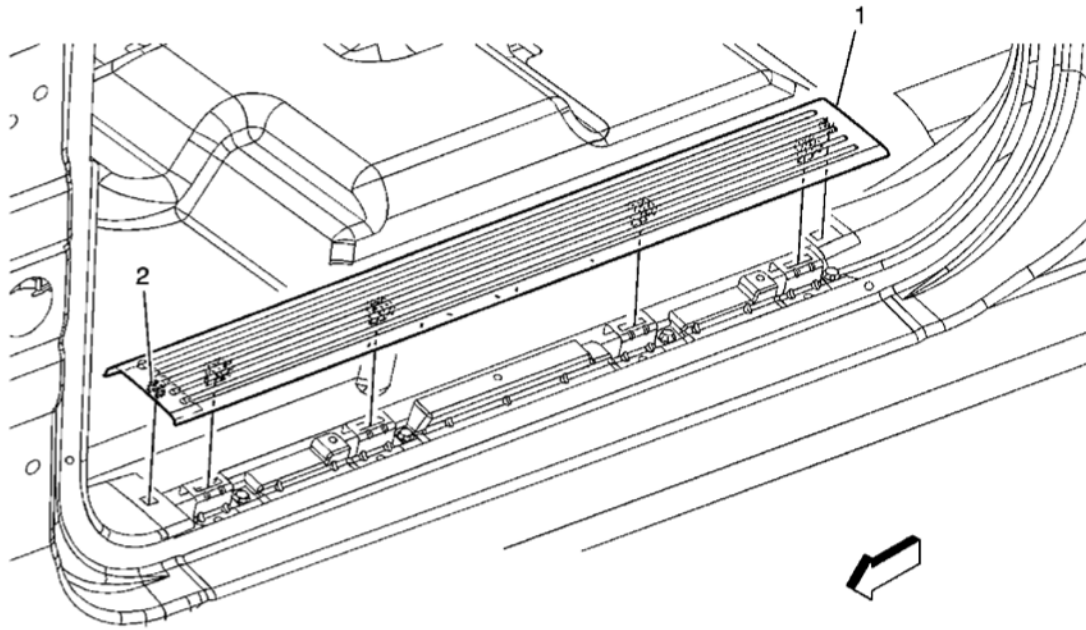


Fig. 11: View Of Front Side Door Sill Plate Assembly & Retainers
 Courtesy of GENERAL MOTORS CORP.

Front Side Door Sill Plate Replacement

Callout	Component Name
1	Front Side Door Sill Trim Plate Assembly
2	Front Side Door Trim Plate Retainer (Qty: 6)

REAR SIDE DOOR SILL PLATE REPLACEMENT (EXTENDED WHEELBASE)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

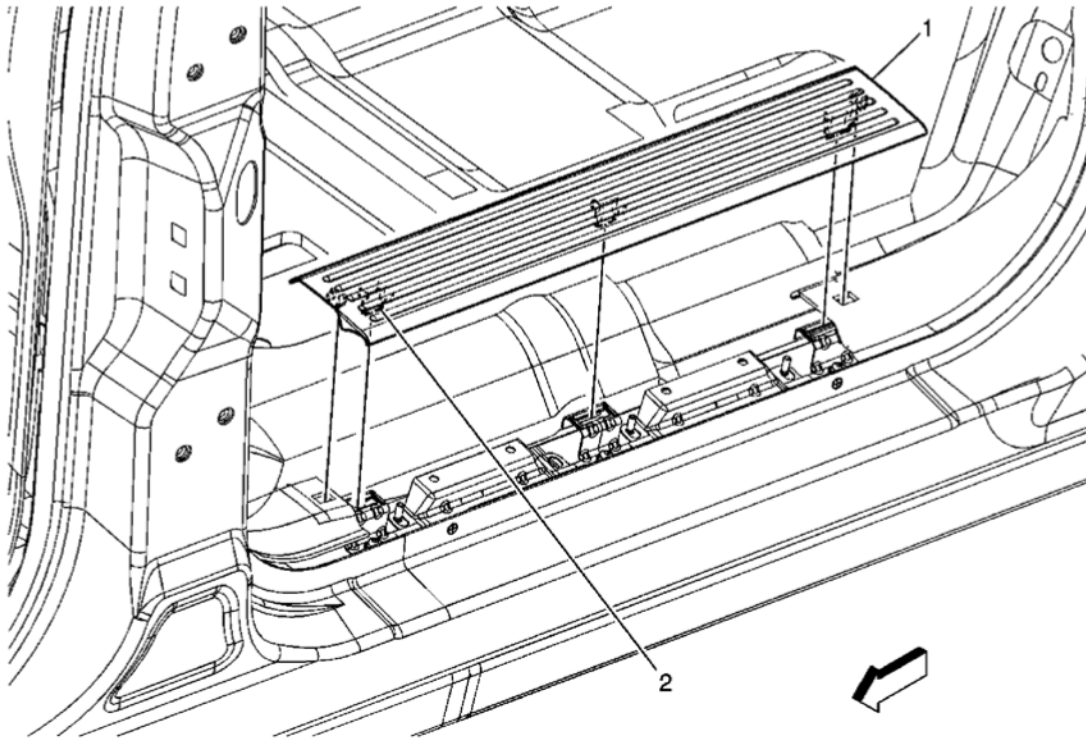


Fig. 12: View Of Rear Side Door Trim Plate Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Rear Side Door Sill Plate Replacement (Extended Wheelbase)

Callout	Component Name
Fastener Tightening Specifications: Refer to <u>Fastener Tightening Specifications</u>.	
1	Rear Side Door Sill Trim Plate Assembly
2	Rear Side Door Trim Plate Retainer (Qty: 5)

REAR SIDE DOOR SILL PLATE REPLACEMENT (STANDARD WHEELBASE)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

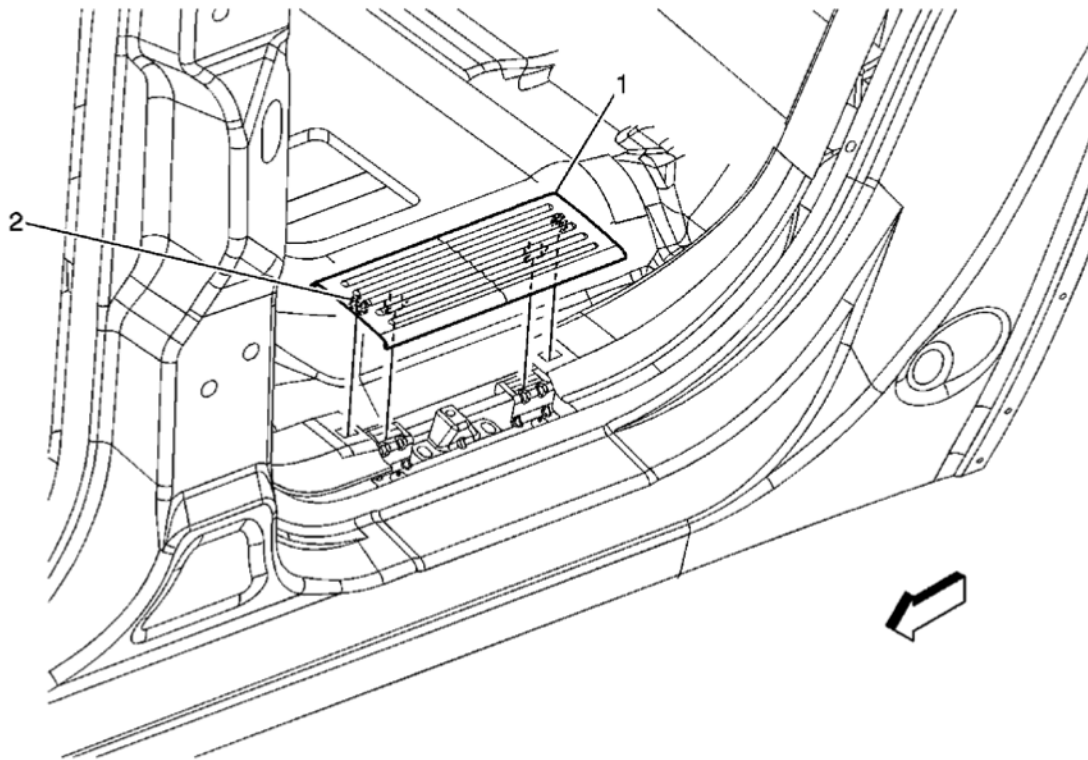


Fig. 13: View Of Rear Side Door Sill Plate Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Rear Side Door Sill Plate Replacement (Standard Wheelbase)

Callout	Component Name
1	Rear Side Door Sill Trim Plate Assembly Tip: Reposition the door opening weatherstrip out of the way.
2	Rear Side Door Trim Plate Retainers (Qty: 4)

DOOR SILL PLATE REPLACEMENT - LIFTGATE

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

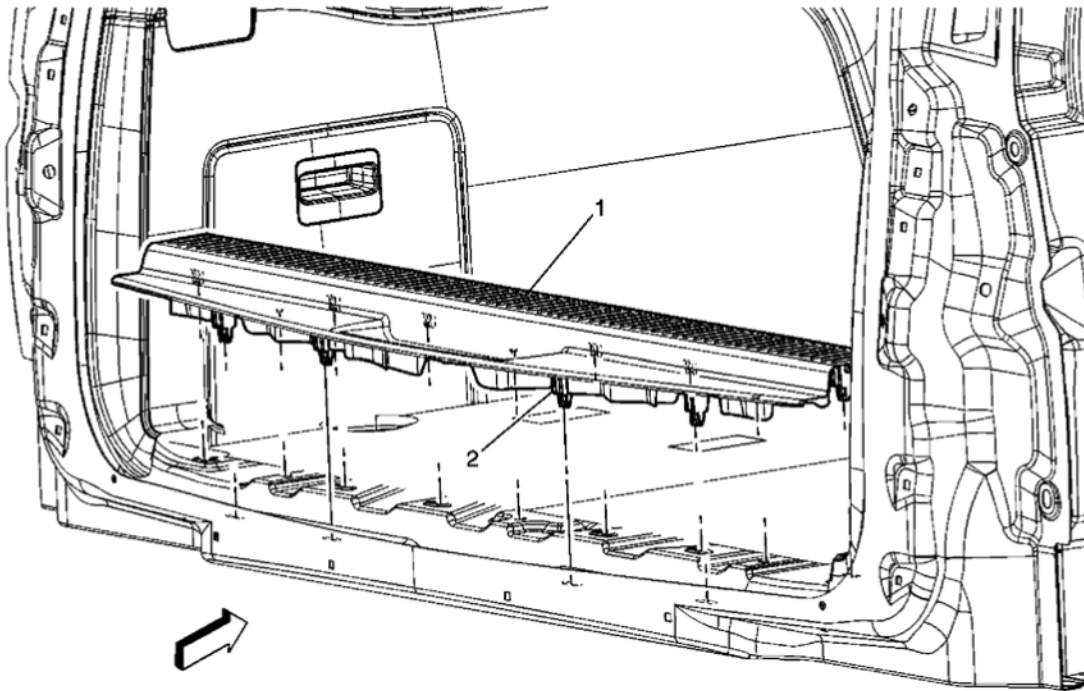


Fig. 14: View Of Rear Floor Rear Trimplate Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Door Sill Plate Replacement - Liftgate

Callout	Component Name
Fastener Tightening Specifications: Refer to <u>Fastener Tightening Specifications</u> .	
1	Rear Floor Rear Trim Plate Assembly
2	Rear Floor Rear Trim Plate Retainer (Qty: 10)

ASSIST HANDLE REPLACEMENT - FRONT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

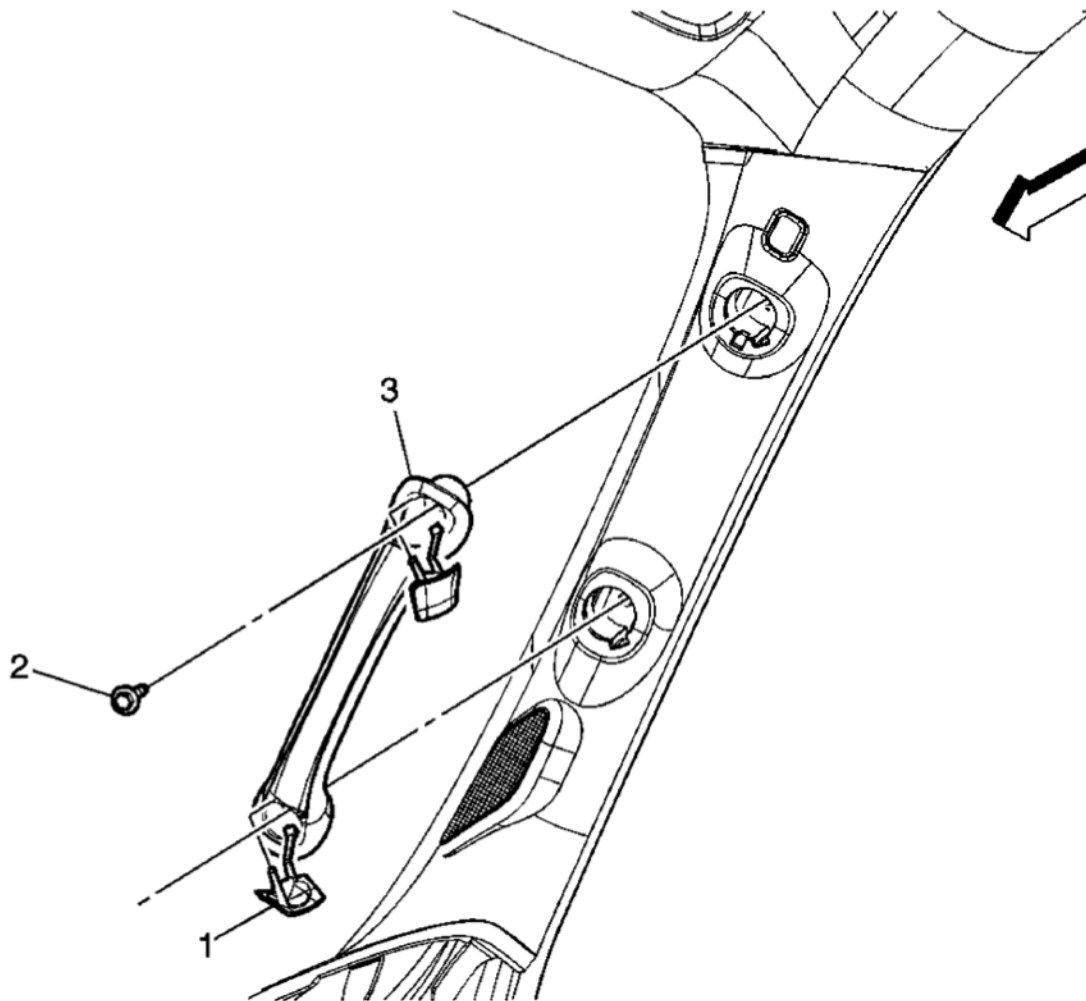


Fig. 15: View Of Windshield Pillar Assist Handle Cover Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Assist Handle Replacement - Front

Callout	Component Name
1	Windshield Pillar Assist Handle Cover (Qty: 2)
2	Windshield Pillar Assist Handle Cover Screw (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 6 N.m (53 lb in)
3	Windshield Pillar Assist Handle Cover Assembly

ROOF RAIL REAR ASSIST HANDLE REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

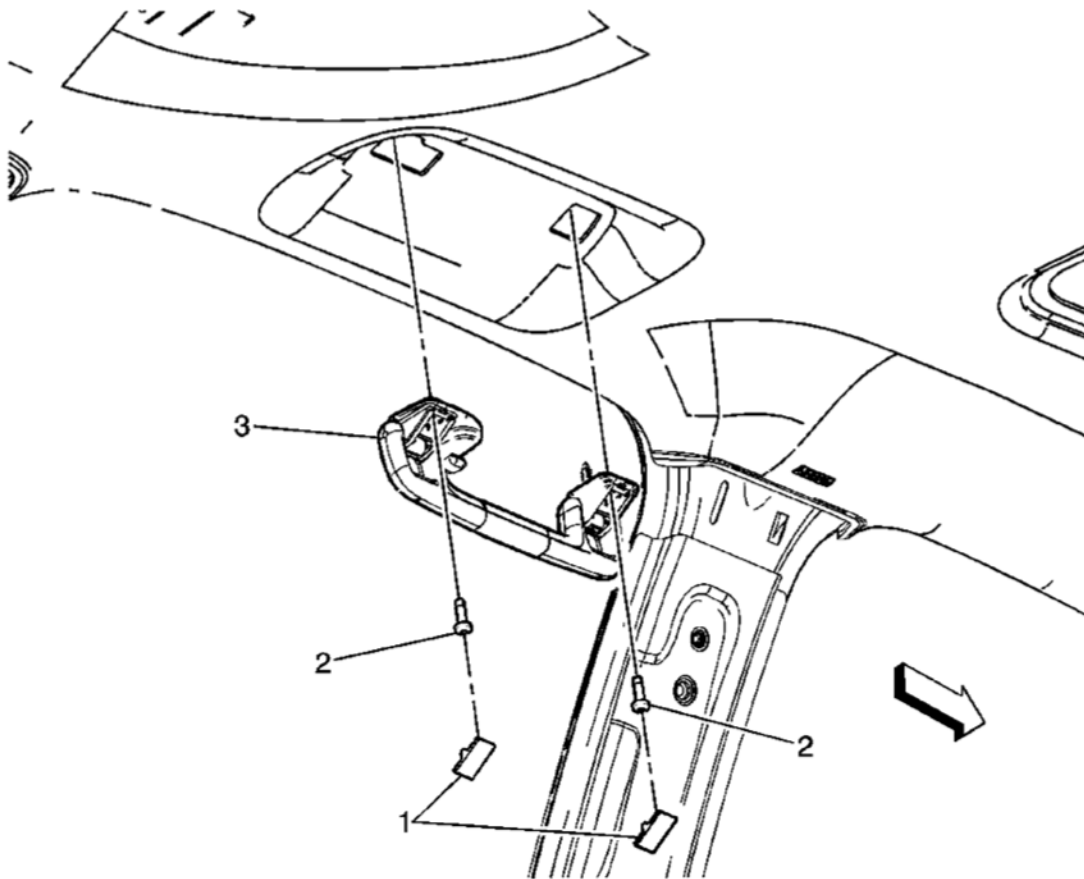


Fig. 16: View Of Roof Rail Rear Assist Handle Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Roof Rail Rear Assist Handle Replacement

Callout	Component Name
1	Roof Rail Rear Assist Handle Cover (Qty: 2)
2	Roof Rail Rear Assist Handle Screw (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 6 N.m (53 lb in)
3	Roof Rail Rear Assist Handle Assembly Tip: Pull assist handle downward to access covers and fasteners.

COAT HOOK REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

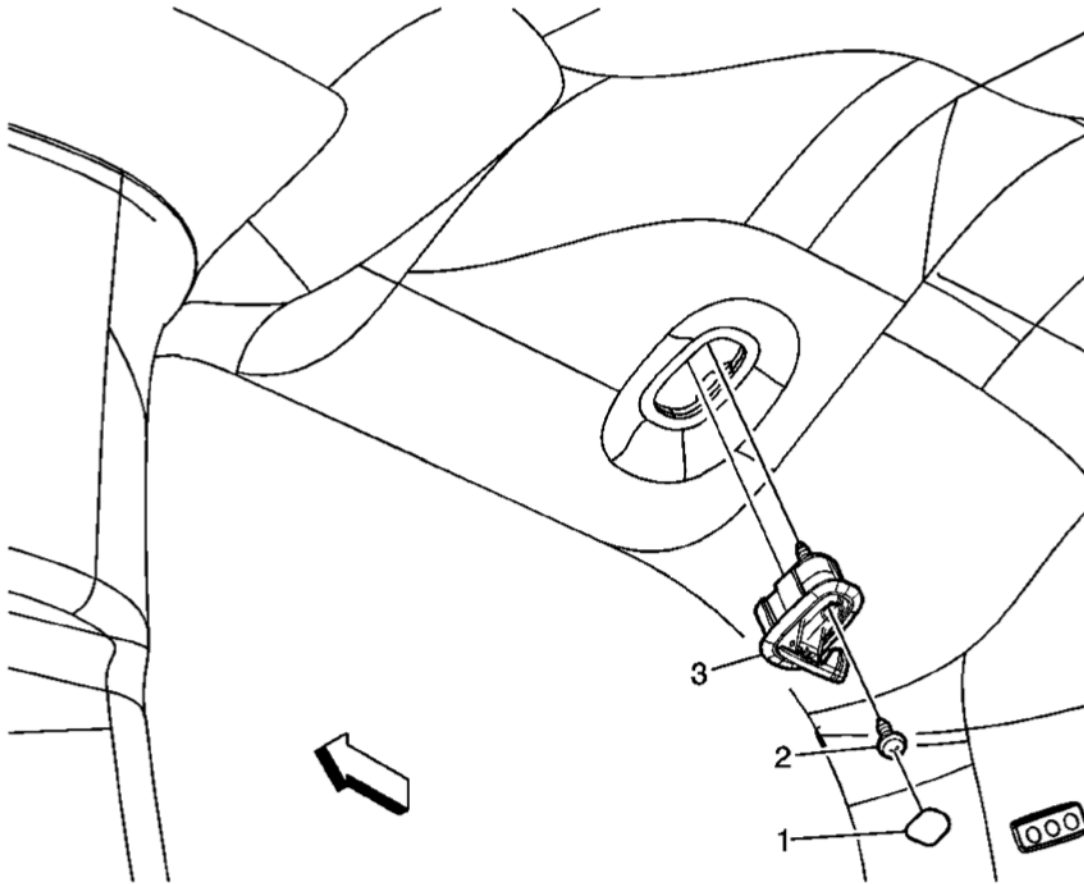


Fig. 17: View Of Coathook Assembly, Cover & Screw
Courtesy of GENERAL MOTORS CORP.

Coat Hook Replacement

Callout	Component Name
1	Coat Hook Assembly Cover
2	Coat Hook Screw (Qty: 1) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 9 N.m (80 lb in)
3	Coat Hook Assembly Tip: Pull hook downward to access cover and fastener.

SUNSHADE REPLACEMENT

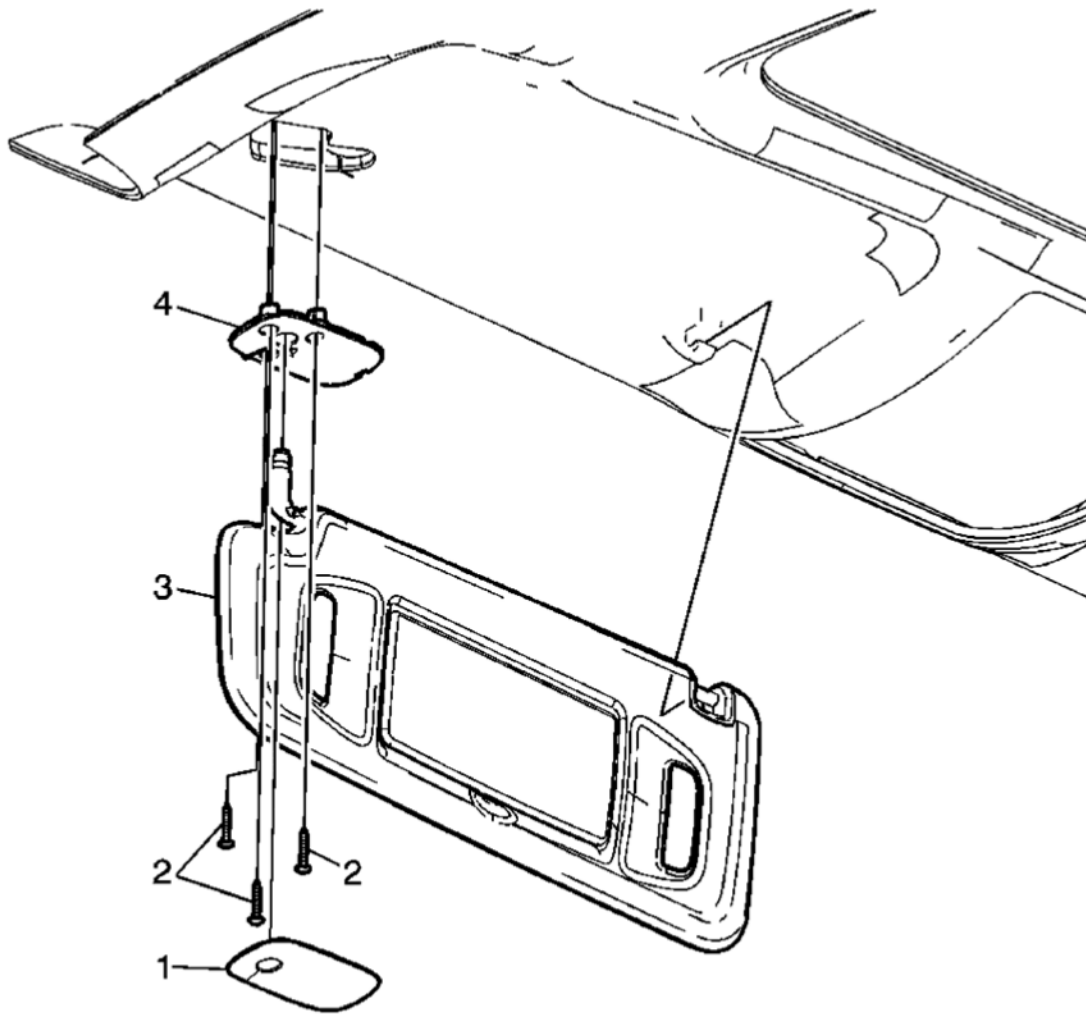


Fig. 18: View Of Sunshade Assembly & Components
 Courtesy of GENERAL MOTORS CORP.

Sunshade Replacement

Callout	Component Name
1	Sunshade Bracket Cover
2	Windshield Side Garnish Molding Screw (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 6 N.m (53 lb in)
3	Sunshade Assembly Tip: Disconnect electrical connectors.
4	Sunshade Bracket

GARNISH MOLDING REPLACEMENT - WINDSHIELD PILLAR

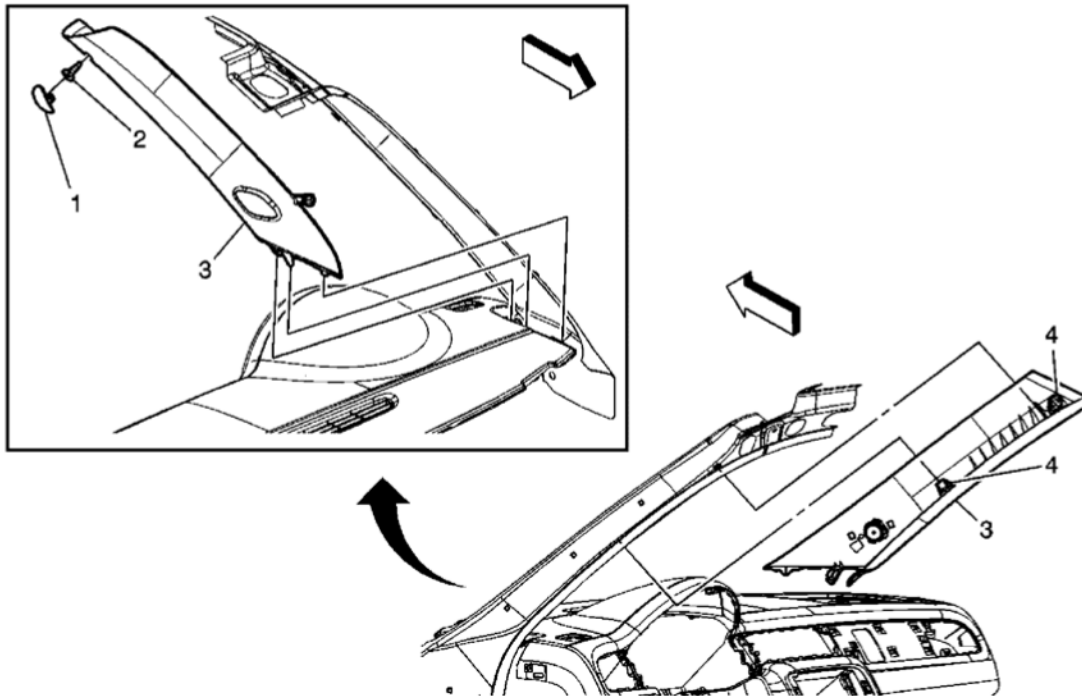


Fig. 19: View Of Windshield Side Garnish Molding Assembly
Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Windshield Pillar

Callout	Component Name
Preliminary Procedures	
1. Disable roof rail SIR system. Refer to SIR Disabling and Enabling . 2. Remove front assist handle (passenger side only). Refer to Assist Handle Replacement - Front.	
1	Windshield Side Garnish Molding Cover
2	Windshield Side Garnish Molding Screw NOTE: Refer to Fastener Notice . Tighten: 2 N.m (18 lb in)
3	Windshield Side Garnish Molding Assembly Tip: 1. Tabs must be installed prior to retainers. 2. Tabs to be fully seated in I/P trim panel retainer and valance panel.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

	3. Disconnect electrical connectors.
4	Windshield Side Garnish Molding Retainer (Qty: 2)

GARNISH MOLDING REPLACEMENT - CENTER PILLAR UPPER

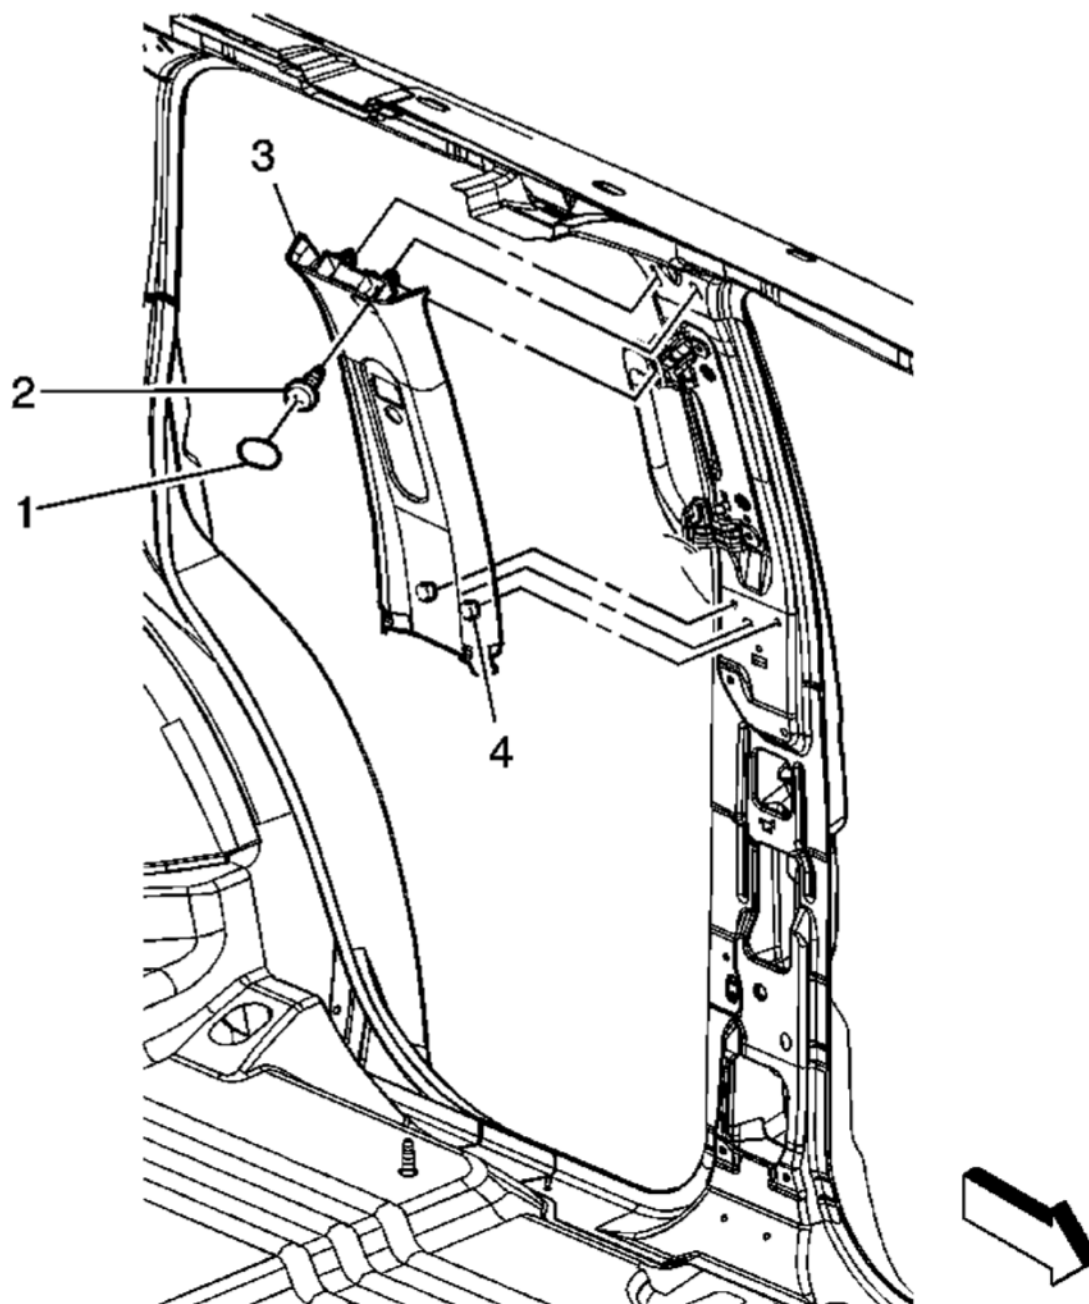


Fig. 20: View Of Center Pillar Upper Garnish Molding Assembly & Components
Courtesy of GENERAL MOTORS CORP.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

Garnish Molding Replacement - Center Pillar Upper

Callout	Component Name
Preliminary Procedures	
1. Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> . 2. Remove center pillar lower garnish molding. Refer to <u>Garnish Molding Replacement - Center Pillar Lower</u>.	
1	Center Pillar Upper Garnish Molding Cover
2	Center Pillar Upper Garnish Molding Screw NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
3	Center Pillar Upper Garnish Molding Assembly Tighten: 35 N.m (25 lb ft) Tip: 1. Remove seat belt D-ring from the adjuster assembly. 2. Pull garnish molding toward inside of the vehicle to disengage the retainers. 3. Align 4-way locator to center pillar before engaging retainers.
4	Center Pillar Upper Garnish Molding Retainer (Qty: 4)

GARNISH MOLDING REPLACEMENT - CENTER PILLAR LOWER

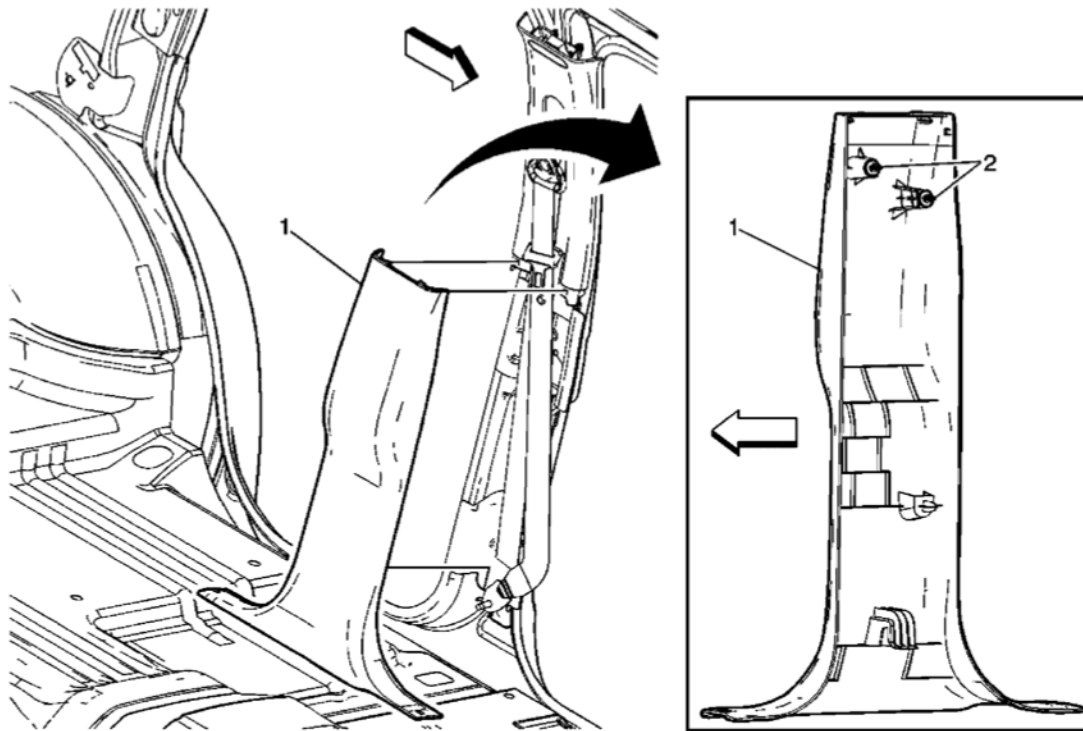


Fig. 21: View Of Center Pillar Lower Garnish Molding Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Center Pillar Lower

Callout	Component Name
Preliminary Procedures	
1. Remove front door sill plate. Refer to <u>Front Side Door Sill Plate Replacement</u>. 2. Remove rear door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u>.	
1	Center Pillar Lower Garnish Molding Assembly Tip: 1. Ensure seat belt webbing does not become trapped during installation. 2. Tab to be fully seated and installed prior to retainer.
2	Center Pillar Lower Garnish Molding Retainer (Qty: 2)

GARNISH MOLDING REPLACEMENT - REAR UPPER (AVALANCHE/ESCALADE EXT)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

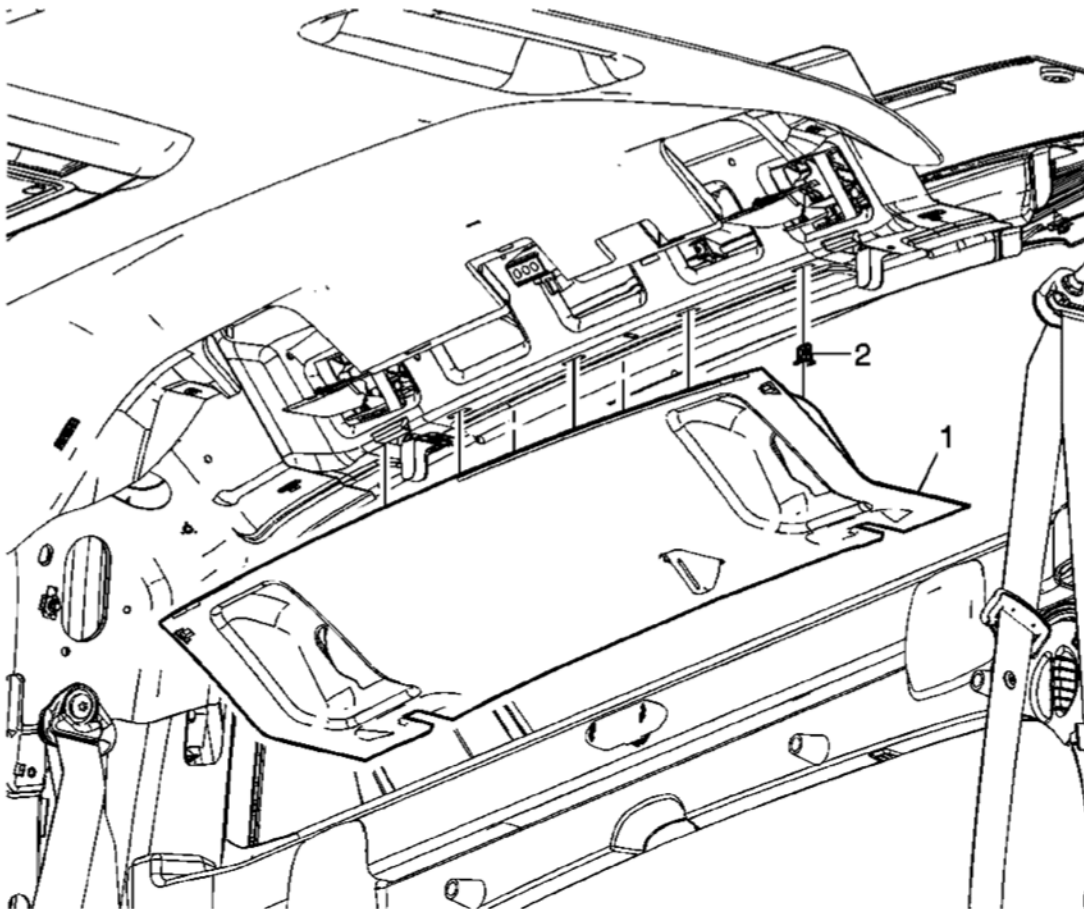


Fig. 22: View Of Headliner Trim Panel Molding Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Rear Upper (Avalanche/Escalade EXT)

Callout	Component Name
Preliminary Procedures	
1. Remove rear window from the vehicle.	
2. Remove body lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)</u> .	
1	Headliner Trim Panel Molding Retainer (Qty: 7)
2	Headliner Trim Panel Molding Assembly Tip: Disconnect electrical connector.

GARNISH MOLDING REPLACEMENT - REAR CORNER (TAHOE/SUBURBAN)

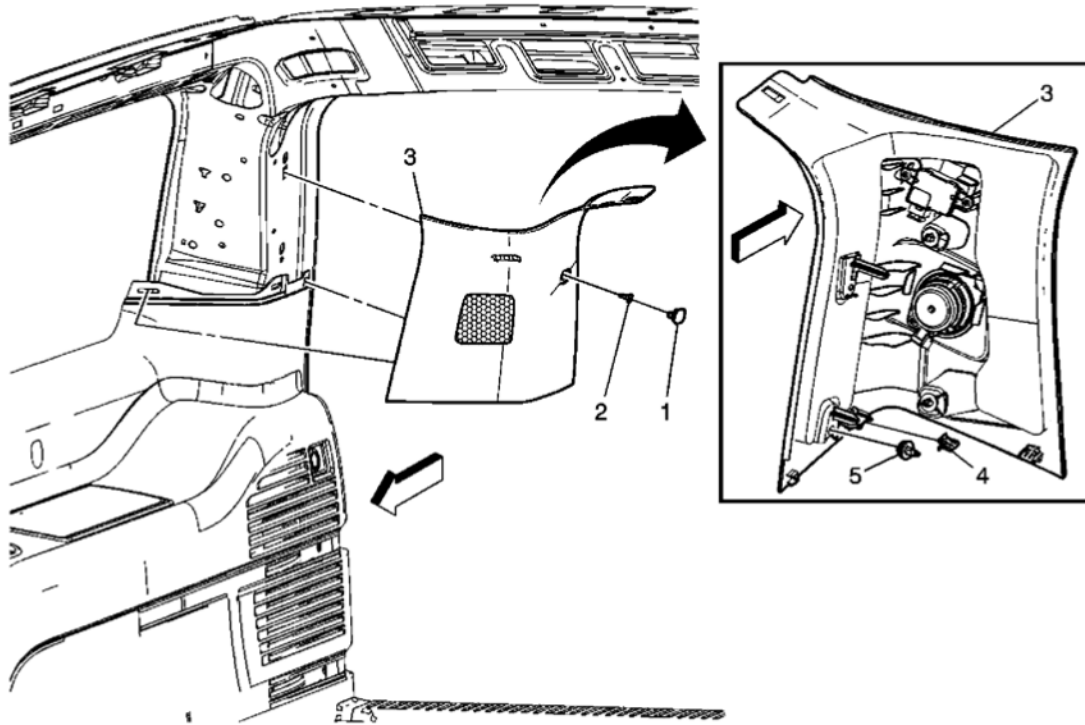


Fig. 23: View Of Body Rear Corner Upper Garnish Molding Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)

Callout	Component Name
Preliminary Procedures	
1. Disable roof rail SIR system. Refer to SIR Disabling and Enabling . 2. Remove rear opening garnish molding. Refer to Garnish Molding Replacement - Rear Door Upper.	
1	Body Rear Corner Upper Garnish Molding Cover Tip: Disconnect the 2 electrical connectors.
2	Body Rear Corner Upper Garnish Molding Screw NOTE: Refer to Fastener Notice . Tighten: 2 N.m (18 lb in)
3	Body Rear Corner Upper Garnish Molding Assembly
4	Body Rear Corner Upper Garnish Molding Clips (Qty: 3)
5	Body Rear Corner Upper Garnish Molding Retainers (Qty: 3)

GARNISH MOLDING REPLACEMENT - REAR DOOR UPPER

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

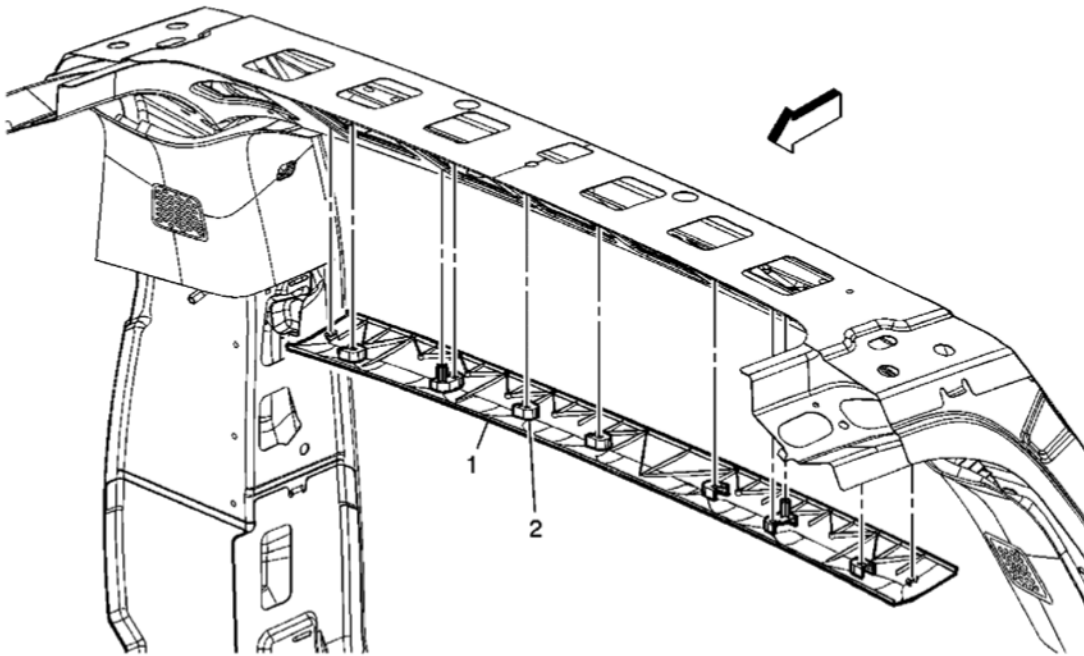


Fig. 24: View Of Back Body Opening Garnish Molding Assembly & Clips
Courtesy of GENERAL MOTORS CORP.

Garnish Molding Replacement - Rear Door Upper

Callout	Component Name
Fastener Tightening Specifications: Refer to <u>Fastener Tightening Specifications</u> .	
1	Back Body Opening Garnish Molding Assembly
2	Back Body Opening Garnish Molding Assembly Clip (Qty: 7)

BODY HINGE PILLAR TRIM PANEL REPLACEMENT

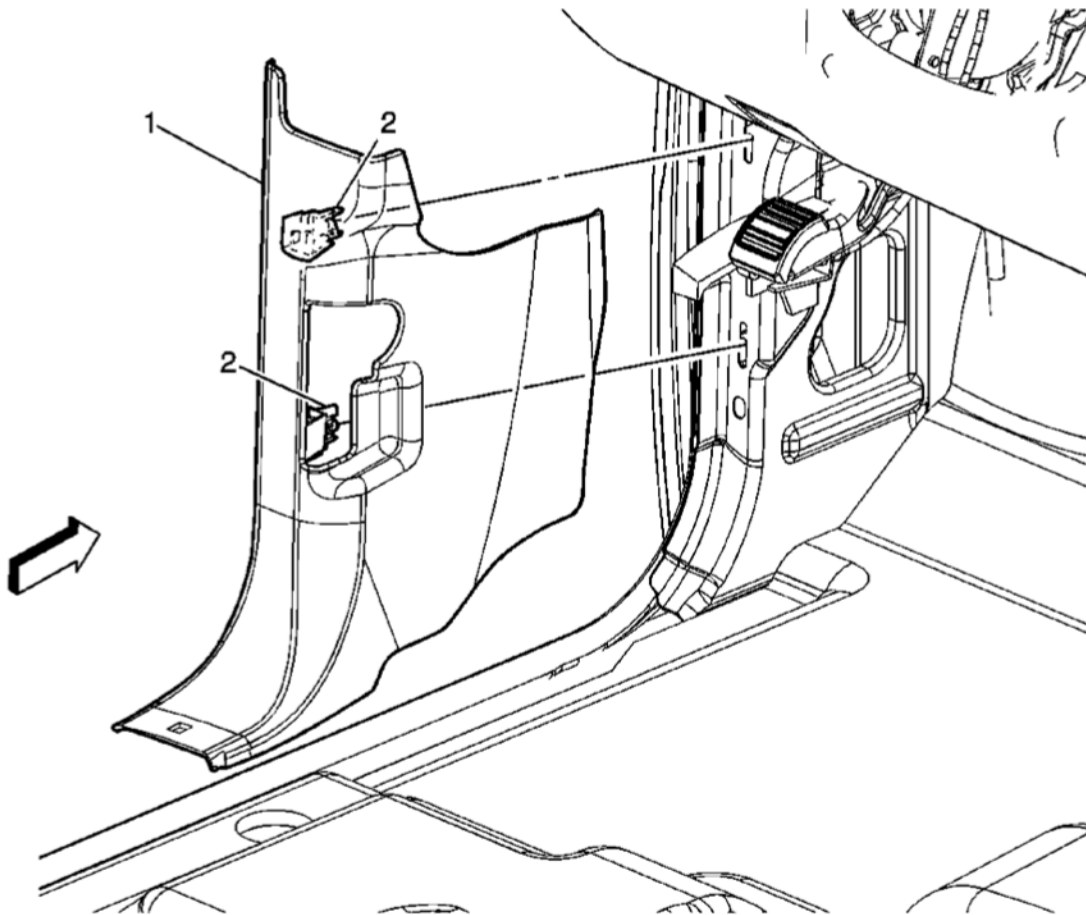


Fig. 25: View Of Front Hinge Pillar Trim Panel Assembly & Retainers
 Courtesy of GENERAL MOTORS CORP.

Body Hinge Pillar Trim Panel Replacement

Callout	Component Name
Preliminary Procedures: Remove front door sill trim panel. Refer to Front Side Door Sill Plate Replacement .	
1	Front Hinge Pillar Trim Panel Assembly Tip: The hood release handle must be in the open position for installation of the LH hinge pillar panel.
2	Front Hinge Pillar Trim Panel Assembly Retainer (Qty: 2)

TRIM PANEL REPLACEMENT - REAR QUARTER - LEFT (EXTENDED WHEELBASE W/E61)

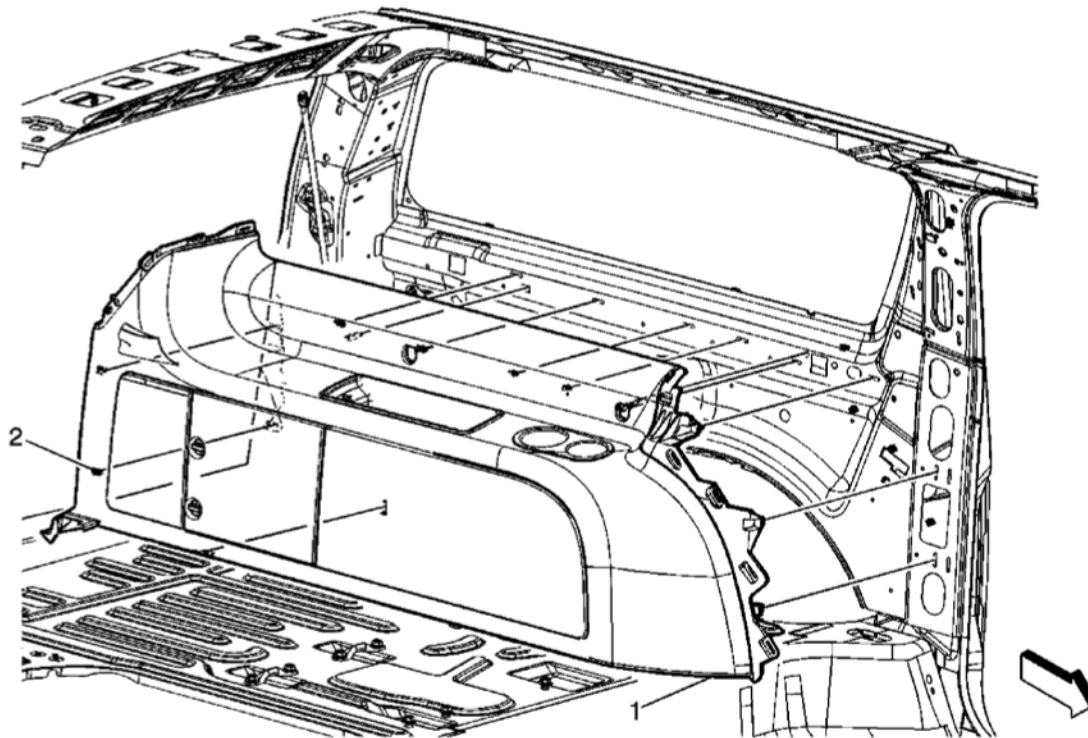


Fig. 26: View Of Body Side Trim Panel Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Rear Quarter - Left (Extended Wheelbase w/E61)

Callout	Component Name
Preliminary Procedures	
1.	Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove third row seats. Refer to <u>Rear Number 2 Seat Replacement (Suburban/Yukon XL)</u> or <u>Rear Number 2 Seat Replacement (Tahoe/Yukon/Escalade)</u> .
3.	Remove rear opening garnish molding. Refer to <u>Garnish Molding Replacement - Rear Door Upper</u> .
4.	Remove back rear corner upper garnish molding. Refer to <u>Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)</u> .
5.	Remove rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u> .
6.	Remove body side lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)</u> .
1	Body Side Trim Panel Assembly Tip: Align locators to body side inner panel prior to engaging retainers.

2 | Body Side Trim Panel Retainer (Qty: 10)

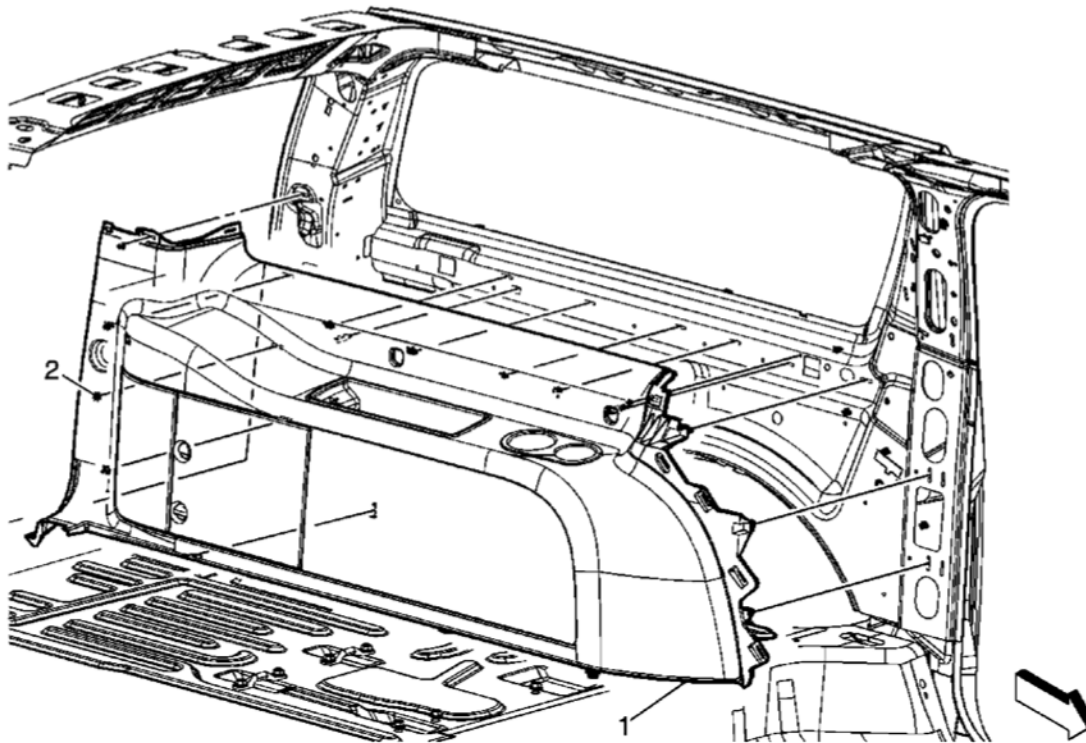
TRIM PANEL REPLACEMENT - REAR QUARTER - LEFT (EXTENDED WHEELBASE W/O E61)

Fig. 27: View Of Body Side Trim Panel Assembly & Retainers
 Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Rear Quarter - Left (Extended Wheelbase w/o E61)

Callout	Component Name
Preliminary Procedures	
1.	Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove third row seats. Refer to <u>Rear Number 2 Seat Replacement (Suburban/Yukon XL)</u> or <u>Rear Number 2 Seat Replacement (Tahoe/Yukon/Escalade)</u> .
3.	Remove rear opening garnish molding. Refer to <u>Garnish Molding Replacement - Rear Door Upper</u> .
4.	Remove back rear corner upper garnish molding. Refer to <u>Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)</u> .
5.	Remove rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u> .
6.	Remove body side lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement</u>

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

(Suburban/Yukon XL/Escalade ESV) or Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade).

1	Body Side Trim Panel Assembly Tip: Align locators to body side inner panel prior to engaging retainers.
2	Body Side Trim Panel Retainer (Qty: 12)

TRIM PANEL REPLACEMENT - REAR QUARTER - LEFT (STANDARD WHEELBASE W/E61)

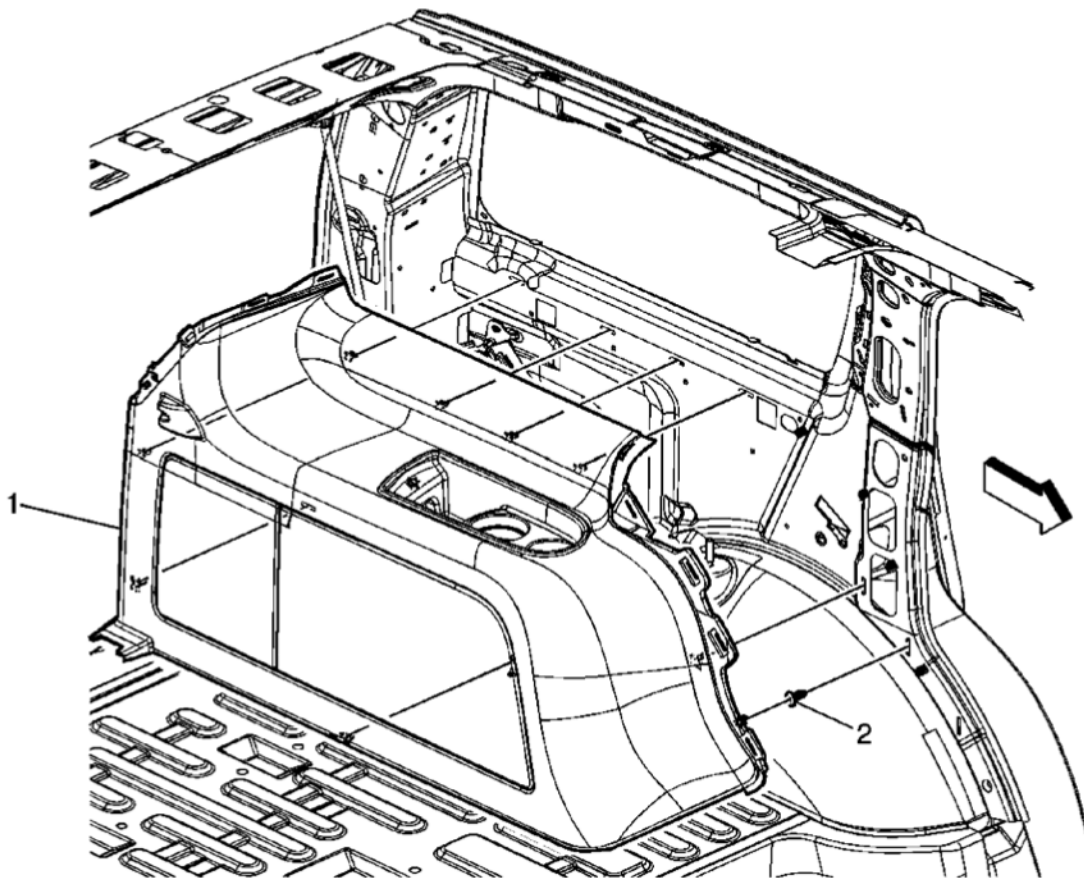


Fig. 28: View Of Body Side Trim Panel Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Rear Quarter - Left (Standard Wheelbase w/E61)

Callout	Component Name
Preliminary Procedures	
1.	Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove third row seats. Refer to <u>Rear Number 2 Seat Replacement (Suburban/Yukon XL)</u> or <u>Rear Number 2 Seat Replacement (Tahoe/Yukon/Escalade)</u> .
3.	Remove rear opening garnish molding. Refer to <u>Garnish Molding Replacement - Rear Door</u>

Upper.

4. Remove back rear corner upper garnish molding. Refer to **Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)**.
5. Remove rear side door sill plate. Refer to **Rear Side Door Sill Plate Replacement (Extended Wheelbase)** or **Rear Side Door Sill Plate Replacement (Standard Wheelbase)**.
6. Remove body side lock pillar garnish molding. Refer to **Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)** or **Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)** or **Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)**.

1	Body Side Trim Panel Assembly Tip: Align 4-way locator and then 2-way locator to body side inner panel.
2	Body Side Trim Panel Retainer (Qty: 8)

TRIM PANEL REPLACEMENT - REAR QUARTER - LEFT (STANDARD WHEELBASE W/O E61)

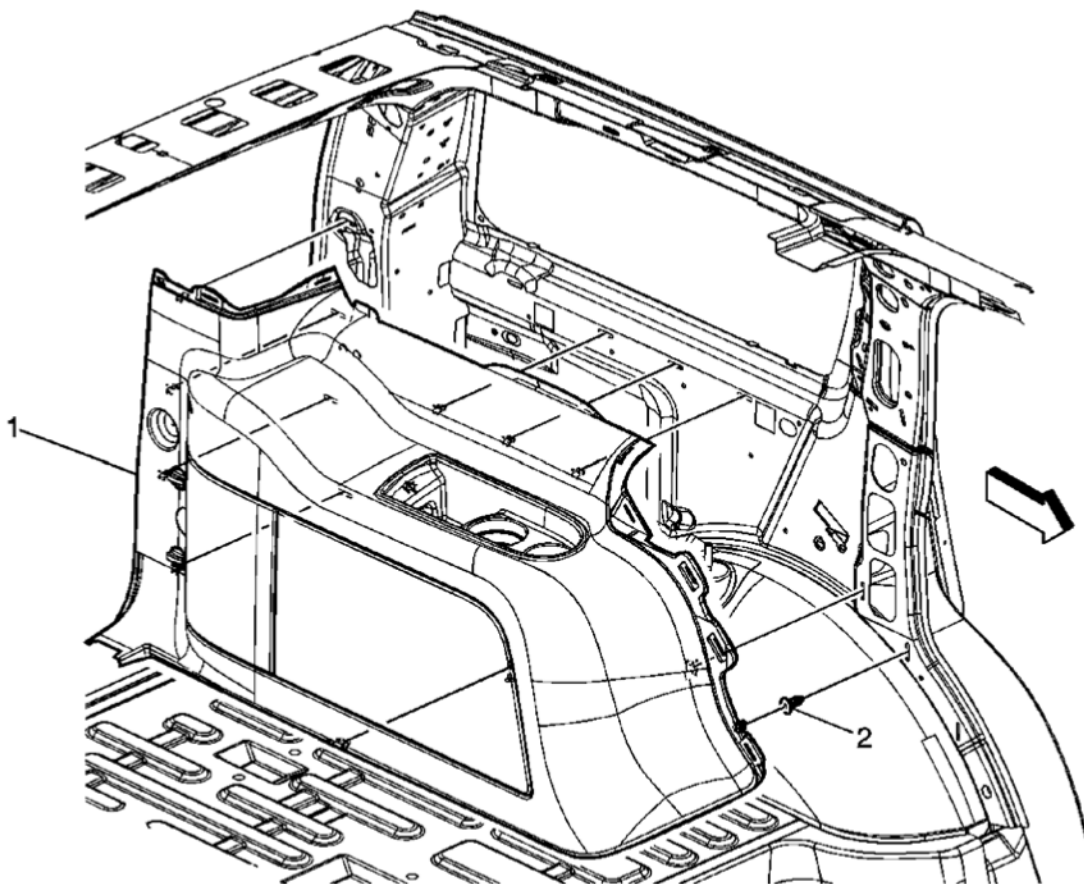



Fig. 29: View Of Body Side Trim Panel Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

Callout	Component Name
Preliminary Procedures	
1.	Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove third row seats. Refer to <u>Rear Number 2 Seat Replacement (Suburban/Yukon XL)</u> or <u>Rear Number 2 Seat Replacement (Tahoe/Yukon/Escalade)</u> .
3.	Remove rear opening garnish molding. Refer to <u>Garnish Molding Replacement - Rear Door Upper</u> .
4.	Remove back rear corner upper garnish molding. Refer to <u>Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)</u> .
5.	Remove rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u> .
6.	Remove body side lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)</u> .
1	Body Side Trim Panel Assembly Tip: Align 4-way locator to body side inner and then 2-way locator to body back opening.
2	Body Side Trim Panel Retainer (Qty: 9)

TRIM PANEL REPLACEMENT - REAR QUARTER - RIGHT (EXTENDED WHEELBASE)

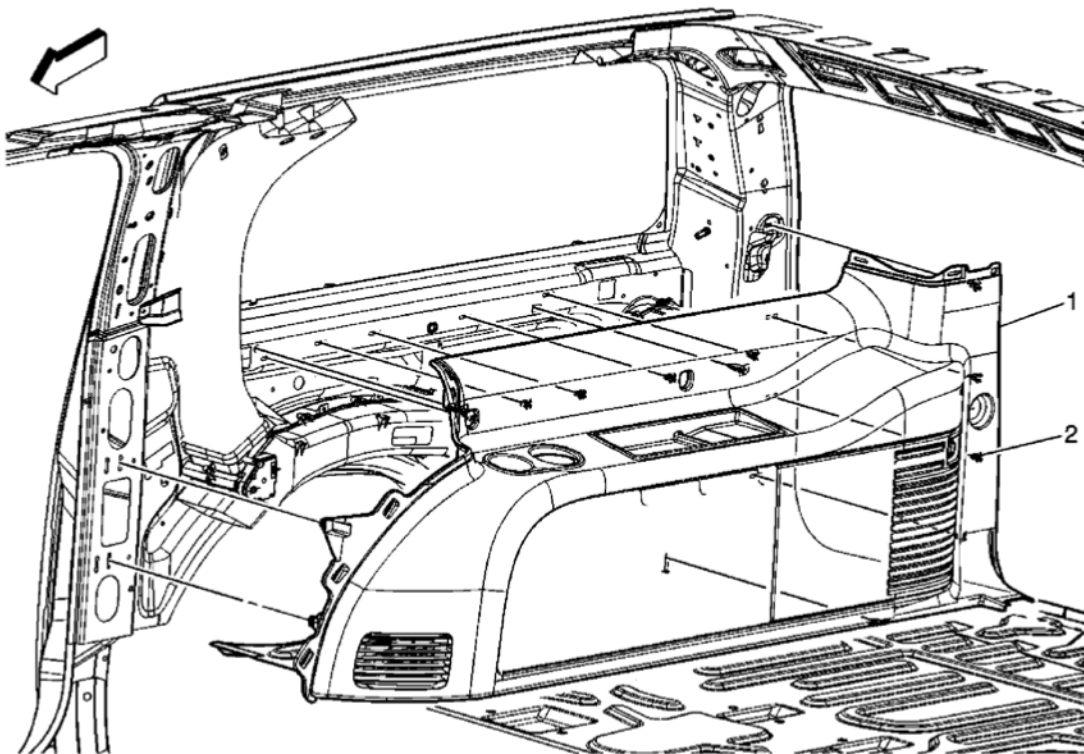

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

Fig. 30: View Of Body Side Trim Panel Assembly & Retainers

Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Rear Quarter - Right (Extended Wheelbase)

Callout	Component Name
Preliminary Procedures	
1. Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> . 2. Remove third row seats. Refer to <u>Rear Number 2 Seat Replacement (Suburban/Yukon XL)</u> or <u>Rear Number 2 Seat Replacement (Tahoe/Yukon/Escalade)</u> . 3. Remove rear opening garnish molding. Refer to <u>Garnish Molding Replacement - Rear Door Upper</u>. 4. Remove back rear corner upper garnish molding. Refer to <u>Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)</u>. 5. Remove rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u>. 6. Remove body side lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)</u>.	
1	Body Side Trim Panel Assembly Tip: 1. Align locators to body side inner panel prior to engaging retainers. 2. Disconnect electrical connector.
2	Body Side Trim Panel Retainer (Qty: 11)

TRIM PANEL REPLACEMENT - REAR QUARTER - RIGHT (STANDARD WHEELBASE)

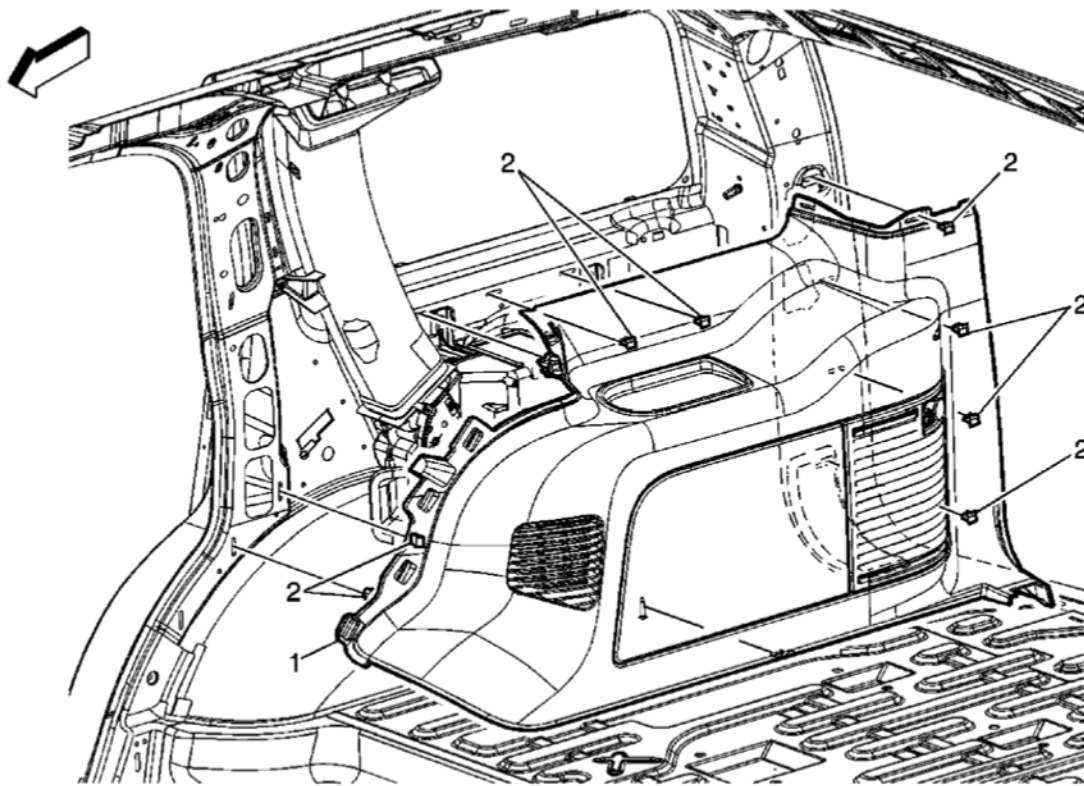


Fig. 31: View Of Body Side Trim Panel Assembly & Retainers

Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Rear Quarter - Right (Standard Wheelbase)

Callout	Component Name
Preliminary Procedures	
1.	Disable the roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove the third row folding seat if equipped. Refer to <u>Rear Number 2 Seat Replacement (Suburban/Yukon XL)</u> or <u>Rear Number 2 Seat Replacement (Tahoe/Yukon/Escalade)</u> .
3.	Remove the rear opening garnish molding. Refer to <u>Garnish Molding Replacement - Rear Door Upper</u> .
4.	Remove the back rear corner upper garnish molding. Refer to <u>Garnish Molding Replacement - Rear Corner (Tahoe/Suburban)</u> .
5.	Remove the rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u> .
6.	Remove the body side lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)</u> .
	Body Side Trim Panel Assembly

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

1	Tip:
	1. Align 4-way locator to body side inner and then 2-way locator to body back opening. 2. Disconnect electrical connector.
2	Body Side Trim Panel Retainers (Qty: 9)

LIFTGATE GARNISH MOLDING REPLACEMENT

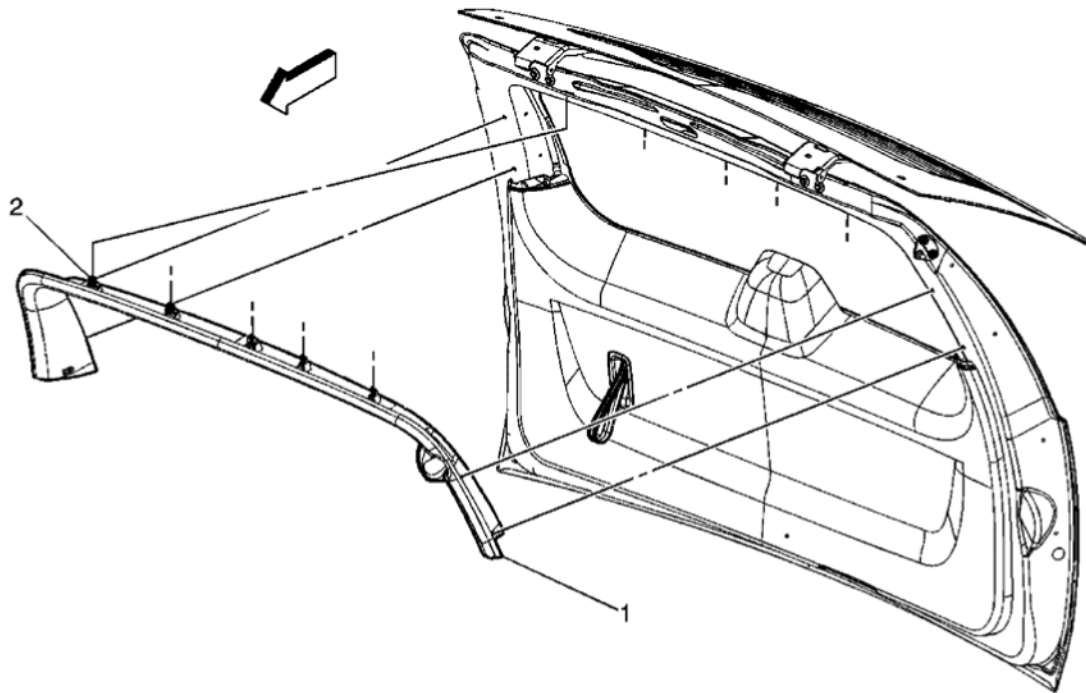


Fig. 32: View Of Liftgate Window Upper Garnish Molding Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Liftgate Garnish Molding Replacement

Callout	Component Name
Preliminary Procedure: Remove the liftgate strut. Refer to <u>Lift Gate Strut Replacement</u> .	
1	Liftgate Window Upper Garnish Molding Assembly
2	Liftgate Window Upper Garnish Molding Retainer (Qty: 9)

TRIM PANEL REPLACEMENT - ENDGATE

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

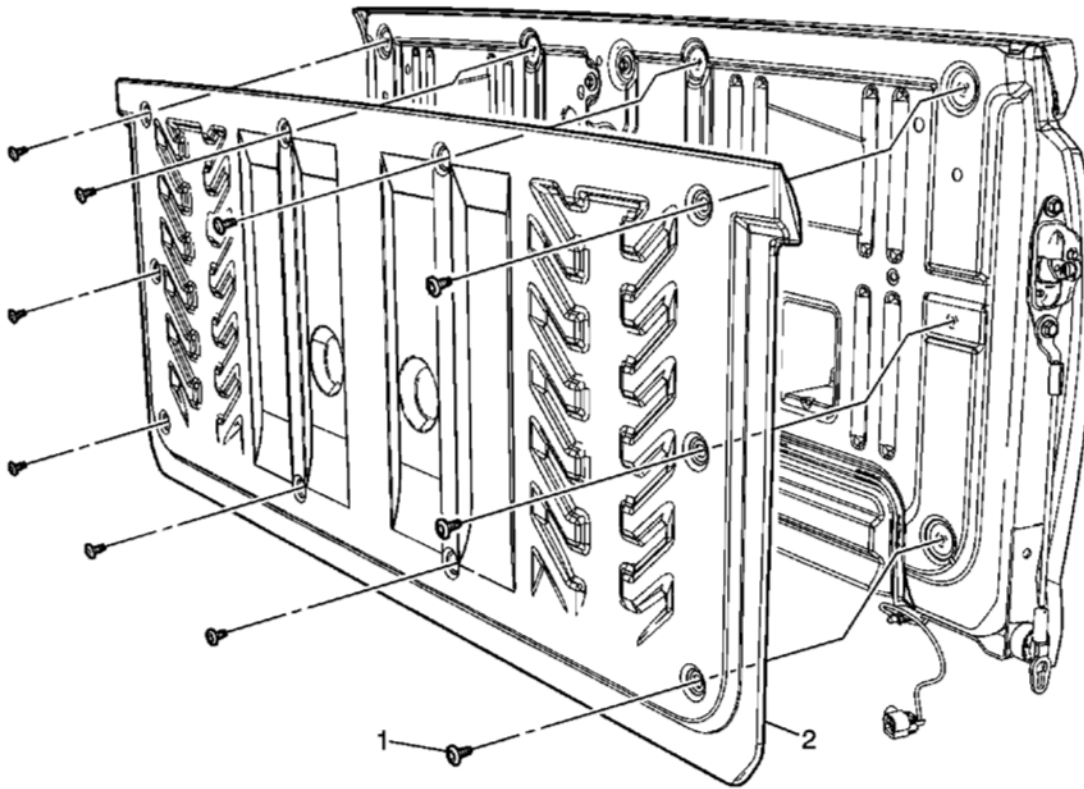


Fig. 33: View Of Endgate Trim Panel & Screws
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Endgate

Callout	Component Name
1	Endgate Trim Panel Screw (Qty: 10) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 9 N.m (80 lb in)
2	Endgate Trim Panel

LIFTGATE TRIM PANEL REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

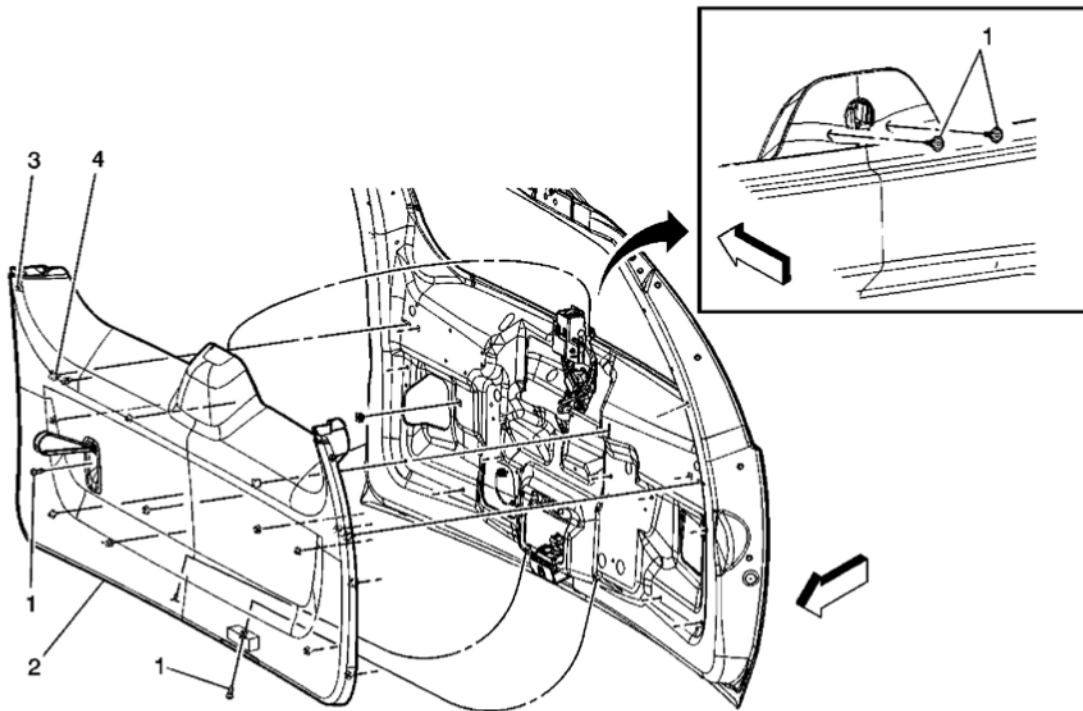


Fig. 34: View Of Liftgate Trim Finish Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Liftgate Trim Panel Replacement

Callout	Component Name
Preliminary Procedure: Remove liftgate window upper garnish molding. Refer to <u>Liftgate Garnish Molding Replacement</u> .	
1	Liftgate Trim Finish Panel Push Pin Retainer (Qty: 2) Tip: Raise liftgate window in order to access push pins.
2	Liftgate Trim Finish Panel Assembly Tip: Disconnect electrical connector.
3	Liftgate Trim Finish Panel Retainer (Qty: 12)
4	Liftgate Trim Finish Panel Clip (Qty: 5)

FLOOR TRIM PLATE REPLACEMENT - REAR (AVALANCHE/ESCALADE EXT)

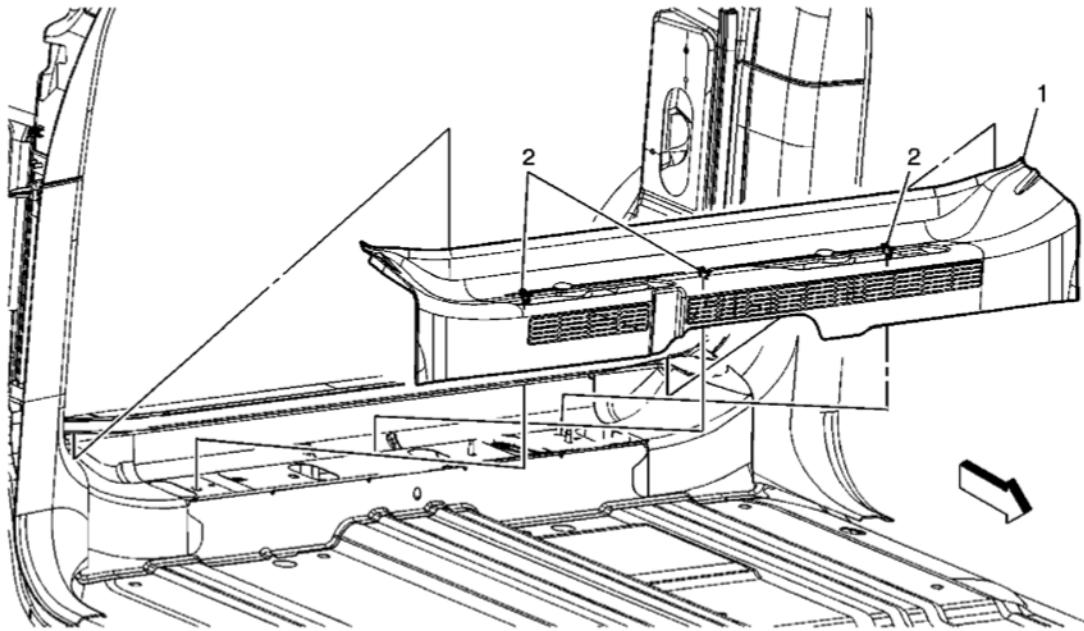


Fig. 35: View Of Rear Floor Trim Plate Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Floor Trim Plate Replacement - Rear (Avalanche/Escalade EXT)

Callout	Component Name
Preliminary Procedures	
1. Remove body lock pillar garnish molding. Refer to <u>Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)</u> or <u>Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)</u> .	
2. Remove midgate hinges. Refer to <u>Hinge Replacement - Midgate</u> .	
1	Rear Floor Trim Plate Assembly
2	Rear Floor Trim Plate Retainers (Qty: 3)

MIDGATE HINGE FINISH COVER REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

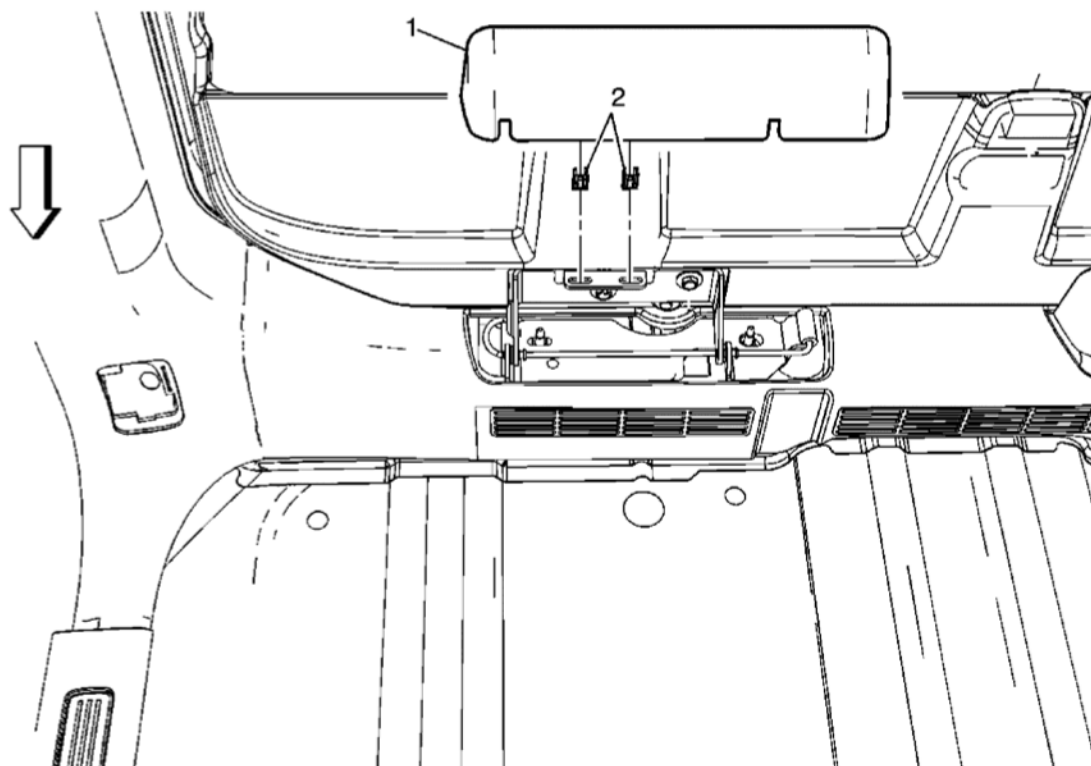


Fig. 36: View Of Midgate Hinge Finish Cover & Clips
Courtesy of GENERAL MOTORS CORP.

Midgate Hinge Finish Cover Replacement

Callout	Component Name
1	Midgate Hinge Finish Cover
2	Midgate Hinge Finish Cover Clip (Qty: 2)

CUP HOLDER REPLACEMENT - FRONT FLOOR CONSOLE - FRONT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

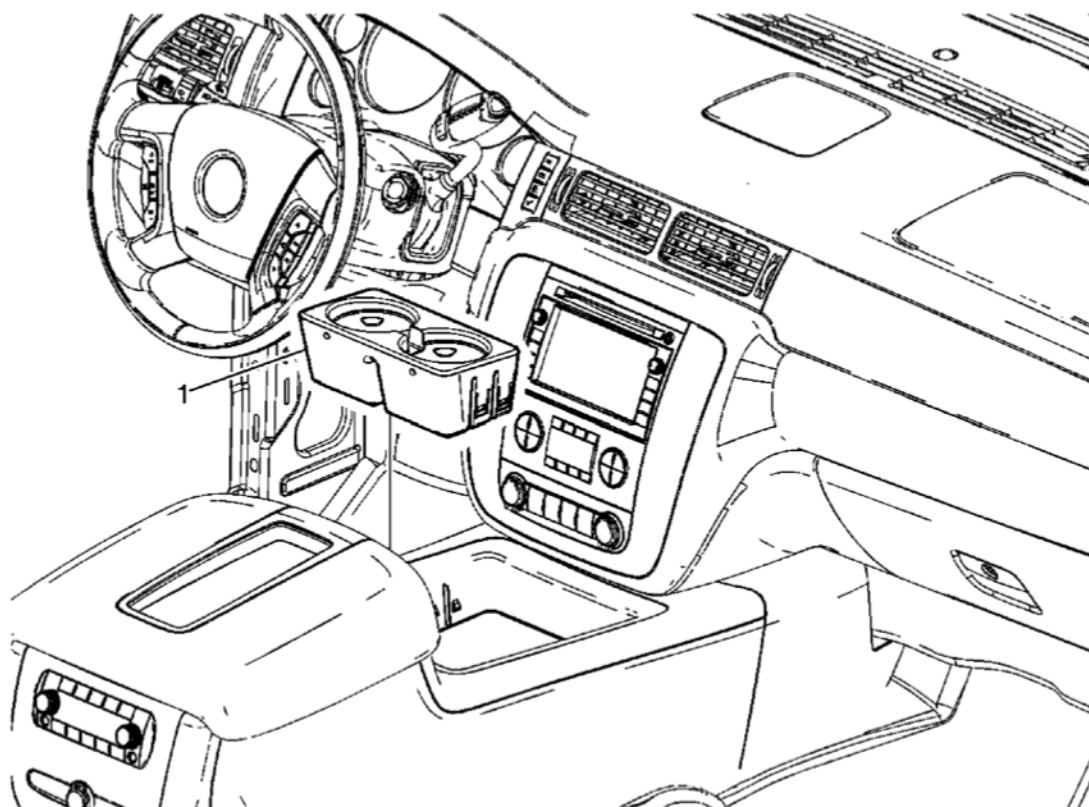


Fig. 37: View Of Front Floor Console Cupholder Assembly
Courtesy of GENERAL MOTORS CORP.

Cup Holder Replacement - Front Floor Console - Front (Except Cadillac)

Callout	Component Name
1	Front Floor Console Cupholder Assembly

CUP HOLDER REPLACEMENT - FRONT FLOOR CONSOLE - REAR (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

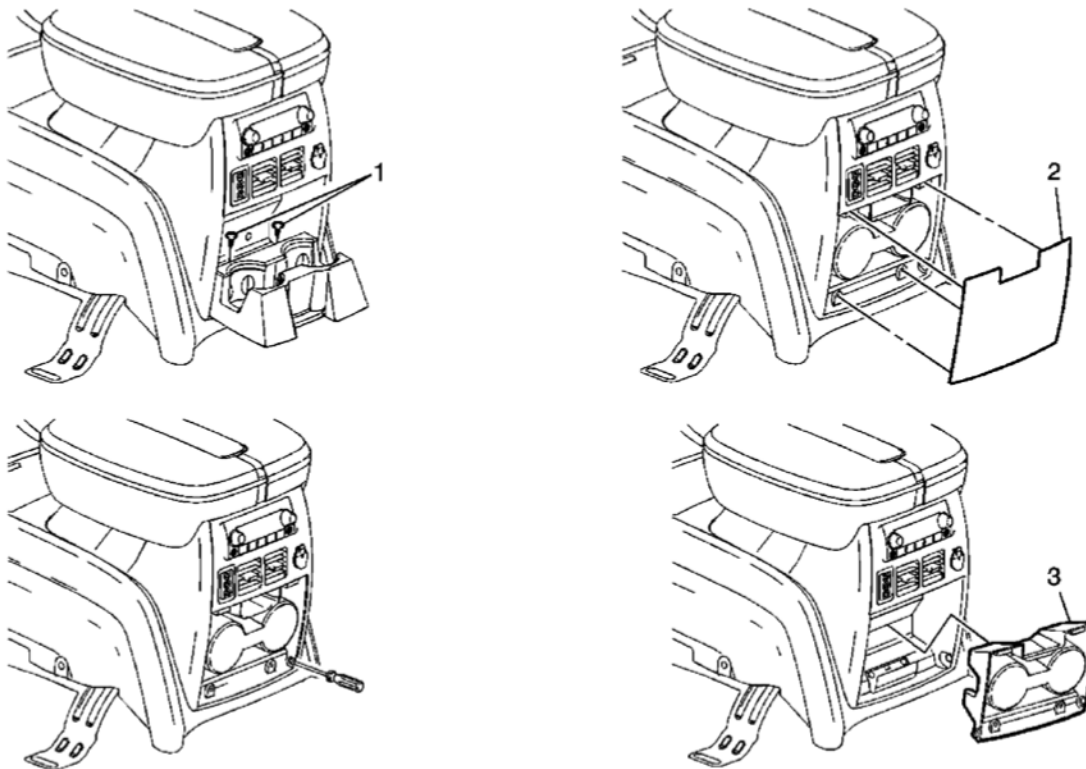


Fig. 38: View Of Front Floor Console Rear Cupholder Assembly, Door & Screws
Courtesy of GENERAL MOTORS CORP.

Cup Holder Replacement - Front Floor Console - Rear (Cadillac)

Callout	Component Name
1	Front Floor Console Rear Cupholder Door Screws (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in) Tip: Open the cupholder and remove the door screws.
2	Front Floor Console Rear Cupholder Door Tip: 1. Close the cupholder and remove the door. 2. Insert a small flat-bladed tool and release the retainer tab.
3	Front Floor Console Rear Cupholder Assembly

CUP HOLDER REPLACEMENT - FRONT FLOOR CONSOLE - REAR (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

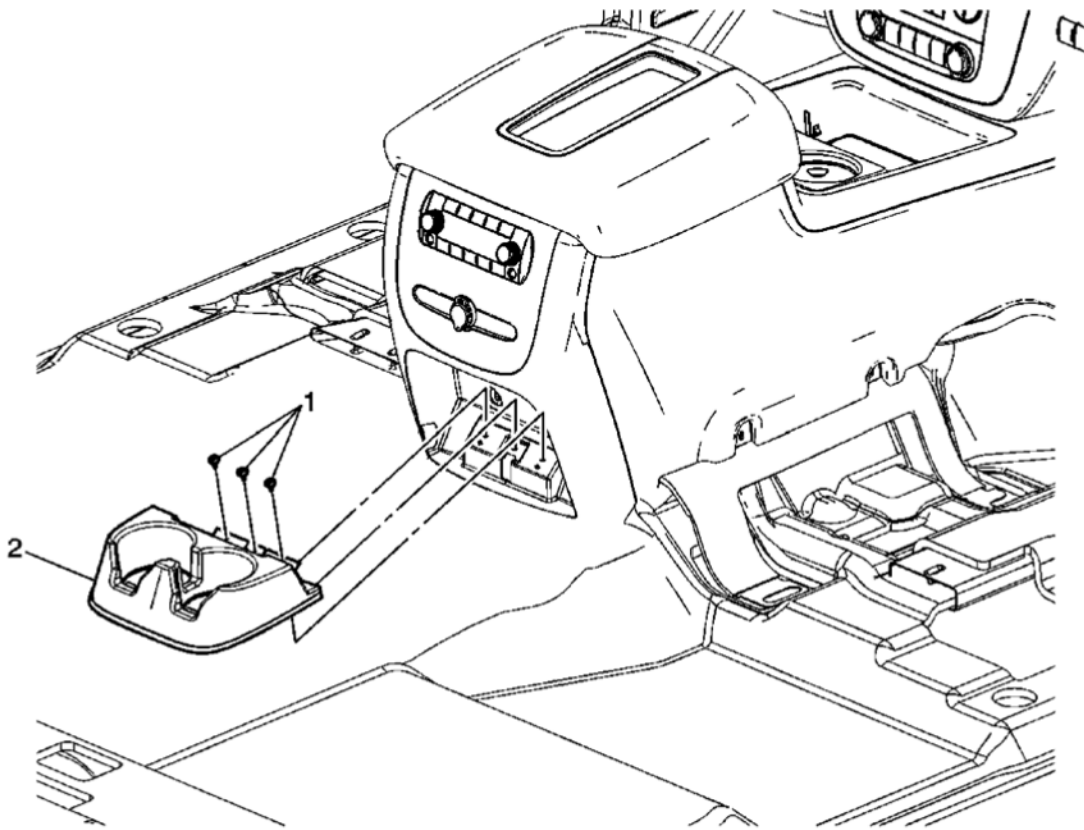


Fig. 39: View Of Front Floor Console Rear Cupholder Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Cup Holder Replacement - Front Floor Console - Rear (Except Cadillac)

Callout	Component Name
1	Front Floor Console Rear Cupholder Assembly Screws (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Rear Cupholder Assembly

BODY LOCK PILLAR GARNISH MOLDING REPLACEMENT (AVALANCHE/ESCALADE EXT)

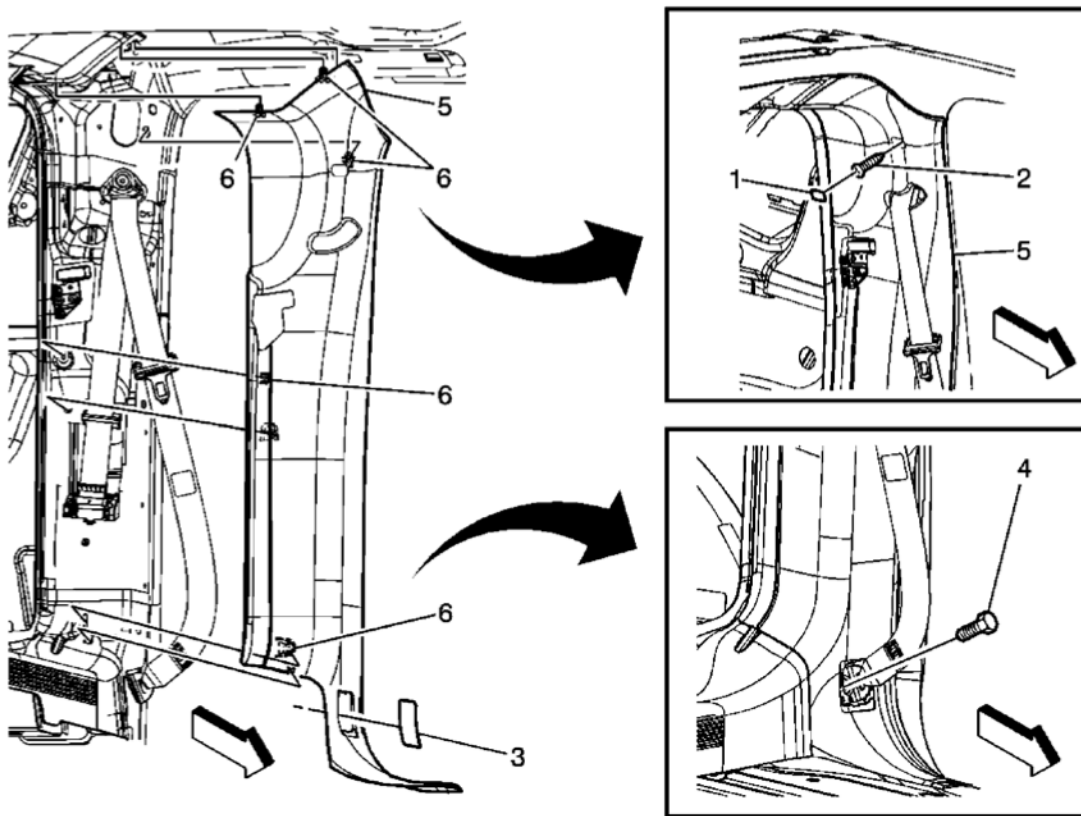


Fig. 40: View Of Body Lock Pillar Garnish Molding Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Body Lock Pillar Garnish Molding Replacement (Avalanche/Escalade EXT)

Callout	Component Name
Preliminary Procedures	
1. Disable roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> . 2. Remove rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u>.	
1	Body Lock Pillar Garnish Molding Plug
2	Body Lock Pillar Garnish Molding Screw
	NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
3	Removable Midgate Hinge Finish Cover
4	Rear Belt Assembly Anchor Bolt

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

	Tighten: 70 N.m (52 lb ft)
	Body Lock Pillar Garnish Molding Assembly
	Tighten: 43 N.m (32 lb ft)
5	Tip: 1. Remove seat belt D-ring from the adjuster assembly. 2. Route seat belt through garnish molding.
6	Body Lock Pillar Garnish Molding Retainers (Qty: 5)

BODY LOCK PILLAR GARNISH MOLDING REPLACEMENT (SUBURBAN/YUKON XL/ESCALADE ESV)

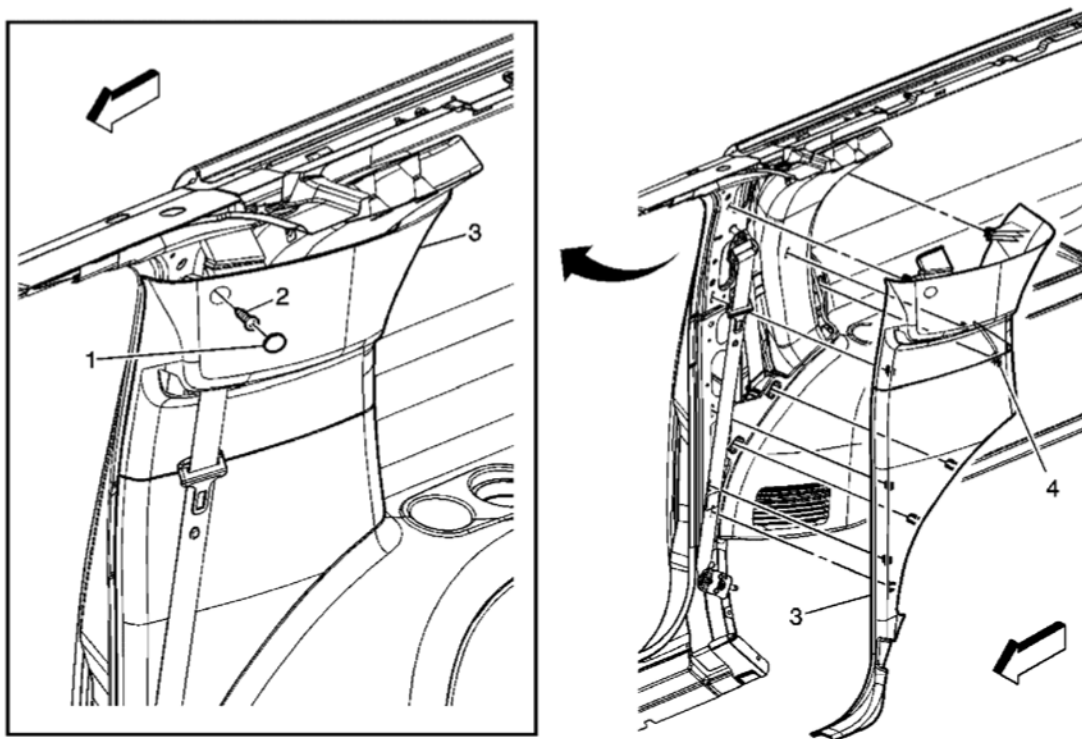


Fig. 41: View Of Body Lock Pillar Garnish Molding Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Body Lock Pillar Garnish Molding Replacement (Suburban/Yukon XL/Escalade ESV)

Callout	Component Name
Preliminary Procedures	
1.	Disable roof rail SIR system. Refer to SIR Disabling and Enabling .

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

2. Remove rear side door sill plate. Refer to **Rear Side Door Sill Plate Replacement (Extended Wheelbase)** or **Rear Side Door Sill Plate Replacement (Standard Wheelbase)**.

1	Body Lock Pillar Garnish Molding Plug
2	Body Lock Pillar Garnish Molding Screw NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
3	Body Lock Pillar Garnish Molding Assembly Tighten: 35 N.m (25 lb ft) Tip: 1. Remove seat belt D-ring from the adjuster assembly. 2. Route seat belt through garnish molding.
4	Body Lock Pillar Garnish Molding Clip (Qty: 10)

BODY LOCK PILLAR GARNISH MOLDING REPLACEMENT (TAHOE/YUKON/ESCALADE)

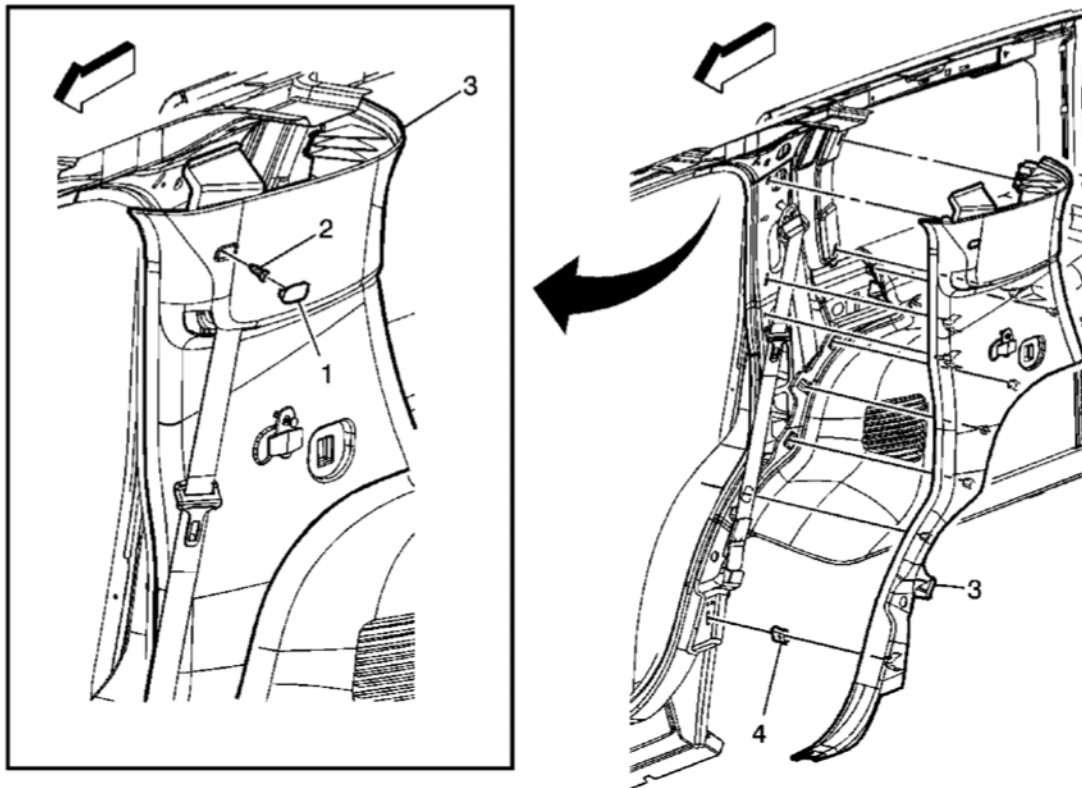


Fig. 42: View Of Body Lock Pillar Garnish Molding Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Body Lock Pillar Garnish Molding Replacement (Tahoe/Yukon/Escalade)

Callout	Component Name
Preliminary Procedures	
1. Disable the roof rail SIR system. Refer to <u>SIR Disabling and Enabling</u> . 2. Remove the rear side door sill plate. Refer to <u>Rear Side Door Sill Plate Replacement (Extended Wheelbase)</u> or <u>Rear Side Door Sill Plate Replacement (Standard Wheelbase)</u>. 3. Fold the rear seat up and forward. 4. Reposition the rear side door weatherstrip off the molding.	
1	Body Lock Pillar Garnish Molding Plug
2	Body Lock Pillar Garnish Molding Screw
	NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
	Body Lock Pillar Garnish Molding Assembly

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

3	Tighten: 35 N.m (25 lb ft) Tip: 1. If equipped with rear folding seat, disconnect the electrical connectors. 2. Remove seat belt D-ring from the adjuster assembly. 3. Route seat belt through garnish molding.
4	Body Lock Pillar Garnish Molding Clip (Qty: 10)

PRESSURE RELIEF VALVE REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Interior Trim and Paneling - Avalanche, Escalade, Suburban, Tahoe & Yukon

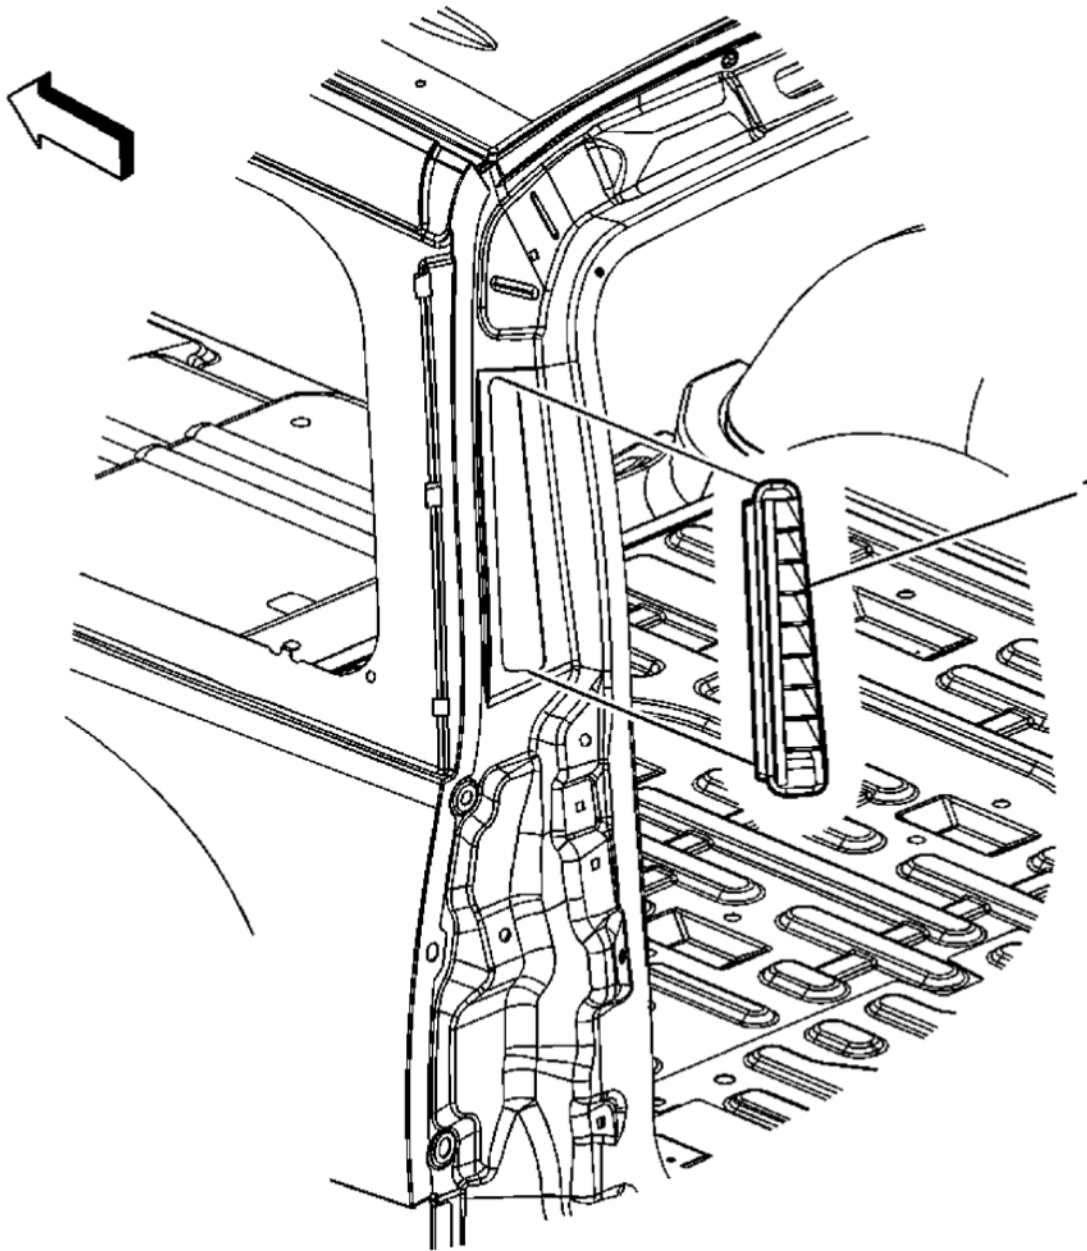


Fig. 43: View Of Pressure Relief Valve Assembly
Courtesy of GENERAL MOTORS CORP.

Pressure Relief Valve Replacement

Callout	Component Name
Preliminary Procedure: Remove the quarter panel upper applique. Refer to <u>Quarter Panel Upper Applique Replacement (Escalade)</u> .	
1	Pressure Relief Valve Assembly