

2004 ENGINE COOLING

Specifications & Drive Belt Routing - TSX

COOLING SYSTEM BLEEDING

Cooling system bleeding procedure for TSX is not available from manufacturer.

DRIVE BELT ROUTING


Information not available from manufacturer.

DRIVE BELT ADJUSTMENTS

A/C COMPRESSOR, ALTERNATOR BELT & POWER STEERING BELT

Drive belt adjustment is not required as TSX is equipped with an automatic drive belt tensioner.

1. Inspect the belt for cracks and damage. If the belt is cracked or damaged, replace it.
2. Check that the auto-tensioner indicator (A) is within the standard range (B). See **Fig. 1** . If it is out of the standard range, replace the drive belt.

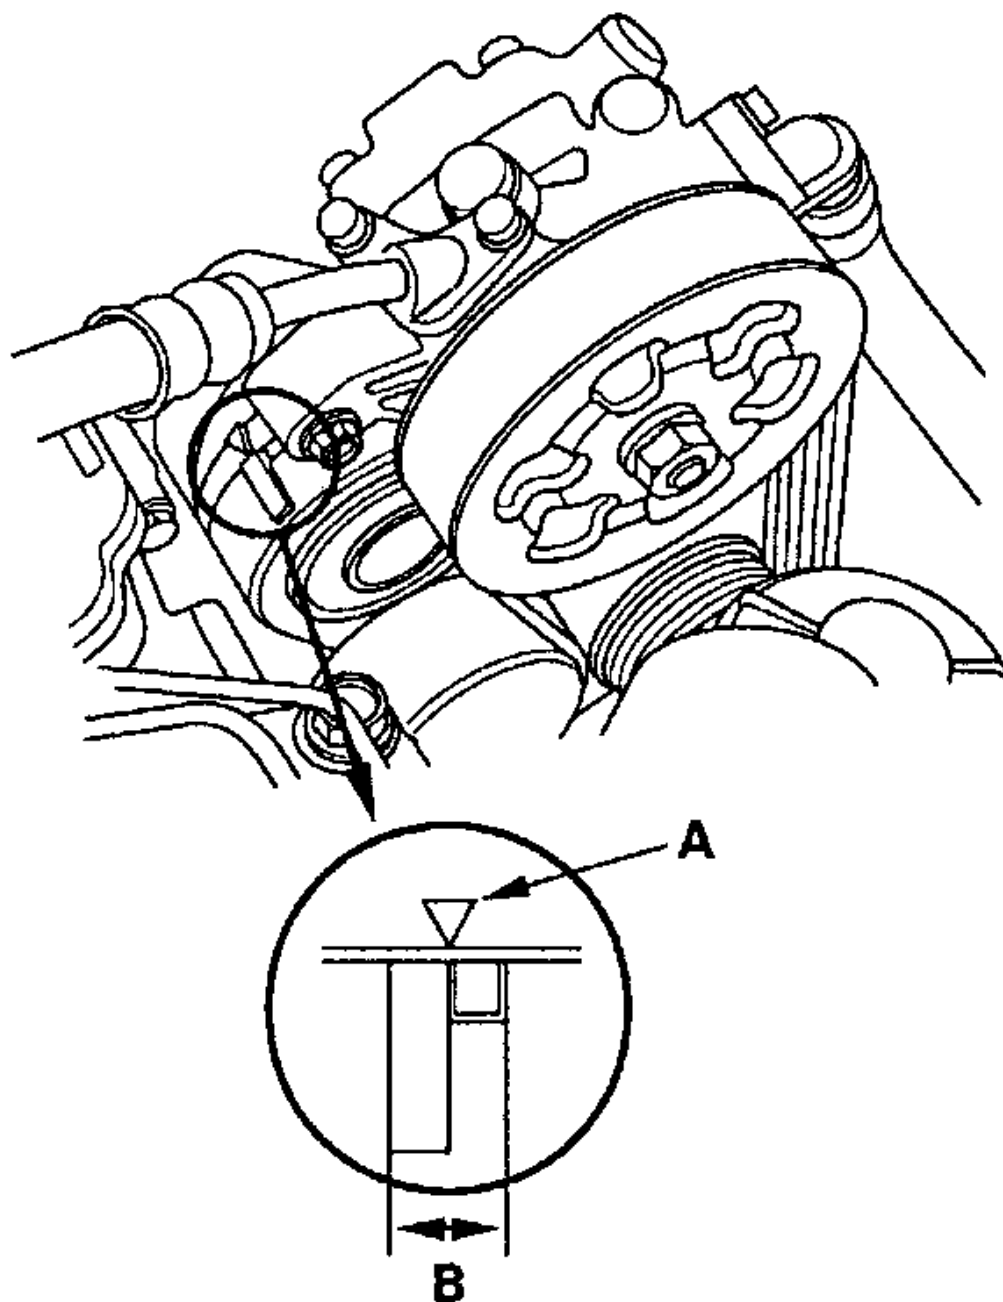

G00302627

Fig. 1: Identifying A/C Compressor/Alternator Belt Tensioner
Courtesy of AMERICAN HONDA MOTOR CO., INC.

SPECIFICATIONS

COOLING SYSTEM

COOLING SYSTEM SPECIFICATIONS

Model	Specification
Coolant Replacement Interval	120,000 Miles ⁽¹⁾
Coolant Capacity	
A/T	5.6 Qts. 5.3 L)
M/T	5.7 Qts. (5.4 L)
Pressure Cap Opens	14-18 psi (93-123 kPa)
Thermostat Opens	
Starts	169-176° F (76-80° C)
Fully Open	194° F (90° C)
(1) Replace after 10 years.	