

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:



Air Inlet Grille Panel Extension Replacement

Callout

Component Name

Air Inlet Grille Panel Extension


1

Procedure

Grasp the grille panel extension and disengage the retainers from the rear edge of the fender and edge of the air inlet panel.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

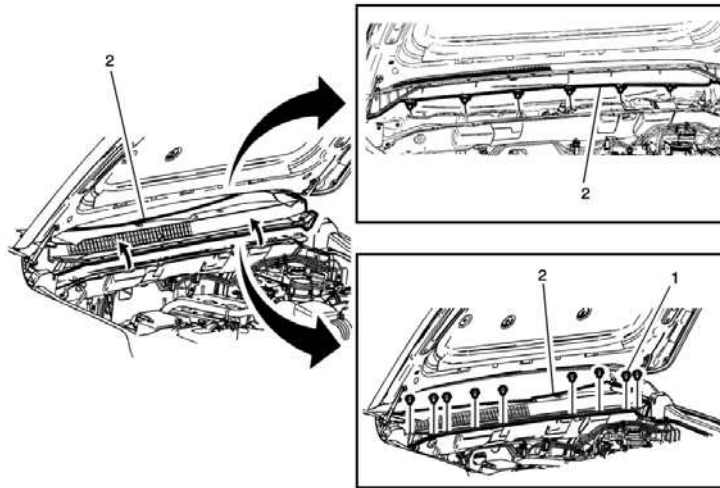

Air Inlet Grille Panel Replacement

Callout

Component Name

Preliminary Procedure

1. Remove the wiper arms. Refer to Windshield Wiper Arm Replacement.
2. Remove the hood rear seal. Refer to Hood Rear Seal Replacement.

1 Air Inlet Grille Panel front Push-In Retainer (Qty: 12)


Air Inlet Grille Panel

Procedure

- 2
 1. Disconnect the windshield washer hose.
 2. Lift up the front edge of the air inlet grille panel.
 3. Use a suitable plastic tool to release the air inlet grille panel retainers.
 4. Transfer parts as needed.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

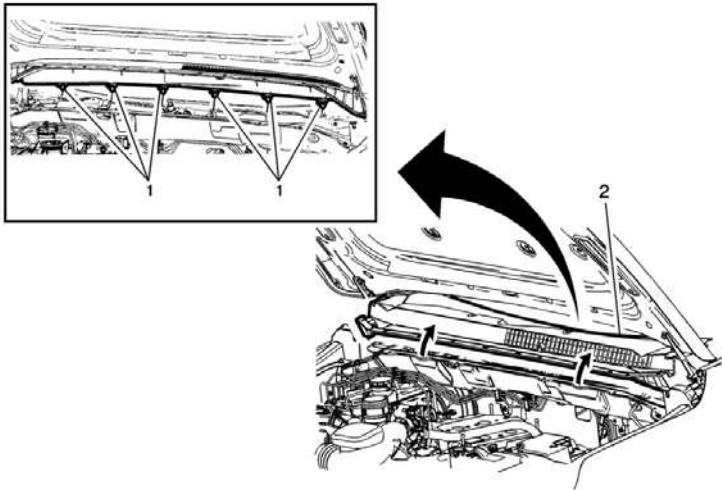

Air Inlet Grille Panel Replacement

Callout	Component Name
Preliminary Procedure	

1. Remove the wiper arms. Refer to Windshield Wiper Arm Replacement.
2. Remove the air inlet grille panel extension. Refer to Air Inlet Grille Panel Extension Replacement.
3. Remove the hood rear seal. Refer to Hood Rear Seal Replacement.

Air Inlet Grille Panel front Push-In Retainer (Qty: 6)

1

Procedure

Use a suitable plastic tool to release the air inlet grille panel retainers.

Air Inlet Grille Panel


Procedure

2

1. Disconnect the windshield washer hose.
2. Lift up the front edge of the air inlet grille panel.
3. Transfer parts as needed.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

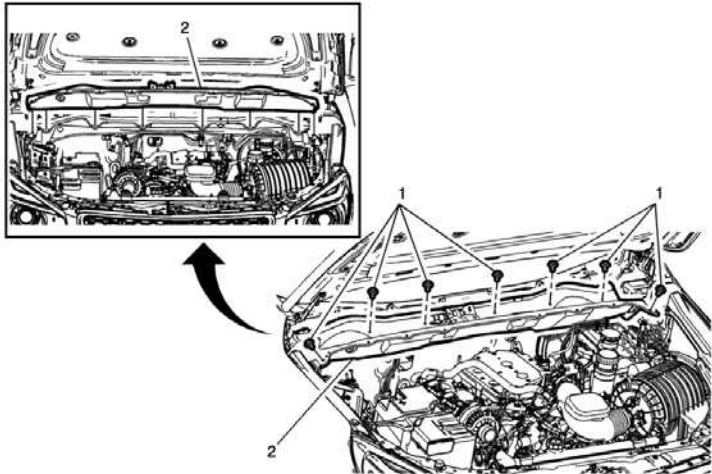

Cowl Front Panel Replacement

Callout	Component Name
Preliminary Procedures	

1. Remove the windshield wiper transmission. Refer to Windshield Wiper Transmission Replacement.
2. Remove the hood rear corner seals. Refer to Hood Rear Corner Seal Replacement.

Cowl Front Panel Bolt (Qty: 7)

Caution: Refer to Fastener Caution.

Procedure

1

Disconnect the windshield washer hose from the cowl front panel.

Tighten

9 Y (80 lb in)

Cowl Front Panel


2

Procedure

Ensure all seals are in place before installation of the cowl front panel.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

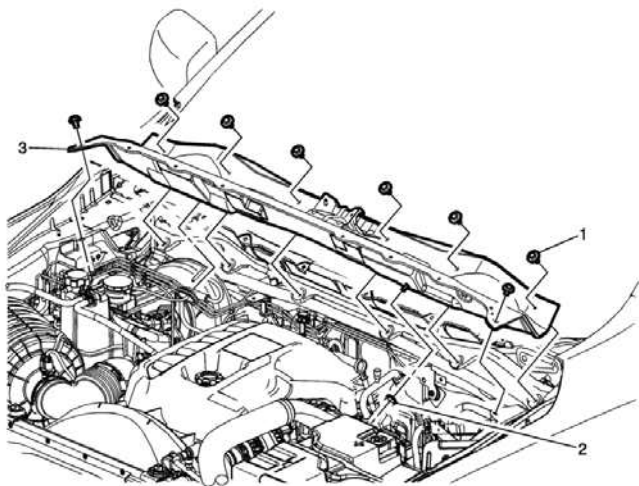

Cowl Front Panel Replacement

Callout	Component Name
Preliminary Procedures	
1.	Remove the windshield wiper transmission. Refer to Windshield Wiper Transmission Replacement.
2.	Remove the hood rear corner seals. Refer to Hood Rear Corner Seal Replacement.
	Cowl Front Panel Bolt (Qty: 8)
1	Caution: Refer to Fastener Caution.
	Tighten
	9 Y (80 lb in)
	Air Conditioning Compressor Hose Clip Nut
2	Procedure
	Remove the air conditioning compressor hose clip nut from the cowl front panel stud. Refer to Fastener Tightening Specifications.
	Cowl Front Panel
	Procedure
3	
	1. Disconnect the windshield washer hose from the cowl front panel.
	2. Disconnect the engine wiring harness grommet from the cowl front panel.
	3. Ensure all seals are in place before installation of the cowl front panel.

2013 Chevrolet Colorado


Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

Fastener Tightening Specifications

Application	Specification	
	Metric	English
Front Bumper Fascia Bolt	3 Y	26 lb in
Front Bumper Fascia Brace Bolt– Lower	5 Y	44 lb in
Front Bumper Fascia Brace Bolt– Top	10 Y	89 lb in
Front Bumper Fascia Lower Bolt	25 Y	18 lb ft
Front Bumper Fascia Top Screw	3.5 Y	30 lb in
Front Bumper Lower Fascia Trim Insert Bolt	9 Y	80 lb in
Front Bumper Lower Fascia Trim Insert Screw	3 Y	27 lb in
Front Bumper Lower Impact Bar Bolt	58 Y	43 lb ft
Front Bumper Upper Impact Bar Nuts	9 Y	80 lb in
Radiator Grille Support Reinforcement Bolt	5 Y	44 lb in
Radiator Grille Support Reinforcement Screw	5 Y	44 lb in
Rear Bumper Center Step Pad Bolt	2.5 Y	22 lb in
Rear Bumper Fascia Reinforcement Bolt	9 Y	80 lb in
Rear Bumper Impact Bar Bracket Bolt	9 Y	80 lb in
Rear Bumper Impact Bar Bracket Side Bolt	58 Y	43 lb ft
Rear Bumper Impact Bar Lower Bolt	58 Y	43 lb ft
Rear Bumper Impact Bar Upper Bolt	58 Y	43 lb ft

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

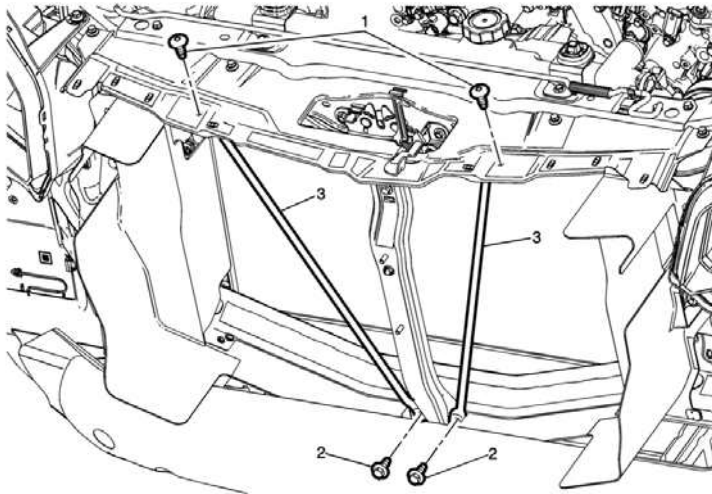

Front Bumper Fascia Brace Replacement

Callout

Component Name

Preliminary Procedure

Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.

Front Bumper Fascia Brace Bolt (Qty: 2)

1

Caution: Refer to Fastener Caution.

Tighten

5 Y (44 lb in)

Front Bumper Fascia Brace Bolt (Qty: 2)

2

Tighten

10 Y (89 lb in)


3

Fender Bumper Fascia Brace

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

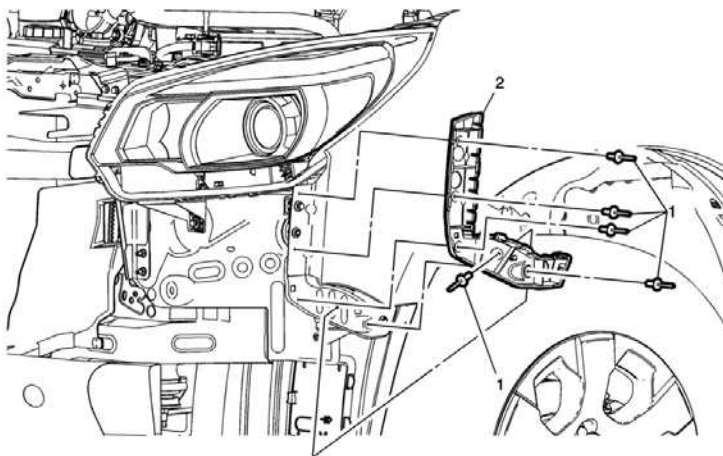

Front Bumper Fascia Guide Replacement

Callout

Component Name

Warning: Refer to Eye Protection Warning.


Preliminary Procedure

Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.

- | | |
|---|--|
| 1 | Front Bumper Fascia Guide Rivet (Qty: 5) |
| 2 | Front Bumper Fascia Guide |

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

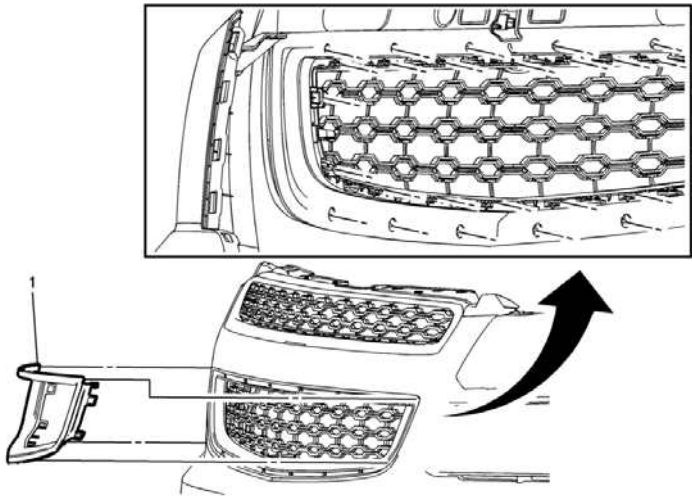

Front Bumper Fascia Lower Molding Replacement

Callout
Preliminary Procedures

Component Name

1. Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.
2. Remove the radiator grille emblem/nameplate. Refer to Radiator Grille Emblem/Nameplate Replacement.

Front Bumper Fascia Lower Molding

1


Procedure

Using a suitable plastic flat-bladed tool, release the retainer tabs from the front bumper fascia lower molding while slowly pullir fascia lower molding from the front fascia and grille.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

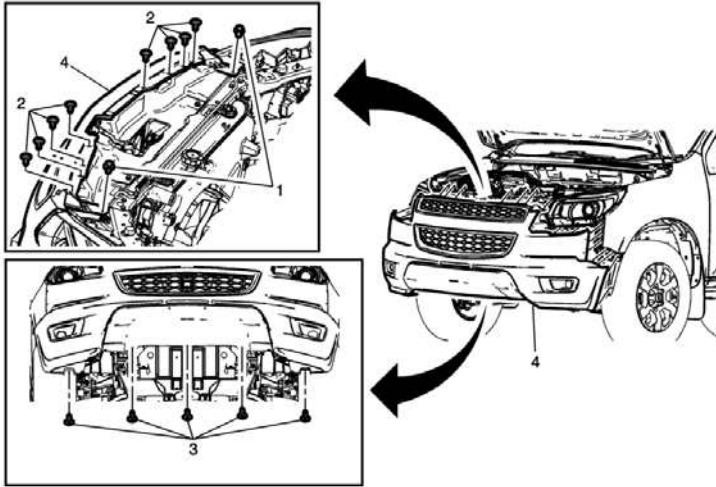

Front Bumper Fascia Replacement

Callout

Component Name

Preliminary Procedure

Remove the front wheelhouse front liner to front fascia screws. Refer to Front Wheelhouse Liner Replacement.

Front Bumper Fascia Bolt (Qty: 2)

1

Caution: Refer to Fastener Caution.

Tighten

3 Y (26 lb in)

Front Bumper Fascia Top Screw (Qty: 8)

2

Tighten

3.5 Y (31 lb in)

Front Bumper Fascia Lower Bolt (Qty: 5)

3

Note: Replace the 5 lower bolts with factory replacement parts.

Tighten

25 Y (18 lb ft)

Front Bumper Fascia

Procedure


4

1. With the aid of an assistant, gently push the fascia to the right when releasing the fascia snaps/clips, this will avoid damaging the snaps/clips on the fascia. Perform this same procedure on the left hand side of the fascia.
2. Carefully push a small nylon wedge between the fascia and the front fascia guide. Insert a small flat-bladed tool into fascia slot and depress the snaps one at a time and pull on the fascia at the same time to gradually remove the fascia from the front fascia guide.
3. Disconnect any electrical connectors.
4. Transfer components as necessary.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

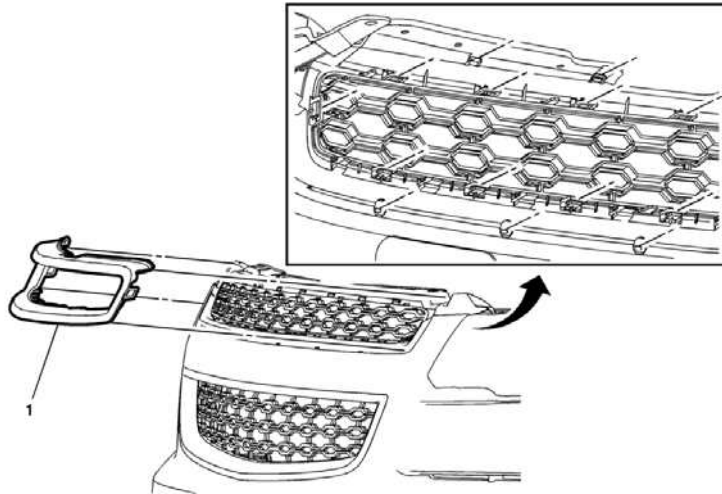

Front Bumper Fascia Upper Molding Replacement

Callout

Component Name

Preliminary Procedures

1. Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.
2. Remove the radiator grille emblem/nameplate. Refer to Radiator Grille Emblem/Nameplate Replacement.

Radiator Upper Grille

1


Procedure

Release the retainer tabs while pulling the upper grille from the front fascia.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

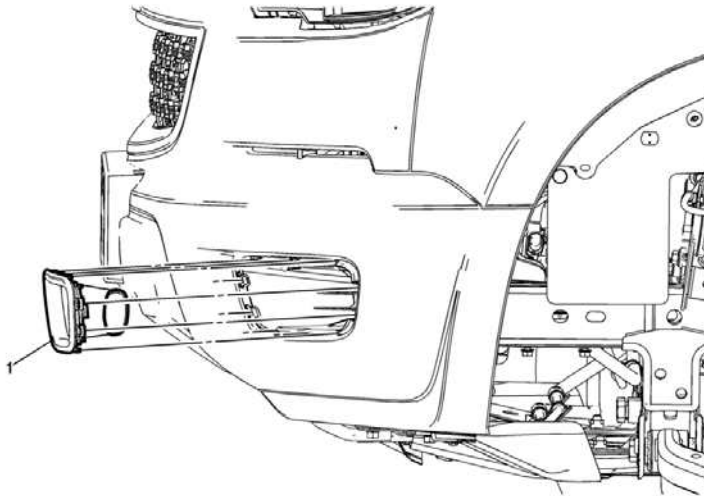

Front Bumper Lower Fascia Side Grille Replacement

Callout

Radiator Grille Lower Side Grille

Component Name

Procedure


1

1. Remove the front wheelhouse liner access cover.
2. Release the tabs securing the radiator grille lower side grille to the front bumper fascia.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

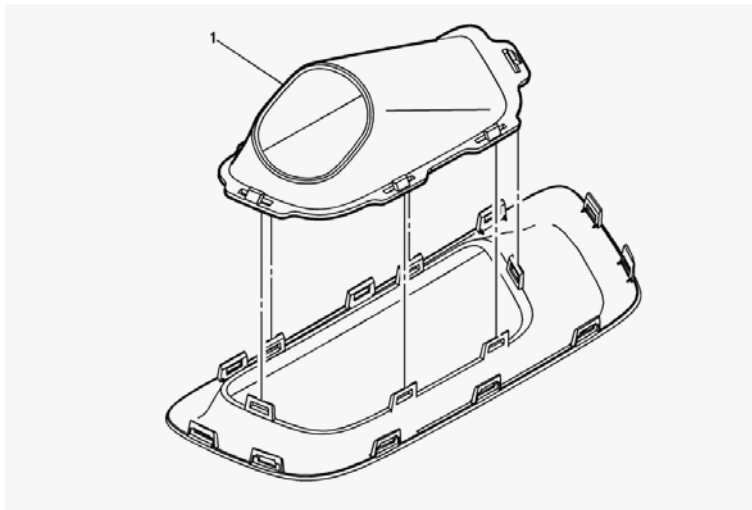

Front Bumper Lower Fascia Side Grille Replacement

Callout

Component Name

Preliminary Procedure

Remove the front bumper lower fascia side grille (outer). Refer to Front Bumper Lower Fascia Side Grille Replacement.

Front Bumper Lower Fascia Side Grille


1

Procedure

Release the locking tabs from the front bumper lower fascia side grille to the front bumper fascia outer insert molding.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

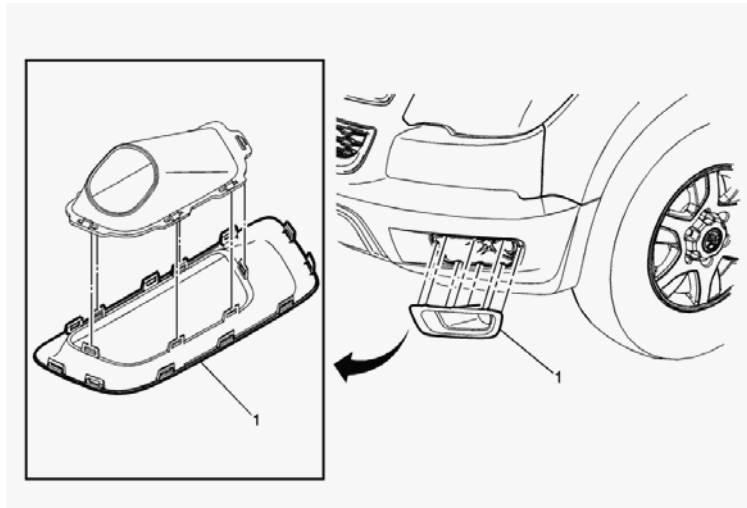

Front Bumper Lower Fascia Side Grille Replacement

Callout

Component Name

Preliminary Procedure

Remove the front wheelhouse liner hole cover.

Front Bumper Fascia Outer Insert Molding


Procedure

1

1. Release the locking tabs to the front bumper lower fascia side grille from the front bumper fascia.
2. Release the locking tabs to the front bumper fascia outer insert molding and separate from the front bumper lower fascia side grille.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

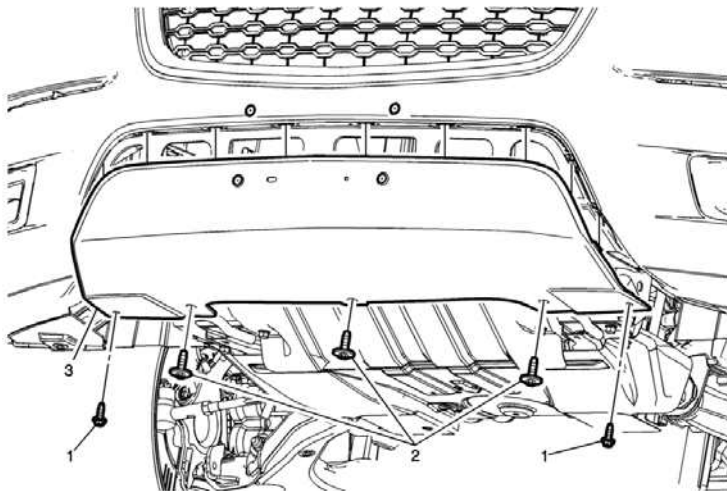

Front Bumper Lower Fascia Trim Insert Replacement

Callout

Component Name

Preliminary Procedure

Remove the license plate bracket, if equipped.

1 Front Bumper Lower Fascia Trim Insert Bolt (Qty: 3)

Caution: Refer to Fastener Caution.

Tighten

9 Y (80 lb in)

2 Front Bumper Lower Fascia Trim Insert Screw (Qty: 2)

Tighten

3 Y (27 lb in)


Front Bumper Lower Fascia Trim Insert

Procedure

3 Carefully push a small nylon wedge between the fascia and the fascia trim insert. Insert a small flat-bladed tool into the fascia and depress the snaps one at a time and pull on the fascia trim insert at the same time to gradually remove the fascia trim ins from the front fascia.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

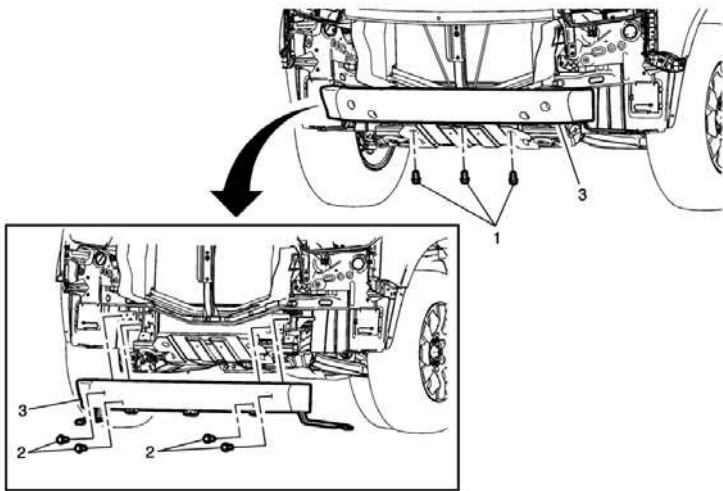


Front Bumper Lower Impact Bar Replacement

Callout	Component Name
Preliminary Procedure	
Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.	
Front Bumper Lower Impact Bar Bolt (Qty: 3)	
1	Caution: Refer to Fastener Caution.
	Tighten
	58 Y (43 lb ft)
Front Bumper Lower Impact Bar Bolt (Qty: 4)	
2	Caution: Refer to Fastener Caution.
	Tighten
	58 Y (43 lb ft)
3	Front Bumper Lower Impact Bar

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

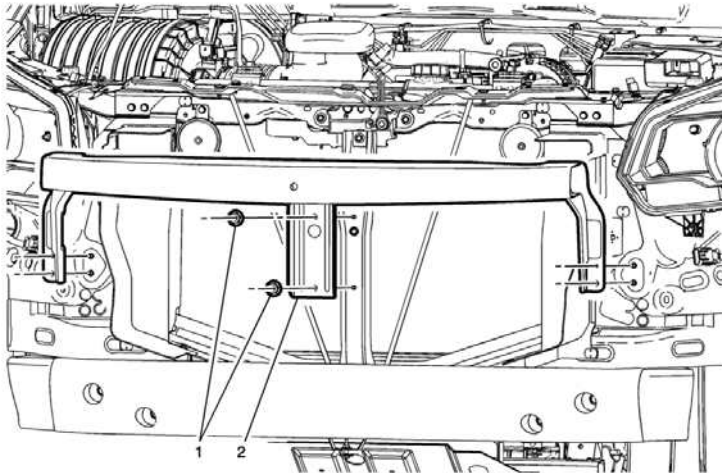


Front Bumper Upper Impact Bar Replacement

Callout	Component Name
Preliminary Procedures	
1.	Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.
2.	Remove the inflatable restraint front end sensors. Refer to Airbag Front End Sensor Replacement.
	Front Bumper Upper Impact Bar Nut (Qty: 2)
1	Caution: Refer to Fastener Caution.
	Tighten
	9 Y (80 lb in)
2	Front Bumper Upper Impact Bar

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

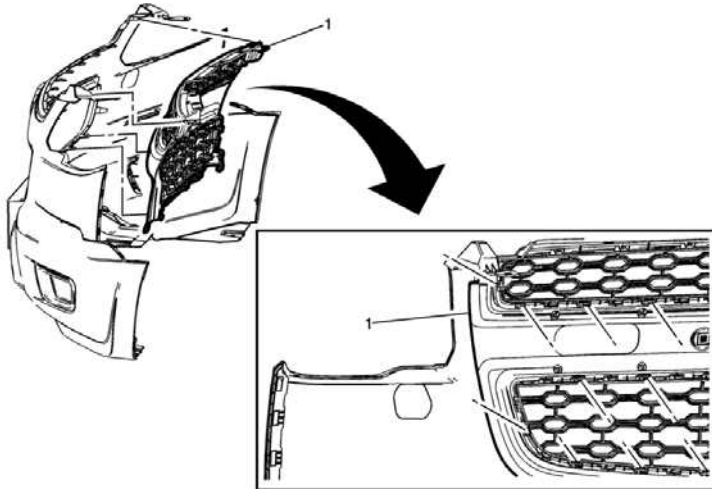

Front Grille Replacement

Callout

Component Name

Preliminary Procedures

1. Remove the front bumper fascia upper molding. Refer to Front Bumper Fascia Upper Molding Replacement.
2. Remove the front bumper fascia lower molding. Refer to Front Bumper Fascia Lower Molding Replacement.

Radiator Grille

1


Procedure

Release the retainer tabs while pulling the upper grille from the front fascia.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

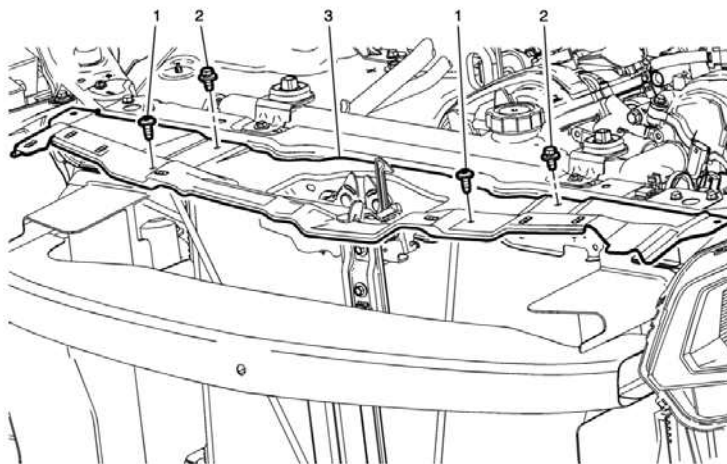

Front Grille Support Reinforcement Replacement

Callout

Component Name

Preliminary Procedure

Remove the front bumper fascia. Refer to Front Bumper Fascia Replacement.

Radiator Grille Support Reinforcement Bolt (Qty: 2)

Caution: Refer to Fastener Caution.

1

Tighten

5 Y (44 lb in)

Radiator Grille Support Reinforcement Screw (Qty: 2)

2

Tighten

5 Y (44 lb in)


3

Radiator Grille Support Reinforcement

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

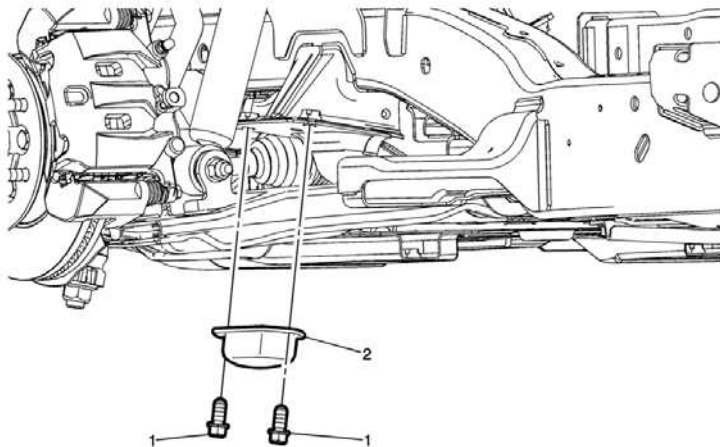

Front Shock Absorber Lower Bumper Replacement

Callout

Component Name

Preliminary Procedure

Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle

Front Shock Absorber Lower Bumper Bolt (Qty: 2)

Caution: Refer to Fastener Caution.

1

Tighten


42 Y (31 lb ft)

2

Front Shock Absorber Lower Bumper

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

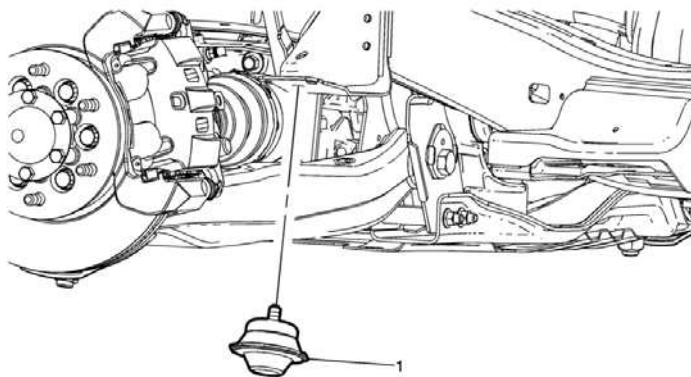

Front Shock Absorber Lower Bumper Replacement

Callout

Component Name

Preliminary Procedure

1. Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle.
2. Remove the tire and wheel assembly. Refer to Tire and Wheel Removal and Installation.

Front Lower Control Arm Bumper

Caution: Refer to Fastener Caution.

Procedure

1. Using the *CH 50888* socket
, remove the bumper
2. Using the *CH 50888* socket and a torque wrench, tighten to
Tighten
106 Y (78 lb ft)

Special Tools


CH 50888 Socket

For regional equivalent tools, refer to Special Tools.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

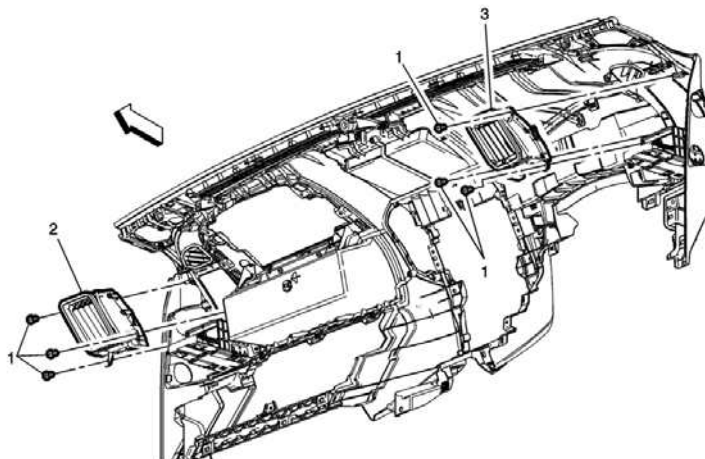

Front Side Door Air Outlet Grille Replacement

Callout

Component Name


Preliminary Procedure

Remove the instrument panel outer air outlet duct. Refer to Instrument Panel Outer Air Outlet Duct Replacement.

- | | |
|---|---|
| 1 | Instrument Carrier Bolt (Qty: 6) |
| | Caution: Refer to Fastener Caution. |
| 2 | Front Side Door Air Outlet Grille- Passenger Side |
| 3 | Front Side Door Air Outlet Grille- Driver Side |

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

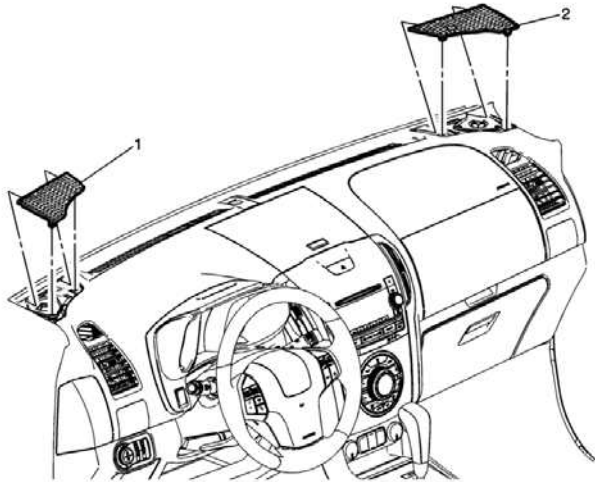

Instrument Panel Accessory Trim Plate Grille Replacement

Callout

Component Name

Instrument Panel Accessory Trim Plate Grille - Left Side

1

Procedure

Use a flat bladed plastic trim tool in order to release the retainer clips securing the grille to the instrument panel assembly.

Instrument Panel Accessory Trim Plate Grille - Right Side


Procedures

2

1. Use a flat bladed plastic trim tool in order to release the retainer clips securing the grille to the instrument panel assembly.
2. If equipped with a theft deterrent alarm indicator, disconnect electrical connection.
3. Transfer all necessary components.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

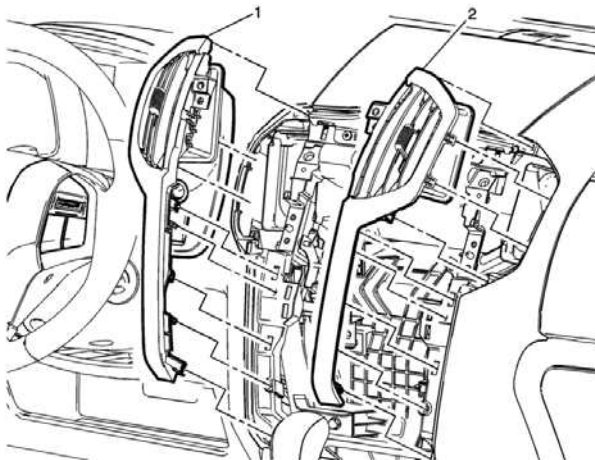

Instrument Panel Center Air Outlet Grille Replacement

Callout

Component Name

Preliminary Procedures

1. Remove the instrument panel center trim plate, if equipped with (UGP) radio. Refer to Instrument Panel Center Trim Plate Replacement.
2. Remove the radio, if equipped with (UGQ) radio. Refer to Radio Replacement.

Instrument Panel Center Air Outlet Grille– Left Hand

1

Procedure

Use a flat bladed plastic trim tool in order to release the retainers securing the instrument panel center air outlet grille to the instrument panel assembly.

Instrument Panel Center Air Outlet Grille– Right Hand

2


Procedure

Use a flat bladed plastic trim tool in order to release the retainers securing the instrument panel center air outlet grille to the instrument panel assembly.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

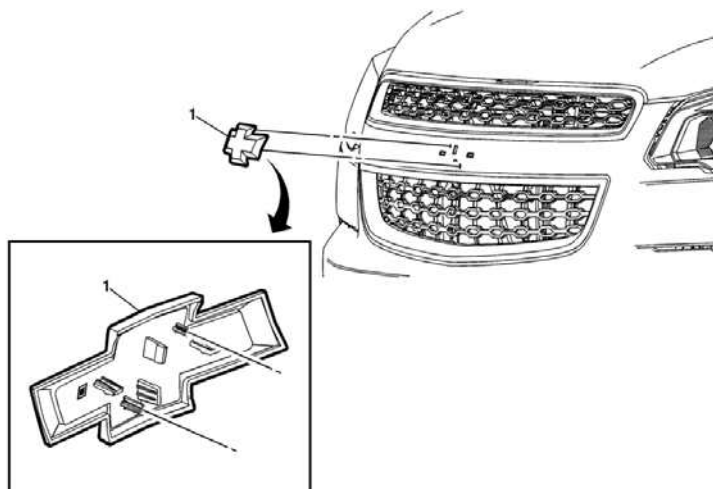

Radiator Grille Emblem/Nameplate Replacement

Callout

Radiator Grille Emblem Nameplate


Warning: Refer to Eye Protection Warning.

Procedure

1. Apply two layers of masking tape at each end of the front fascia emblem.
2. Using a small flat-bladed tool, release the three locking retainers on the front fascia emblem.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

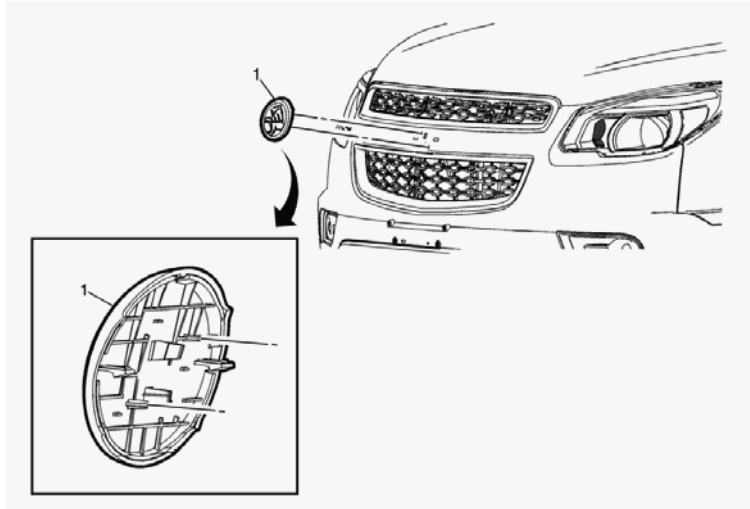

Radiator Grille Emblem/Nameplate Replacement

Callout

Radiator Grille Emblem Nameplate

Warning: Refer to Eye Protection Warning.


Procedure

1

1. Apply two layers of masking tape at each end of the front fascia emblem.
2. Using a small flat-bladed tool, release the three locking retainers on the front fascia emblem.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

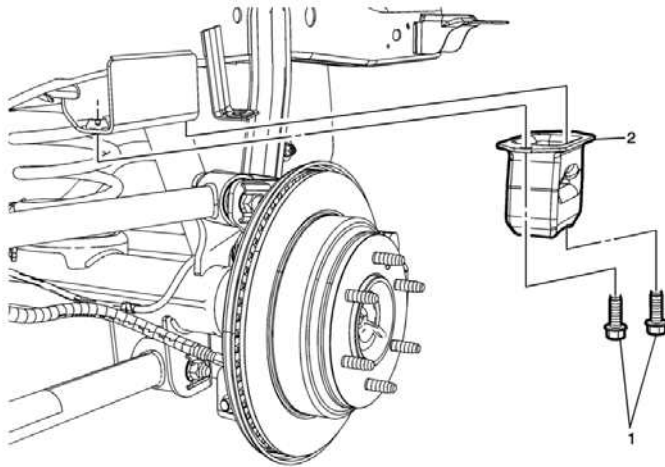


Rear Axle Bumper Replacement

Callout	Component Name
Preliminary Procedure	
1. Raise and support the vehicle. Refer to Lifting and Jacking the Vehicle.	
2. Remove the tire and wheel assembly. Refer to Tire and Wheel Removal and Installation.	
Rear Axle Bumper Bolt (Qty:2)	
1	Caution: Refer to Fastener Caution.
	Tighten
	56 Y (41 lb ft)
2	Rear Axle Bumper

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

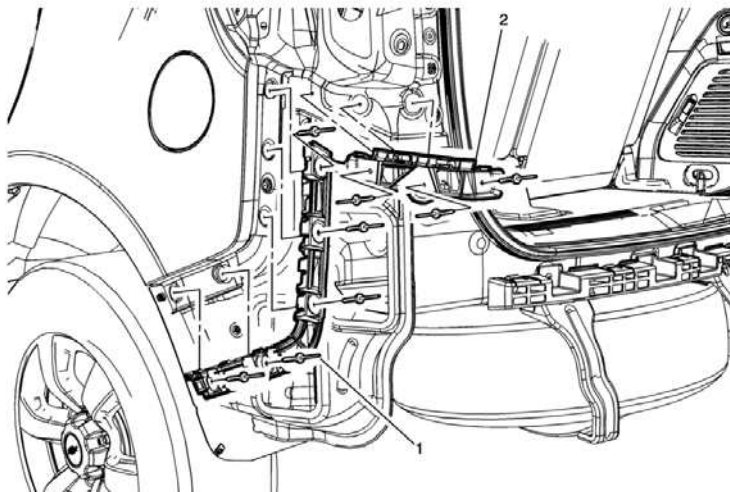

Rear Bumper Fascia Guide Replacement - Left Side

Callout

Component Name

Warning: Refer to Eye Protection Warning.

Preliminary Procedure


Remove the rear bumper fascia. Refer to Rear Bumper Fascia Replacement.

- | | |
|---|---|
| 1 | Rear Bumper Fascia Outer Guide Rivet (Qty: 8) |
| 2 | Rear Bumper Fascia Outer Guide |

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

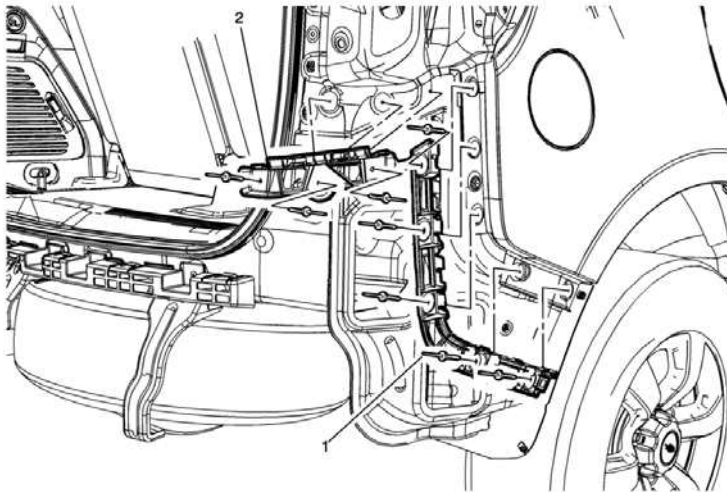

Rear Bumper Fascia Guide Replacement - Right Side

Callout

Component Name

Warning: Refer to Eye Protection Warning.

Preliminary Procedure


Remove the rear bumper fascia. Refer to Rear Bumper Fascia Replacement.

- 1 Rear Bumper Fascia Outer Guide Rivet (Qty: 8)
- 2 Rear Bumper Fascia Outer Guide

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

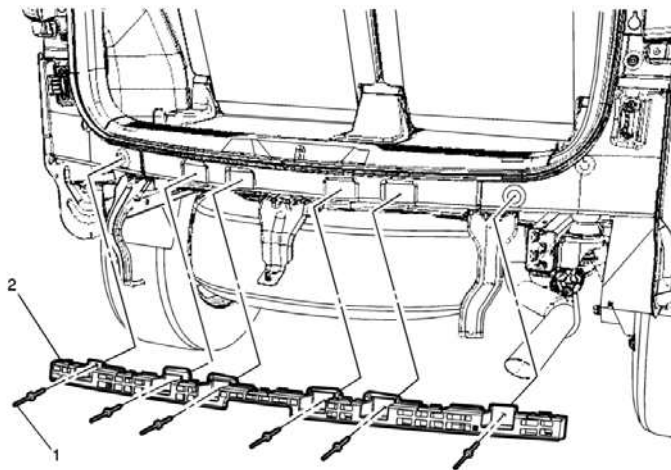

Rear Bumper Fascia Guide Replacement

Callout

Component Name

Warning: Refer to Eye Protection Warning.

Preliminary Procedure


Remove the rear bumper fascia. Refer to Rear Bumper Fascia Replacement.

- | | |
|---|---|
| 1 | Rear Bumper Fascia Guide Rivet (Qty: 6) |
| 2 | Rear Bumper Fascia Guide |

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

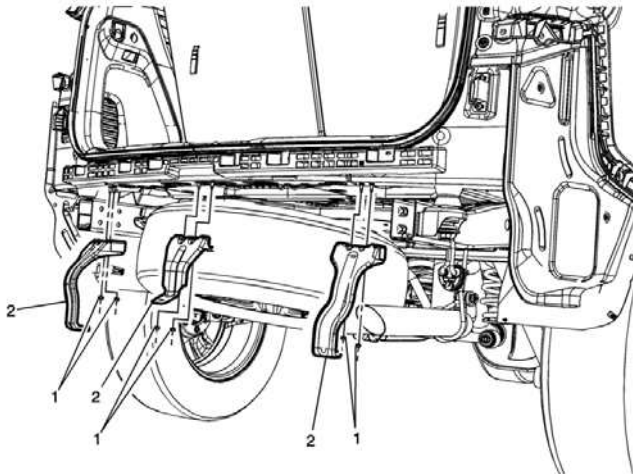

Rear Bumper Fascia Lower Reinforcement Replacement

Callout

Component Name

Preliminary Procedure

Remove the rear bumper fascia. Refer to Rear Bumper Fascia Replacement.

Rear Bumper Fascia Lower Reinforcement Nut (Qty: 6)

Caution: Refer to Fastener Caution.

1

Tighten

9 Y (80 lb in)

Rear Bumper Fascia Lower Reinforcement

2


Procedure

Transfer any lower reinforcement as needed.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

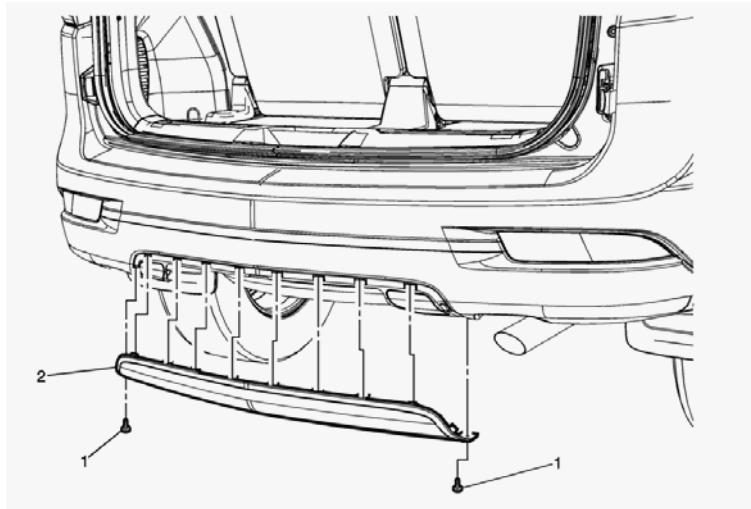

Rear Bumper Fascia Lower Skid Plate Replacement

Callout

Component Name

1

Rear Bumper Fascia Lower Skid Plate Screw (Qty: 2)

Caution: Refer to Fastener Caution.

Rear Bumper Fascia Lower Skid Plate


Procedure

2

Carefully push a small nylon wedge between the rear fascia and the lower fascia skid plate. Insert a small flat-bladed tool into fascia slot and depress the snaps one at a time and pull on the rear fascia at the same time to gradually remove the lower fascia skid plate from the rear fascia.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

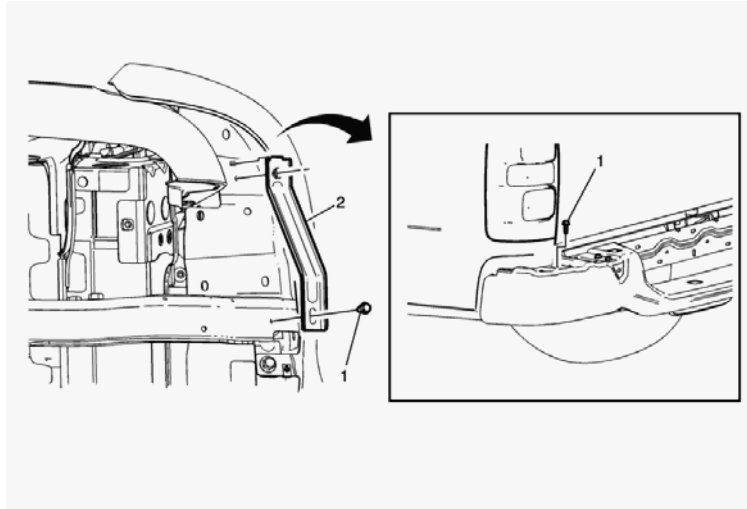

Rear Bumper Fascia Reinforcement Replacement

Callout

Component Name

Preliminary Procedure

Remove the rear bumper step outer par. Refer to Rear Bumper Step Outer Pad Replacement.

Rear Bumper Fascia Reinforcement Bolt (Qty: 2)

Caution: Refer to Fastener Caution.

1

Tighten


9 Y (80 lb in)

2

Rear Bumper Fascia Reinforcement

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

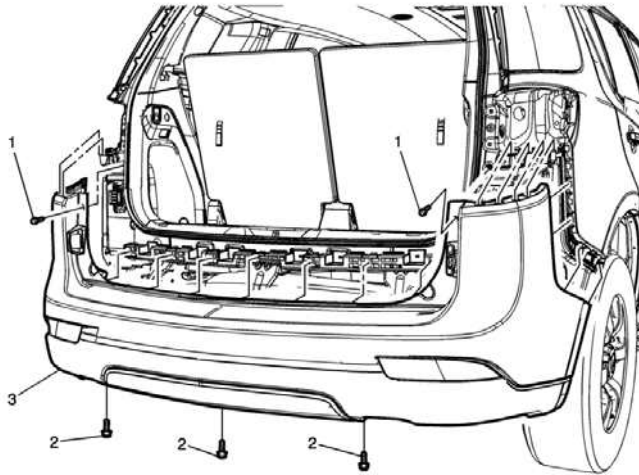

Rear Bumper Fascia Replacement

Callout

Component Name

Preliminary Procedure

Remove the rear mud rear guard. Refer to Rear Mud Rear Guard Replacement.

Rear Bumper Fascia Screw (Qty: 2)

1

Caution: Refer to Fastener Caution.

Tighten

10 Y (89 lb in)

2

Rear Bumper Fascia Lower Bolt (Qty: 3)

Rear Bumper Fascia


Procedure

3

1. Carefully push a small nylon wedge between the fascia and the rear fascia guide. Insert a small flat-bladed tool into the fascia slot and depress the snaps one at a time and pull on the fascia at the same time to gradually remove the fascia from the rear fascia guide.
2. Disconnect the electrical connectors.
3. Transfer parts as needed.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

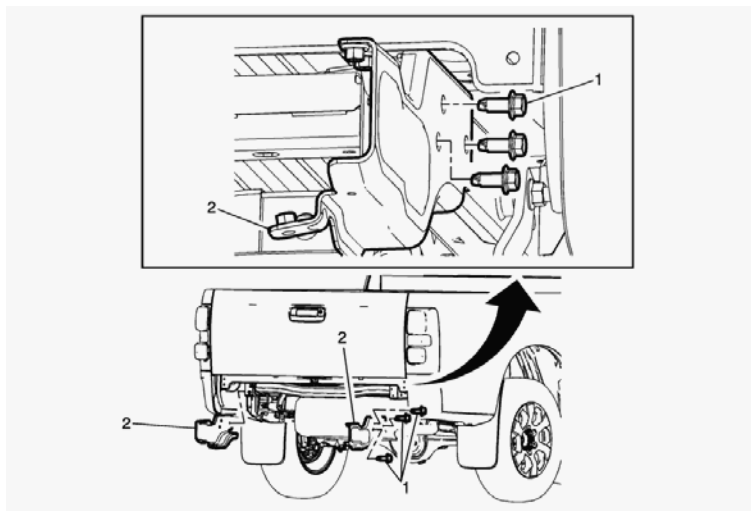

Rear Bumper Impact Bar Bracket Replacement

Callout

Component Name

Preliminary Procedure

Remove the rear bumper impact bar. Refer to Rear Bumper Impact Bar Replacement.

Rear Bumper Impact Bar Bracket Bolt (Qty: 3)

Caution: Refer to Fastener Caution.

1

Tighten


58 Y (43 lb ft)

2

Rear Bumper Impact Bar Bracket

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

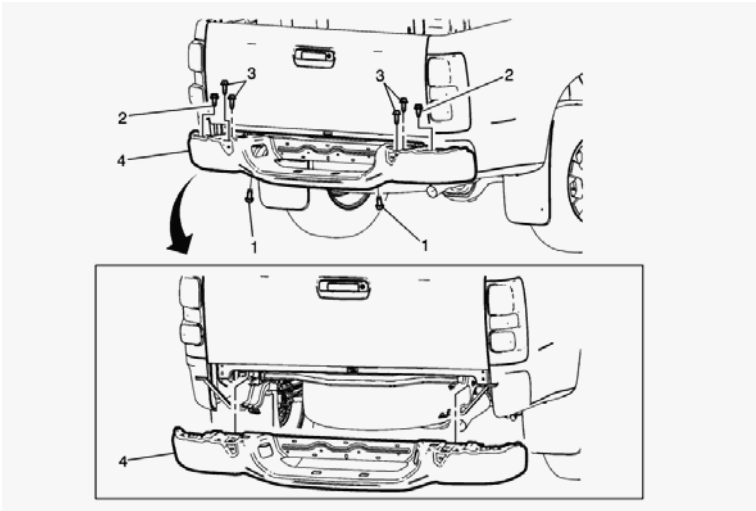


Rear Bumper Impact Bar Replacement

Callout	Component Name
Preliminary Procedures	
1. Remove the rear center bumper step pad. Refer to Rear Bumper Step Center Pad Replacement.	
2. Remove the rear bumper outer step pad. Refer to Rear Bumper Step Outer Pad Replacement.	
Rear Bumper Impact Bar Lower Bolt (Qty: 2)	
1	Caution: Refer to Fastener Caution. Tighten 58 Y (43 lb ft)
Rear Bumper Impact Bar Upper Bolt (Qty: 4)	
2	Tighten 58 Y (43 lb ft)
Rear Bumper Impact Bar Bracket Bolt (Qty: 2)	
3	Tighten 9 Y (80 lb in)
Rear Bumper Impact Bar	
4	Procedure Disconnect the electrical connector.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

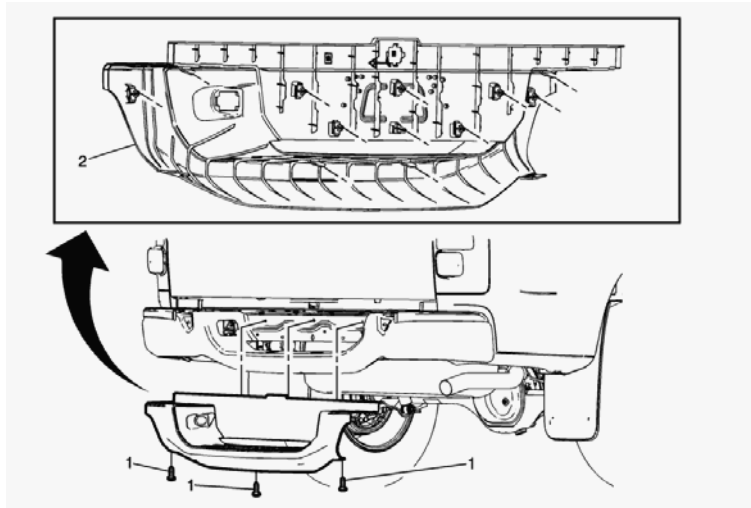

Rear Bumper Step Center Pad Replacement

Callout Preliminary Procedures

1. Ensure the endgate is fully closed.
2. Remove the rear license plate lamp. Refer to Rear License Plate Lamp Replacement.

Component Name

Rear Bumper Center Step Pad Bolt

- 1 **Caution:** Refer to Fastener Caution.

Tighten

2.5 Y (22 lb in)

Rear Bumper Center Step Pad


Procedure

- 2
1. Carefully push a thin nylon wedge between the lower rear edge of the step pad while pulling on the lower edge of the step pad releasing the retainers, gradually work across and upwards the lower edge of the step pad removing the step pad from the rear bumper impact bar.
 2. Reach under the rear bumper impact bar and compress the step pad retainers using a suitable tool.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:

Fuel Delivery: | Fuel:

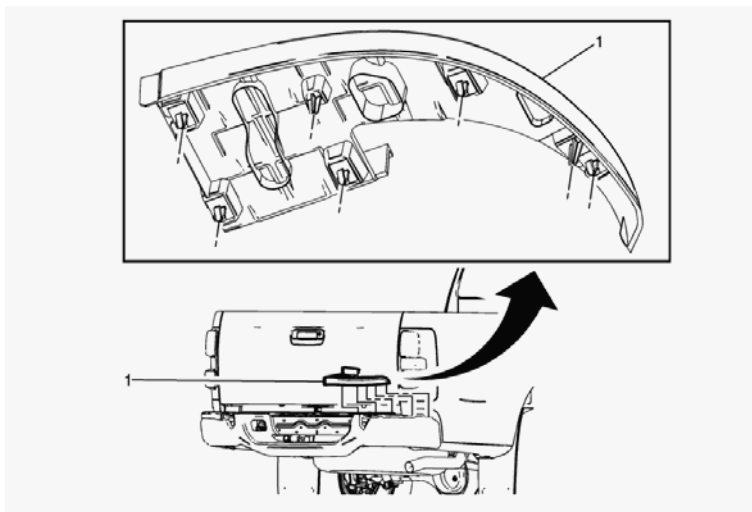

Rear Bumper Step Outer Pad Replacement

Callout

Component Name

Preliminary Procedures

1. Ensure the endgate is fully closed.
2. Remove the rear bumper center step pad. Refer to Rear Bumper Step Center Pad Replacement.

Rear Bumper Outer Step Pad


Procedure

1

1. Carefully push a thin nylon wedge between the lower rear edge of the step pad while pulling on the lower edge of the step pad releasing the retainers, gradually work across and upwards the lower edge of the step pad removing the step pad from the rear bumper impact bar.
2. Reach under the rear bumper impact bar and compress the step pad retainers using a suitable tool.

2013 Chevrolet Colorado

Submodel: | Engine Type: | Liters:
Fuel Delivery: | Fuel:

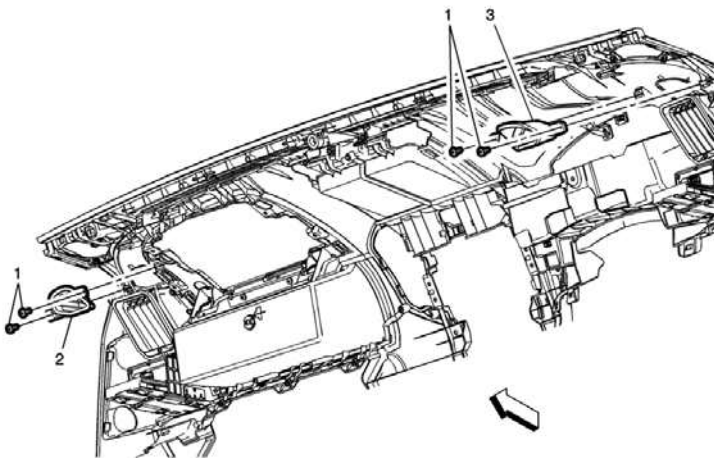

Side Window Defogger Outlet Grille Replacement

Callout Preliminary Procedures

Component Name

1. Remove the left side window defogger outlet duct. Refer to Side Window Defogger Outlet Duct Replacement - Left Side
2. Remove the right side window defogger outlet duct. Refer to Side Window Defogger Outlet Duct Replacement - Right Side

- | | |
|---|--|
| 1 | Instrument Carrier Bolt (Qty: 4)
Caution: Refer to Fastener Caution. |
| 2 | Side Window Defogger Outlet Grille- Passenger Side |
| 3 | Side Window Defogger Outlet Grille- Driver Side |