

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

2007 ACCESSORIES & EQUIPMENT

Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

SPECIFICATIONS

FASTENER TIGHTENING SPECIFICATIONS

Fastener Tightening Specifications

Application	Specification	
	Metric	English
Front Floor Console Bolts (Cadillac)	2 N.m	18 lb in
Front Floor Console Compartment Bezel Screws (Cadillac)	2 N.m	18 lb in
Front Floor Console Compartment Panel Screws (Except Cadillac)	2 N.m	18 lb in
Front Floor Console Cover (Lid) Screws	2 N.m	18 lb in
Front Floor Console End Panel Screws (Except Cadillac)	2 N.m	18 lb in
Front Floor Console Inner Cover Screws	2 N.m	18 lb in
Front Floor Console Latch Inner Screws	2 N.m	18 lb in
Front Floor Console Latch Outer Screws	2 N.m	18 lb in
Front Floor Console Side Trim Panel Screws (Cadillac)	2 N.m	18 lb in
Front Overhead Console Screws	2 N.m	18 lb in
Instrument Panel Carrier Screws/Bolts (Except Cadillac)	2 N.m	18 lb in
Instrument Panel Carrier Support Bolts	22 N.m	16 lb ft
Instrument Panel Carrier Support Screw	2 N.m	18 lb in
Instrument Panel Cluster Trim Plate Cover Screws	2 N.m	18 lb in
Instrument Panel Compartment Door Assembly Screws (Except Cadillac)	2 N.m	18 lb in
Instrument Panel Compartment Door Screws	2 N.m	18 lb in
Instrument Panel Compartment Latch Screws	2 N.m	18 lb in
Instrument Panel Compartment Striker Screws	2 N.m	18 lb in
Instrument Panel Insulator Screws	2 N.m	18 lb in
Instrument Panel Knee Bolster Deflector Nuts	9 N.m	80 lb in
Instrument Panel Knee Bolster Screws	2 N.m	18 lb in
Instrument Panel Lower Trim Panel Nuts (Cadillac)	9 N.m	80 lb in
Instrument Panel Lower Trim Panel Screws (Cadillac)	2 N.m	18 lb in
Instrument Panel Upper Trim Panel Bolts (Except Cadillac)	9 N.m	80 lb in
Instrument Panel Upper Trim Panel Bolts/Screws (Cadillac)	9 N.m	80 lb in
Instrument Panel Upper Trim Panel Screws (Except Cadillac)	2 N.m	18 lb in

REPAIR INSTRUCTIONS

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

INSTRUMENT PANEL INSULATOR REPLACEMENT (CADILLAC)

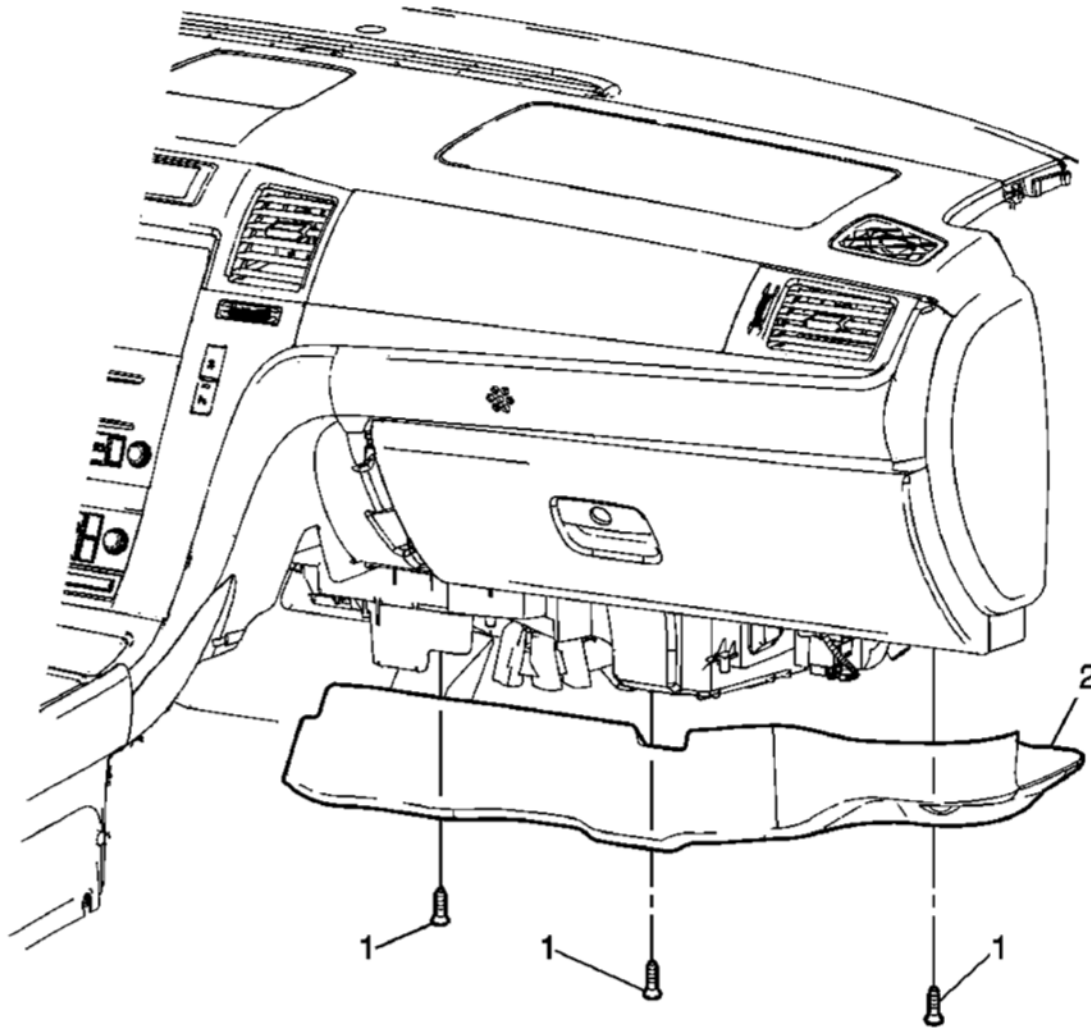


Fig. 1: View Of Instrument Panel Lower Trim Panel Insulator & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Insulator Replacement (Cadillac)

Callout	Component Name
Preliminary Procedures: Remove the right console trim panel. Refer to Front Floor Console Side Trim Panel Replacement - Right (Cadillac) or Front Floor Console Side Trim Panel Replacement - Right (Except Cadillac) .	
1	Instrument Panel Lower Trim Panel Insulator Screws (Qty: 3) NOTE: Refer to Fastener Notice

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

Tighten: 2 N.m (18 lb in)

2 Instrument Panel Lower Trim Panel Insulator

INSTRUMENT PANEL INSULATOR REPLACEMENT (EXCEPT CADILLAC)

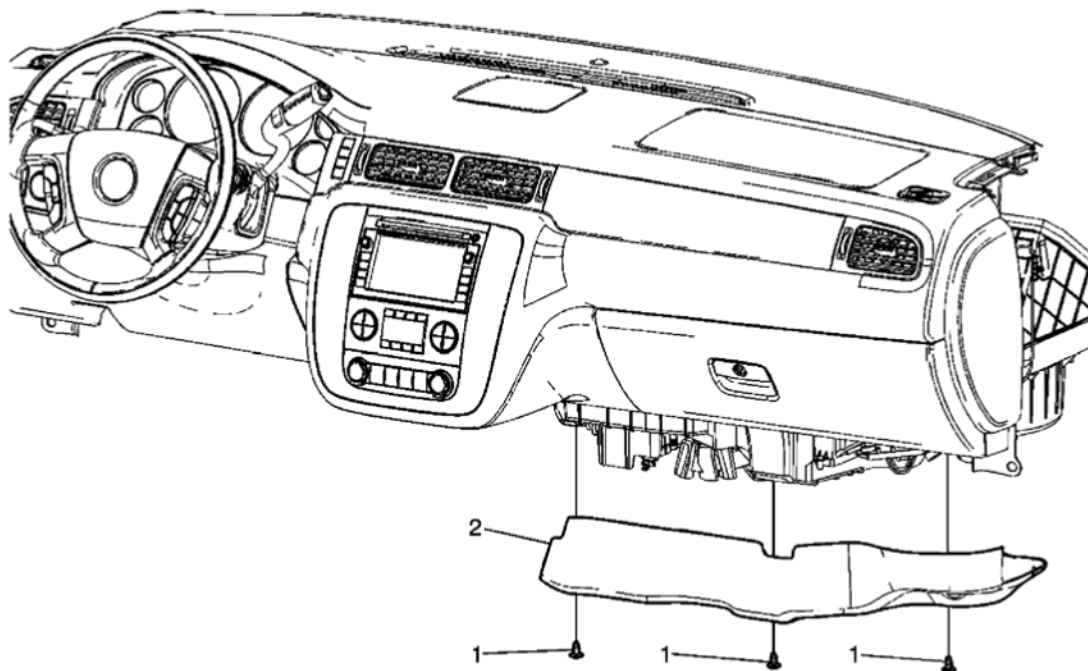


Fig. 2: View Of Instrument Panel Lower Trim Panel Insulator & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Insulator Replacement (Except Cadillac)

Callout	Component Name
1	Instrument Panel Lower Trim Panel Insulator Screws (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Lower Trim Panel Insulator

TRIM REPLACEMENT - INSTRUMENT PANEL (I/P) LOWER CENTER (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

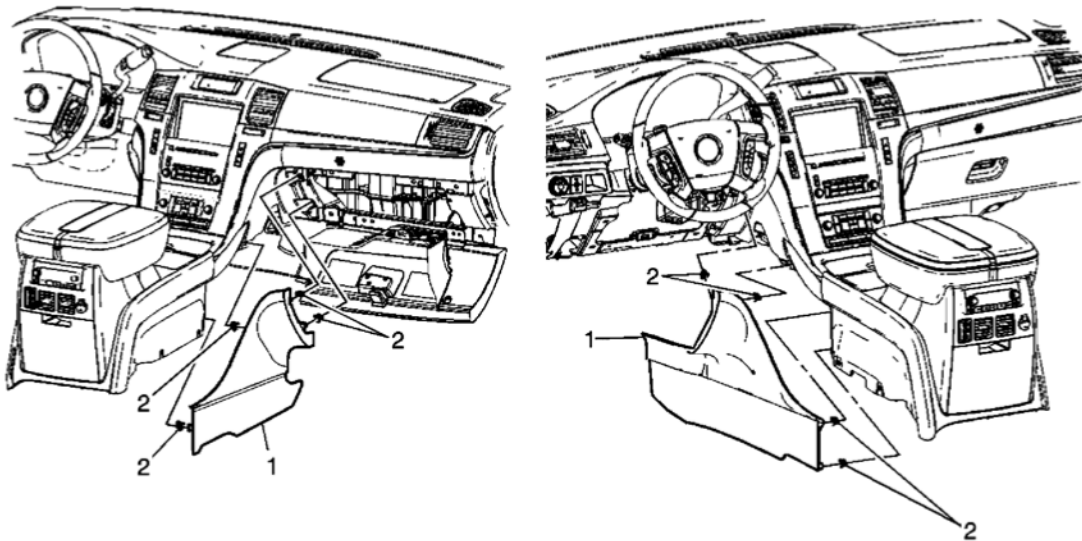


Fig. 3: View Of Instrument Panel Lower Center Trim & Clips
Courtesy of GENERAL MOTORS CORP.

Trim Replacement - Instrument Panel (I/P) Lower Center (Cadillac)

Callout	Component Name
Preliminary Procedure: Fully open the instrument panel compartment when removing the right trim panel.	
1	Instrument Panel Lower Center Trim - Right or Left Tip: • When removing the left side, also remove the knee bolster. Refer to <u>Knee Bolster Replacement (Cadillac)</u> or <u>Knee Bolster Replacement (Except Cadillac)</u>. • Use a flat-bladed plastic trim tool in order to release the trim panel from the instrument panel.
2	Retainer Clips (Qty: 8) (4 per side)

KNEE BOLSTER REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

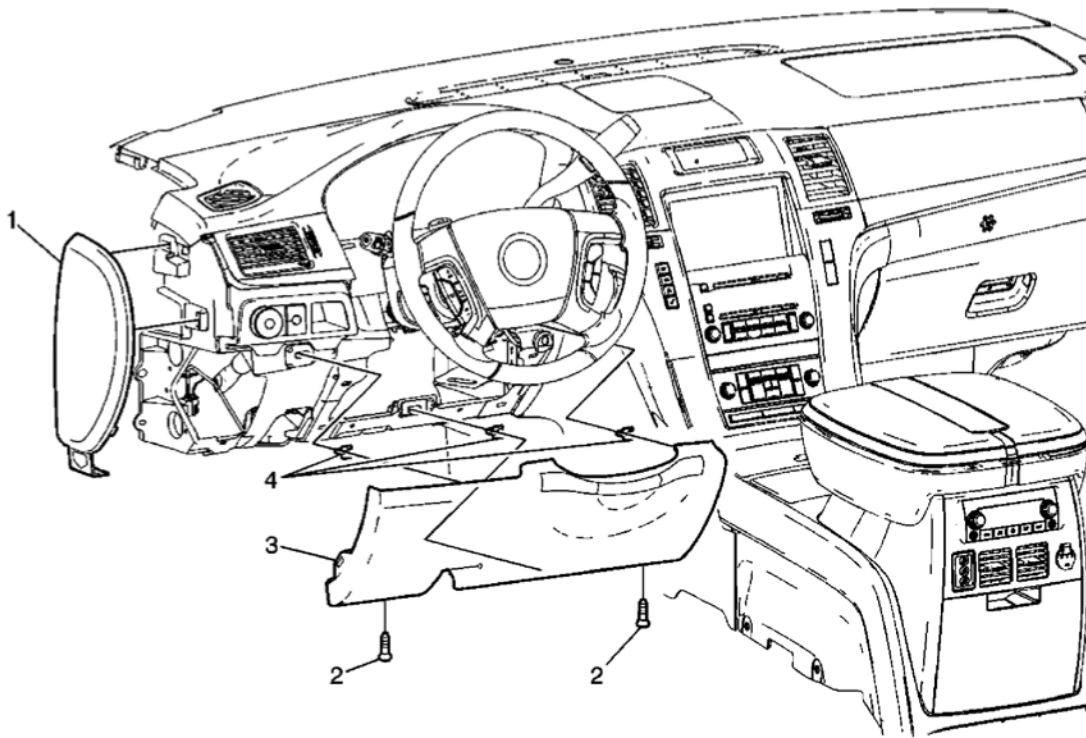


Fig. 4: View Of Knee Bolster Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Knee Bolster Replacement (Cadillac)

Callout	Component Name
Preliminary Procedures: Remove the park brake release handle. Refer to <u>Park Brake Release Handle Assembly Replacement</u> .	
1	Left Outer Trim Cover Tip: Refer to <u>Instrument Panel Outer Trim Cover Replacement (Cadillac)</u> or <u>Instrument Panel Outer Trim Cover Replacement (Except Cadillac)</u> .
2	Knee Bolster Assembly Screws (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
3	Knee Bolster Assembly
4	Retainer Clips (Qty: 4)

KNEE BOLSTER REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

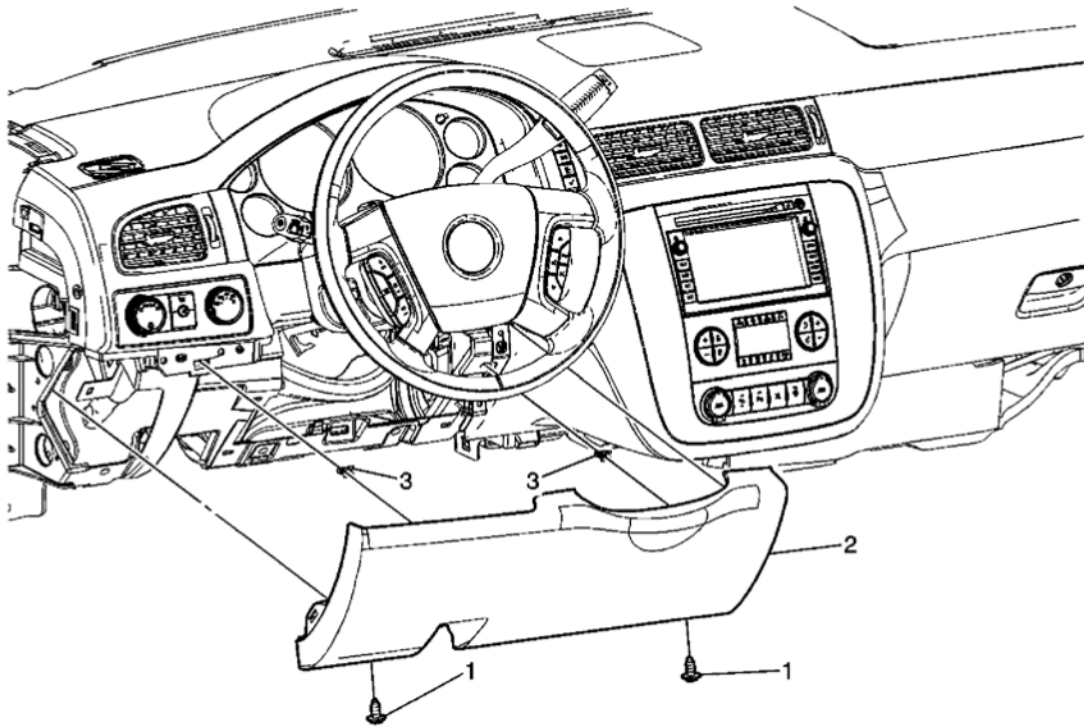


Fig. 5: View Of Knee Bolster Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Knee Bolster Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedures	
1. Remove the left instrument panel outer trim cover. Refer to <u>Instrument Panel Outer Trim Cover Replacement (Cadillac)</u> or <u>Instrument Panel Outer Trim Cover Replacement (Except Cadillac)</u>. 2. Remove the park brake release handle. Refer to <u>Park Brake Release Handle Assembly Replacement</u>.	
1	Knee Bolster Assembly Screws (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Knee Bolster Assembly
3	Retainer Clips (Qty: 4)

INSTRUMENT PANEL DRIVER KNEE BOLSTER DEFLECTOR REPLACEMENT

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

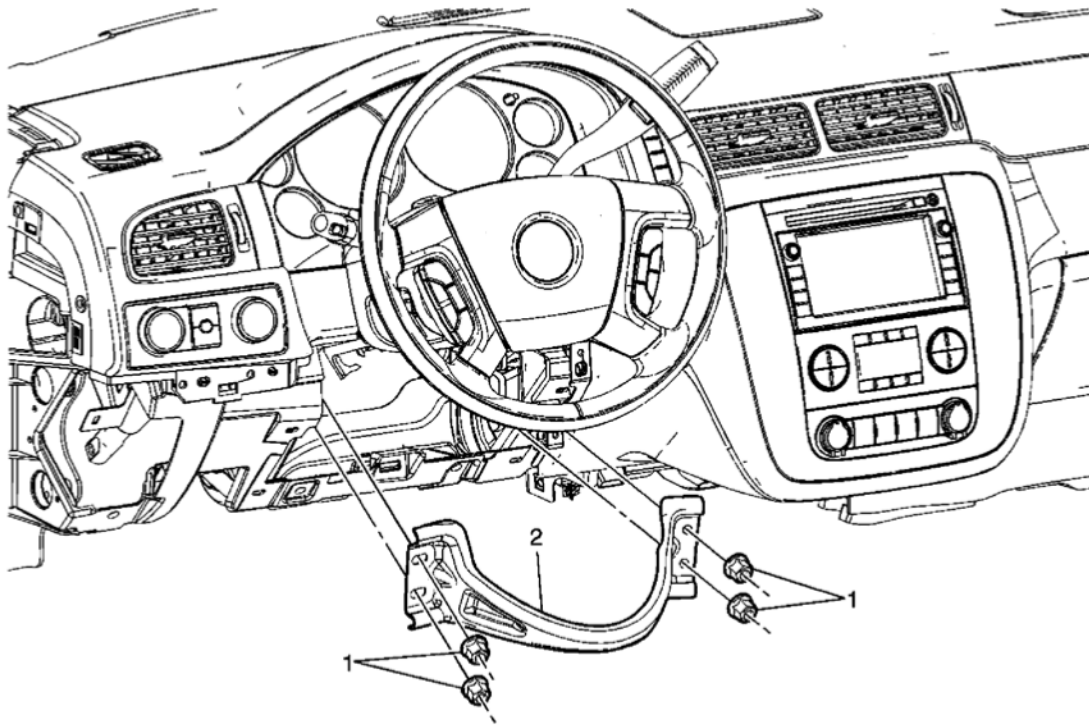


Fig. 6: View Of Knee Bolster Deflector & Nuts
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Driver Knee Bolster Deflector Replacement

Callout	Component Name
Preliminary Procedure: Remove the knee bolster. Refer to <u>Knee Bolster Replacement (Cadillac)</u> or <u>Knee Bolster Replacement (Except Cadillac)</u> .	
1	Knee Bolster Deflector Nuts (Qty: 4) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 9 N.m (80 lb in)
2	Knee Bolster Deflector

INSTRUMENT PANEL ACCESSORY TRIM PLATE REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

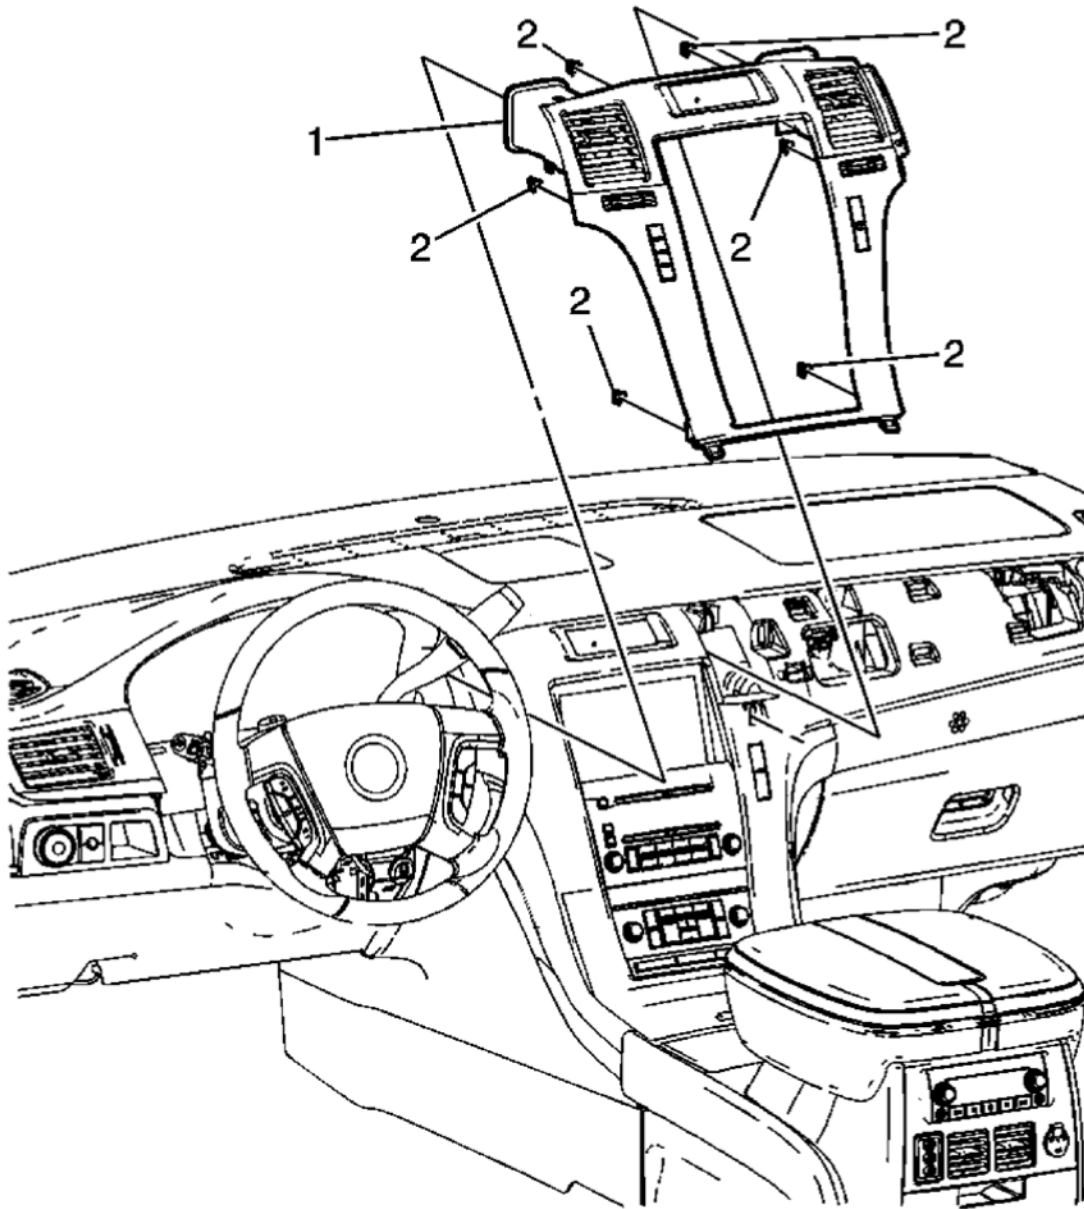


Fig. 7: View Of Instrument Panel Accessory Trim Panel & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Accessory Trim Plate Replacement (Cadillac)

Callout	Component Name
Preliminary Procedures	
1.	Remove the instrument panel center trim plate. Refer to <u>Trim Panel Replacement - Instrument Panel (I/P) Center (Cadillac)</u> or <u>Trim Panel Replacement - Instrument Panel (I/P) Center (Except Cadillac)</u> .

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

2. Remove the front floor console bezel. Refer to **Floor Console Bezel Replacement (Cadillac)** or **Floor Console Bezel Replacement (Except Cadillac)**.

1	Instrument Panel Accessory Trim Panel Tip: 1. Disconnect the electrical connections. 2. If replacing the accessory trim plate transfer all necessary components.
2	Retainer Clips (Qty: 6)

INSTRUMENT PANEL ACCESSORY TRIM PLATE REPLACEMENT (EXCEPT CADILLAC)

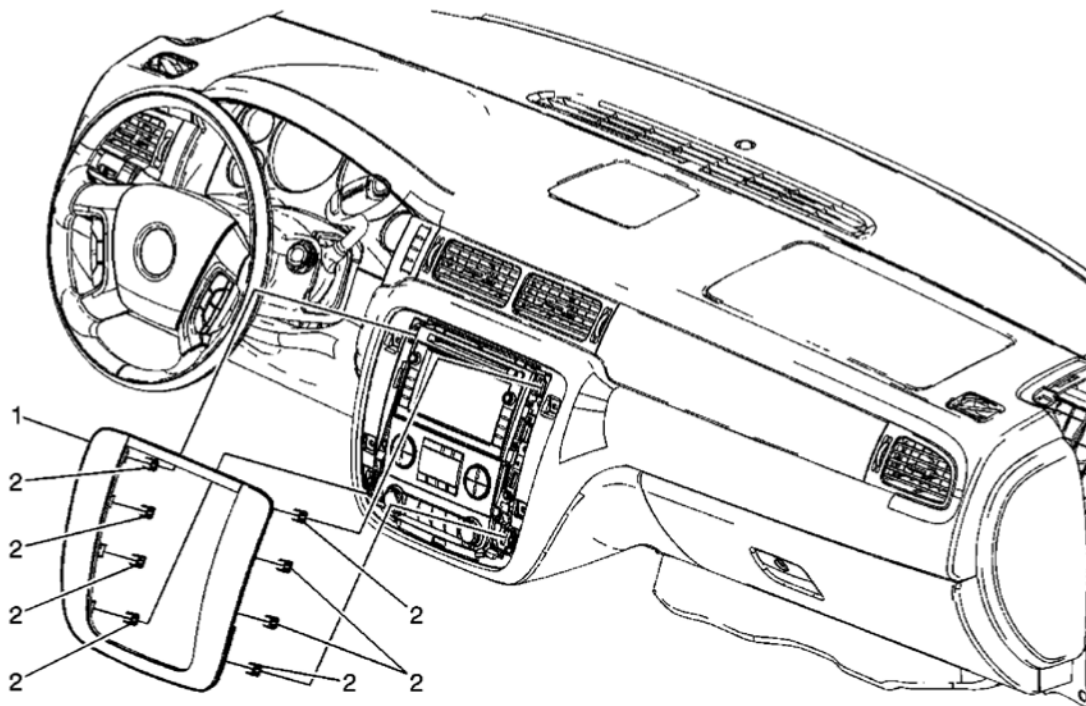


Fig. 8: View Of Instrument Panel Accessory Trim Panel & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Accessory Trim Plate Replacement (Except Cadillac)

Callout	Component Name
1	Instrument Panel Accessory Trim Plate Tip: Use a flat-bladed plastic trim tool in order to release the retainer clips securing the trim plate to the instrument panel.
2	Retainer Clips (Qty: 9)

TRIM PANEL REPLACEMENT - INSTRUMENT PANEL (I/P) CENTER (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

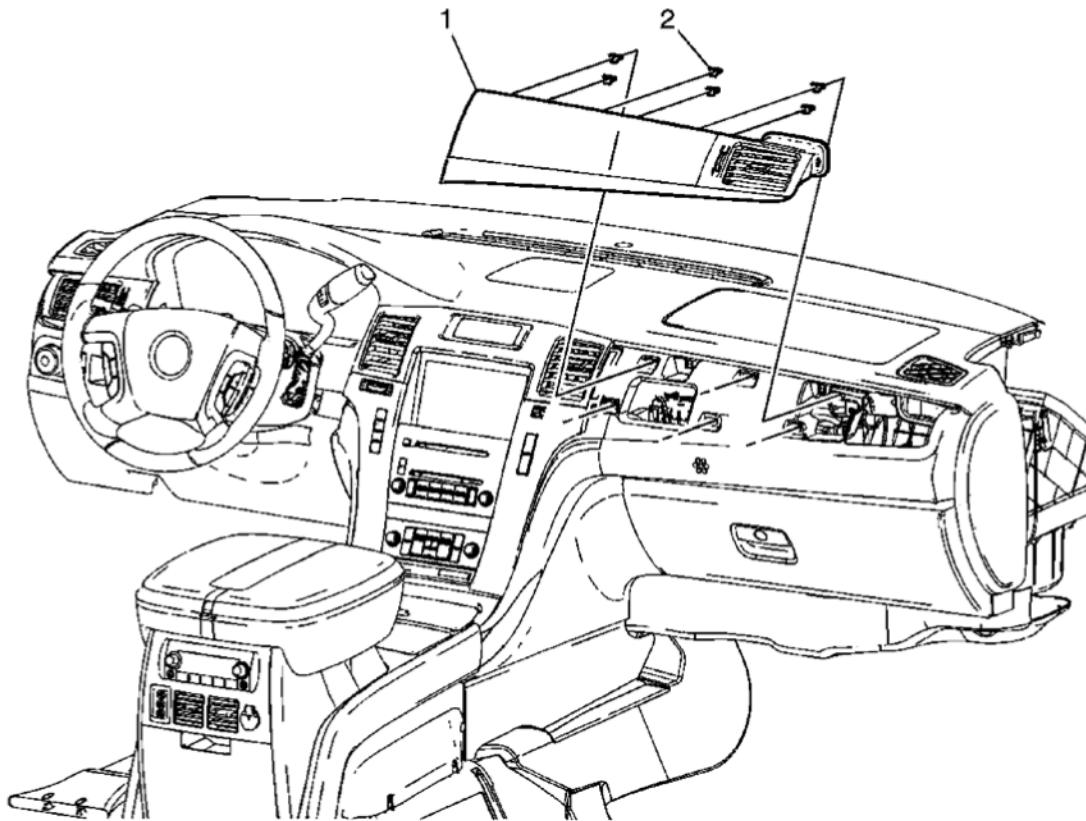


Fig. 9: Instrument Panel Center Trim Plate & Clips
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Instrument Panel (I/P) Center (Cadillac)

Callout	Component Name
1	Instrument Panel Center Trim Plate Tip: Use a flat-bladed plastic trim tool in order to release the retainer clips securing the trim plate to the instrument panel.
2	Retainer Clips (Qty: 6)

TRIM PANEL REPLACEMENT - INSTRUMENT PANEL (I/P) CENTER (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

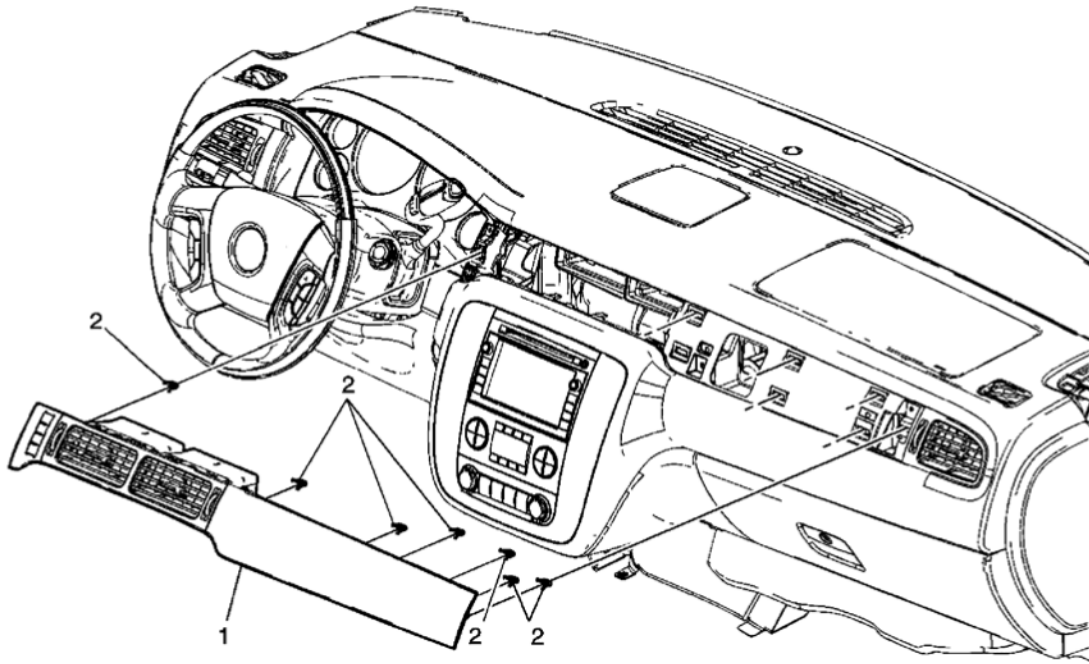


Fig. 10: Instrument Panel Center Trim Plate & Clips
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Instrument Panel (I/P) Center (Except Cadillac)

Callout	Component Name
1	Instrument Panel Center Trim Plate Tip: 1. Use a flat-bladed plastic trim tool in order to release the retainer clips securing the trim plate to the instrument panel. 2. Disconnect the electrical connections.
2	Retainer Clips (Qty: 7)

INSTRUMENT PANEL UPPER TRIM PANEL REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

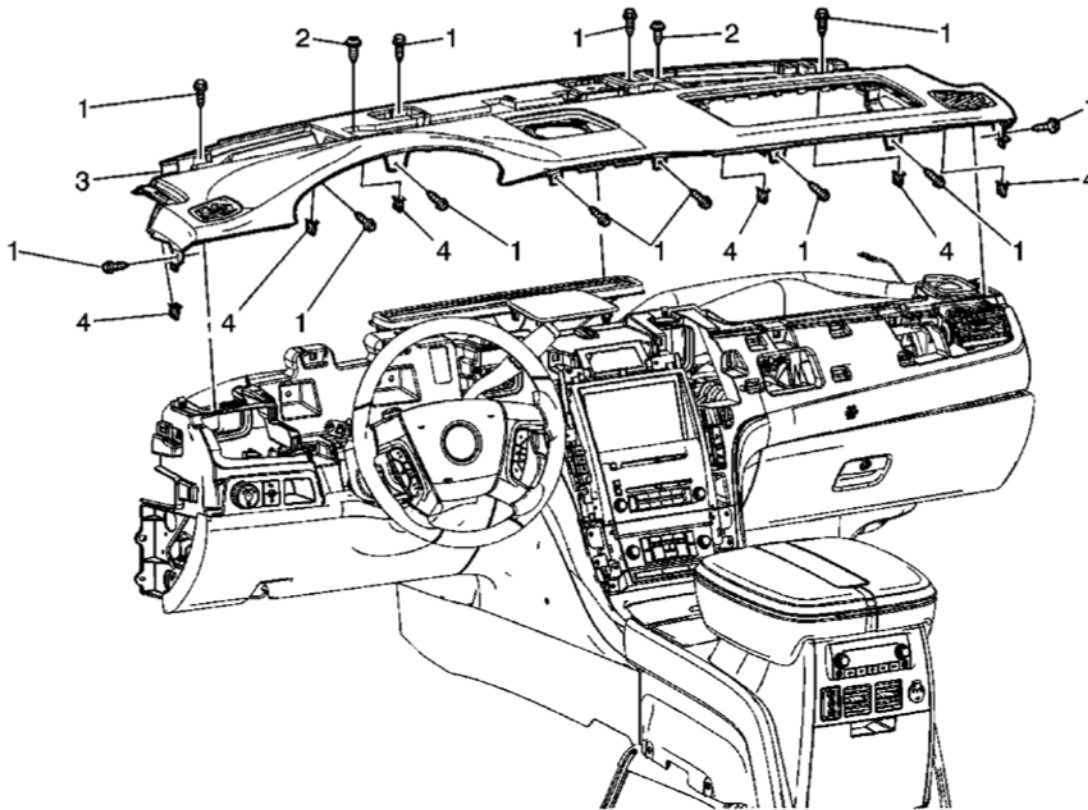


Fig. 11: View Of Instrument Panel Upper Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Upper Trim Panel Replacement (Cadillac)

Callout	Component Name
Preliminary Procedures	
1.	Disable the SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove the windshield pillar garnish moldings. Refer to <u>Garnish Molding Replacement - Windshield Pillar</u> .
3.	Remove the instrument panel upper trim panel with defroster nozzle. Refer to <u>Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Cadillac)</u> or <u>Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Except Cadillac)</u> .
4.	Remove the instrument panel outer trim covers. Refer to <u>Instrument Panel Outer Trim Cover Replacement (Cadillac)</u> or <u>Instrument Panel Outer Trim Cover Replacement (Except Cadillac)</u> .
5.	Remove the left instrument panel deflector. Refer to <u>Deflector Replacement - Instrument Panel Air - Left (Cadillac)</u> or <u>Deflector Replacement - Instrument Panel Air - Left (Except Cadillac)</u> .
6.	Remove the instrument panel cluster assembly. Refer to <u>Instrument Cluster Replacement</u>

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

(Cadillac) or Instrument Cluster Replacement (Except Cadillac) .

7. Remove the instrument panel center trim panel. Refer to Trim Panel Replacement - Instrument Panel (I/P) Center (Cadillac) or Trim Panel Replacement - Instrument Panel (I/P) Center (Except Cadillac).
8. Remove the instrument panel accessory trim panel assembly. Refer to Instrument Panel Accessory Trim Plate Replacement (Cadillac) or Instrument Panel Accessory Trim Plate Replacement (Except Cadillac).
9. Remove the instrument panel inflatable restraint. Refer to Inflatable Restraint Instrument Panel Module Replacement .

1	Instrument Panel Upper Trim Panel Bolts/Screws (Qty: 8) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 9 N.m (80 lb in)
2	Instrument Panel Upper Trim Panel Assembly Tip: 1. Disconnect electrical connections. 2. With the aid of an assistant, remove the trim panel from the vehicle.
3	Retainer Clips (Qty: 6)

INSTRUMENT PANEL UPPER TRIM PANEL REPLACEMENT (EXCEPT CADILLAC)

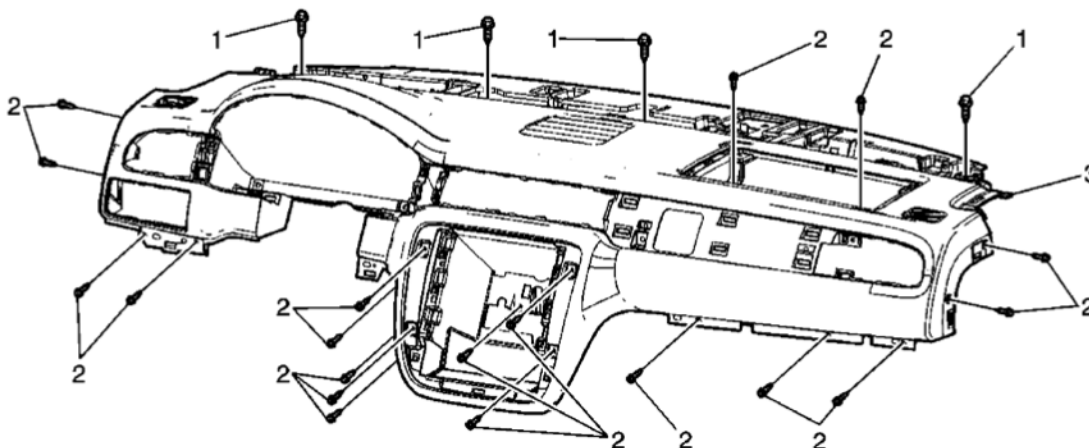


Fig. 12: View Of Instrument Panel Upper Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Upper Trim Panel Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedures	

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1. Disable the SIR system. Refer to **SIR Disabling and Enabling** .
2. Remove the windshield pillar garnish moldings. Refer to **Garnish Molding Replacement - Windshield Pillar** .
3. Remove the instrument panel upper trim panel with defroster nozzle. Refer to **Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Cadillac)** or **Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Except Cadillac)**.
4. Remove the instrument panel outer trim covers. Refer to **Instrument Panel Outer Trim Cover Replacement (Cadillac)** or **Instrument Panel Outer Trim Cover Replacement (Except Cadillac)**.
5. Remove the left instrument panel deflector. Refer to **Deflector Replacement - Instrument Panel Air - Left (Cadillac)** or **Deflector Replacement - Instrument Panel Air - Left (Except Cadillac)** .
6. Remove the headlamp switch bezel assembly. Refer to **Headlamp Switch Bezel Replacement**.
7. Remove the instrument panel cluster assembly. Refer to **Instrument Cluster Replacement (Cadillac)** or **Instrument Cluster Replacement (Except Cadillac)** .
8. Remove the knee bolster assembly. Refer to **Knee Bolster Replacement (Cadillac)** or **Knee Bolster Replacement (Except Cadillac)**.
9. Remove the instrument panel center trim panel. Refer to **Trim Panel Replacement - Instrument Panel (I/P) Center (Cadillac)** or **Trim Panel Replacement - Instrument Panel (I/P) Center (Except Cadillac)**.
10. Remove the instrument panel accessory switch assembly. Refer to **Accessory Switch Replacement (Cadillac)** or **Accessory Switch Replacement (Except Cadillac)** .
11. Remove the HVAC control module. Refer to **HVAC Control Module Replacement** .
12. Remove the radio. Refer to **Radio Replacement (Cadillac)** or **Radio Replacement (Except Cadillac)** .
13. Remove the instrument panel inflatable restraint. Refer to **Inflatable Restraint Instrument Panel Module Replacement** .
14. Remove the right instrument panel deflector. Refer to **Deflector Replacement - Instrument Panel Air - Center (Cadillac)** or **Deflector Replacement - Instrument Panel Air - Center (Except Cadillac)** .
15. Remove the instrument panel compartment door. Refer to **Instrument Panel Compartment Door Replacement (Cadillac)** or **Instrument Panel Compartment Door Replacement (Except Cadillac)**.
16. Remove the instrument panel access hole cover panel. Refer to **Instrument Panel Compartment Access Hole Cover Replacement (Cadillac)** or **Instrument Panel Compartment Access Hole Cover Replacement (Except Cadillac)**.

1

Instrument Panel Upper Trim Panel Bolts (Qty: 4)

NOTE:

Refer to **Fastener Notice** .

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

	Tighten: 9 N.m (80 lb in)
2	Instrument Panel Upper Trim Panel Screws (Qty: 18) Tighten: 2 N.m (18 lb in)
3	Instrument Panel Upper Trim Panel Assembly Tip: 1. Prior to removal of the trim panel from the carrier assembly, note the routing of the wiring to aid in reassembly. 2. Disconnect electrical connections. 3. With the aid of an assistant, remove the trim panel from the vehicle.

HEADLAMP SWITCH BEZEL REPLACEMENT

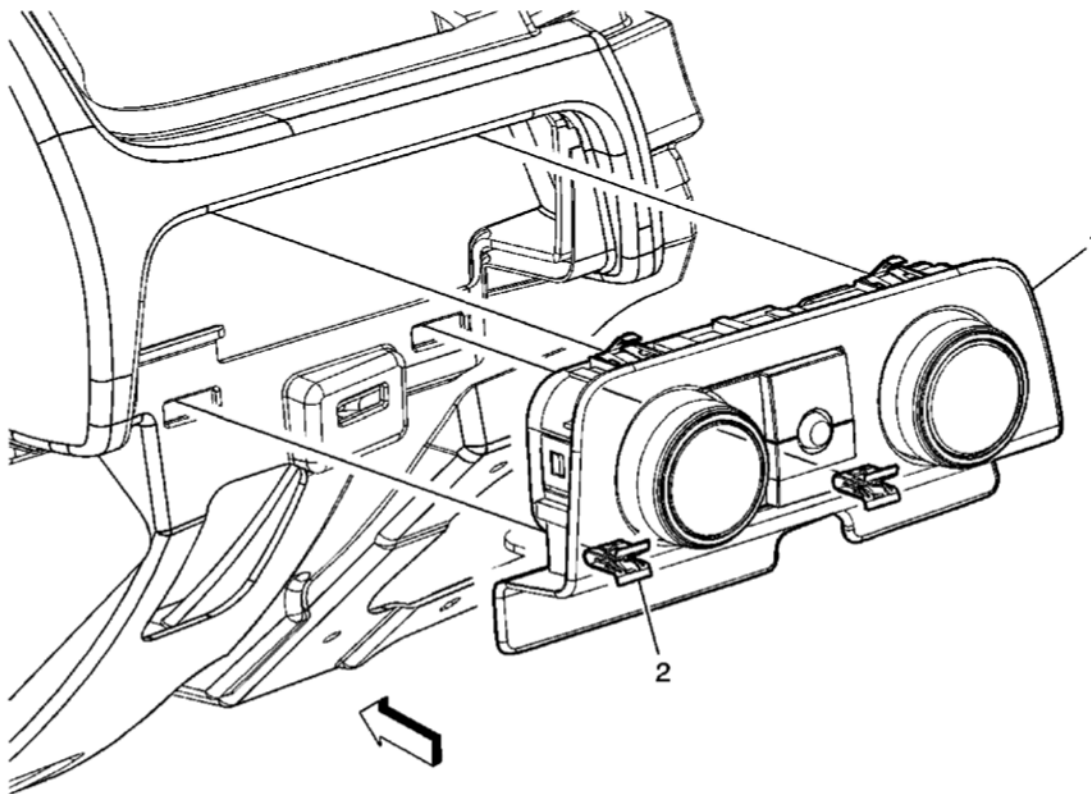


Fig. 13: View Of Headlamp Switch Trim Plate Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Headlamp Switch Bezel Replacement

Callout	Component Name
	Headlamp Switch Trim Plate Assembly Tip:

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1	1. Disconnect the electrical connectors. 2. If replacing the trim plate, transfer the switches as needed.
2	Headlamp Switch Plate Retainer (Qty: 4)

INSTRUMENT PANEL CLUSTER TRIM PLATE COVER REPLACEMENT (EXCEPT CADILLAC)

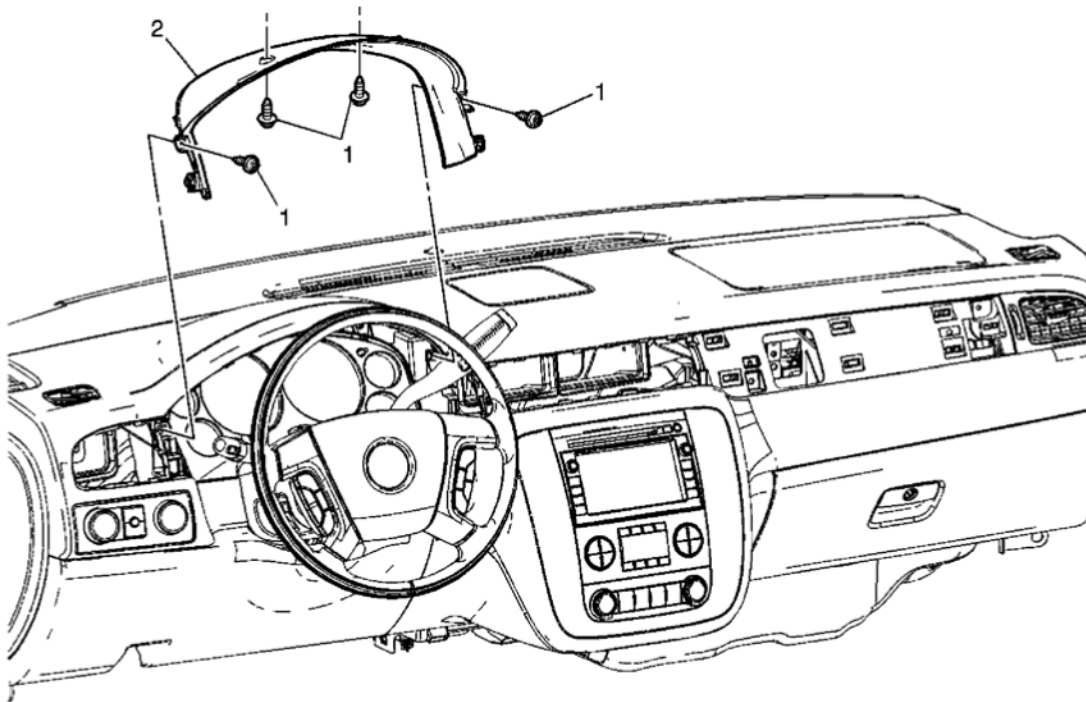


Fig. 14: View Of Instrument Panel Cluster Trim Plate Cover Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Cluster Trim Plate Cover Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedures	
1. Tilt the steering wheel to its lowest position.	
2. Remove the instrument panel left air deflector. Refer to <u>Deflector Replacement - Instrument Panel Air - Left (Cadillac)</u> or <u>Deflector Replacement - Instrument Panel Air - Left (Except Cadillac)</u> .	
3. Remove the instrument panel center trim panel. Refer to <u>Trim Panel Replacement - Instrument Panel (I/P) Center (Cadillac)</u> or <u>Trim Panel Replacement - Instrument Panel (I/P) Center (Except Cadillac)</u> .	
	Instrument Panel Cluster Trim Plate Cover Assembly Screws (Qty: 4)
NOTE:	

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1	Refer to Fastener Notice . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Cluster Trim Plate Cover Assembly

TRIM PANEL REPLACEMENT - INSTRUMENT PANEL (I/P) CLUSTER (CADILLAC)

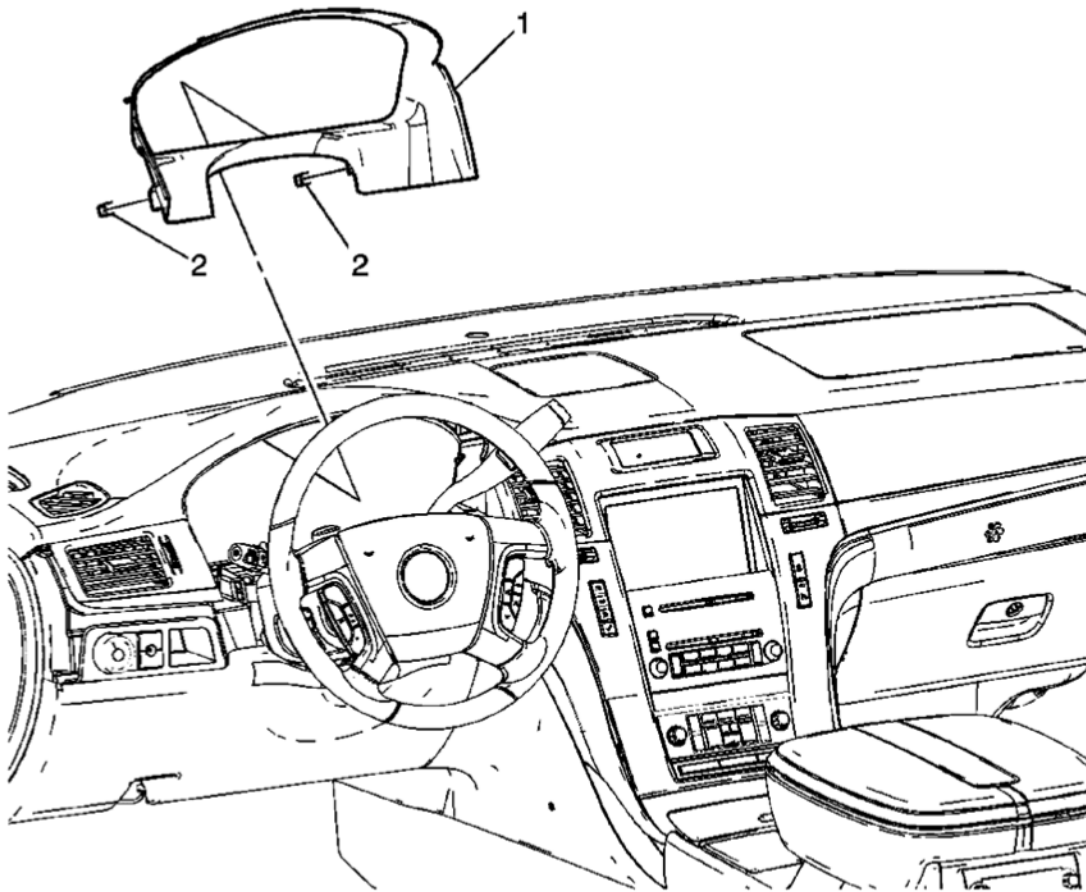


Fig. 15: View Of Instrument Panel Cluster Trim Plate Bezel & Clips
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Instrument Panel (I/P) Cluster (Cadillac)

Callout	Component Name
1	Instrument Panel Cluster Trim Plate Bezel Tip: 1. Position the steering wheel to its lowest possible position. 2. Use a flat-bladed plastic trim tool in order to release the retainer clips securing the lower edge of the trim plate to the instrument panel.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

3. Pull the trim bezel downward, releasing the tabs at the upper edge of the bezel from the instrument panel upper trim panel.

2 Retainer Clips (Qty: 4)

TRIM PANEL REPLACEMENT - INSTRUMENT PANEL (I/P) CLUSTER (EXCEPT CADILLAC)

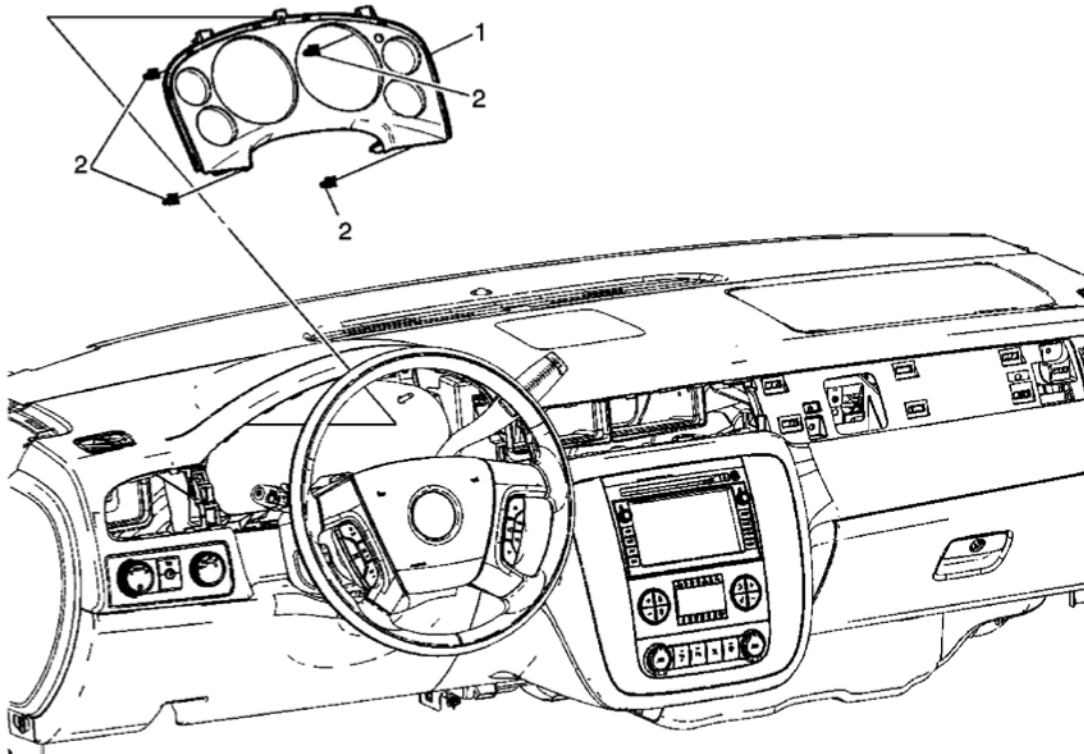


Fig. 16: View Of Instrument Panel Cluster Trim Plate Bezel & Clips
Courtesy of GENERAL MOTORS CORP.

Trim Panel Replacement - Instrument Panel (I/P) Cluster (Except Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the instrument panel cluster trim plate cover. Refer to <u>Instrument Panel Cluster Trim Plate Cover Replacement (Except Cadillac)</u> .	
1	Instrument Panel Cluster Trim Plate
2	Retainer Clips (Qty: 4)

INSTRUMENT PANEL OUTER TRIM COVER REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

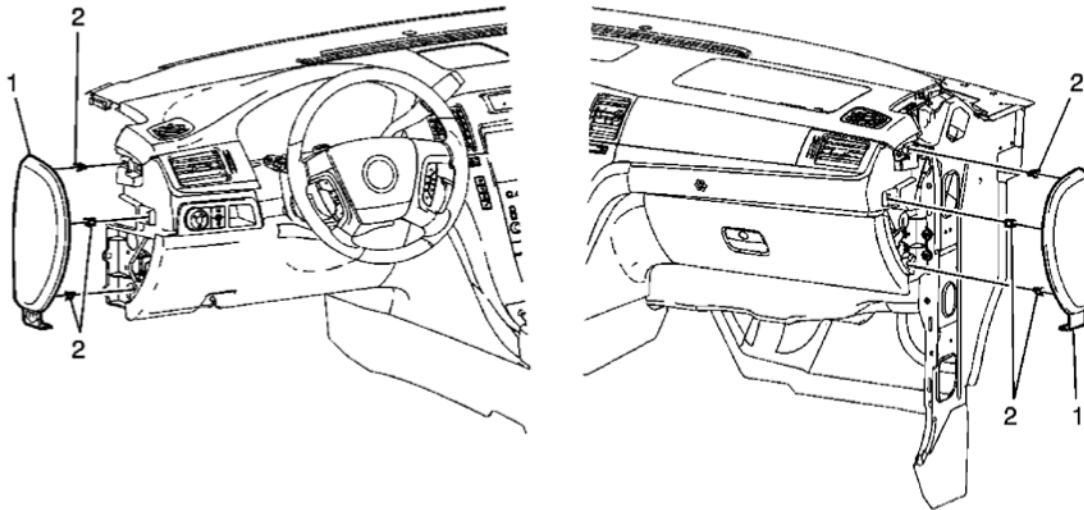


Fig. 17: View Of Instrument Panel Outer Trim Cover & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Outer Trim Cover Replacement (Cadillac)

Callout	Component Name
1	Instrument Panel Outer Trim Cover - Right or Left
2	Retainer Clips (Qty: 3)

INSTRUMENT PANEL OUTER TRIM COVER REPLACEMENT (EXCEPT CADILLAC)

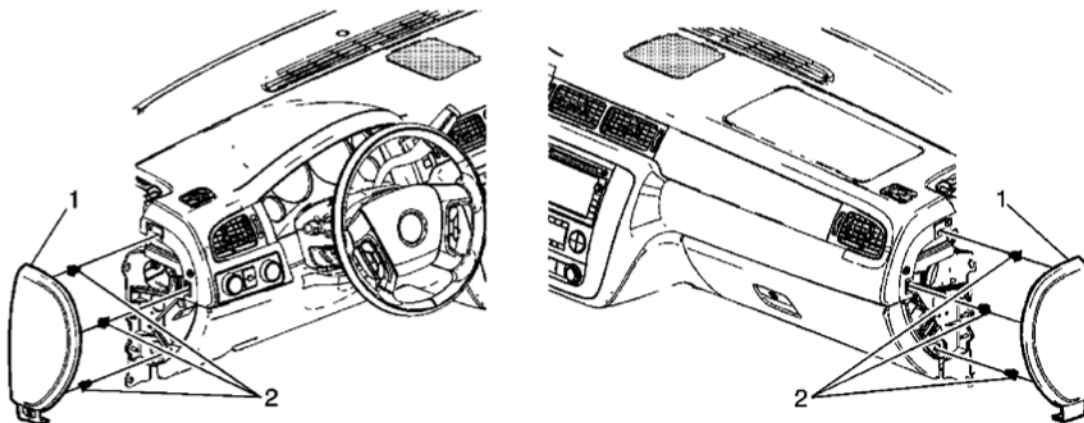


Fig. 18: View Of Instrument Panel Outer Trim Cover & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Outer Trim Cover Replacement (Except Cadillac)

Callout	Component Name

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1	Instrument Panel Outer Trim Cover - Right or Left
2	Retainer Clips (Qty: 3)

INSTRUMENT PANEL COMPARTMENT DOOR LOCK STRIKER REPLACEMENT (CADILLAC)

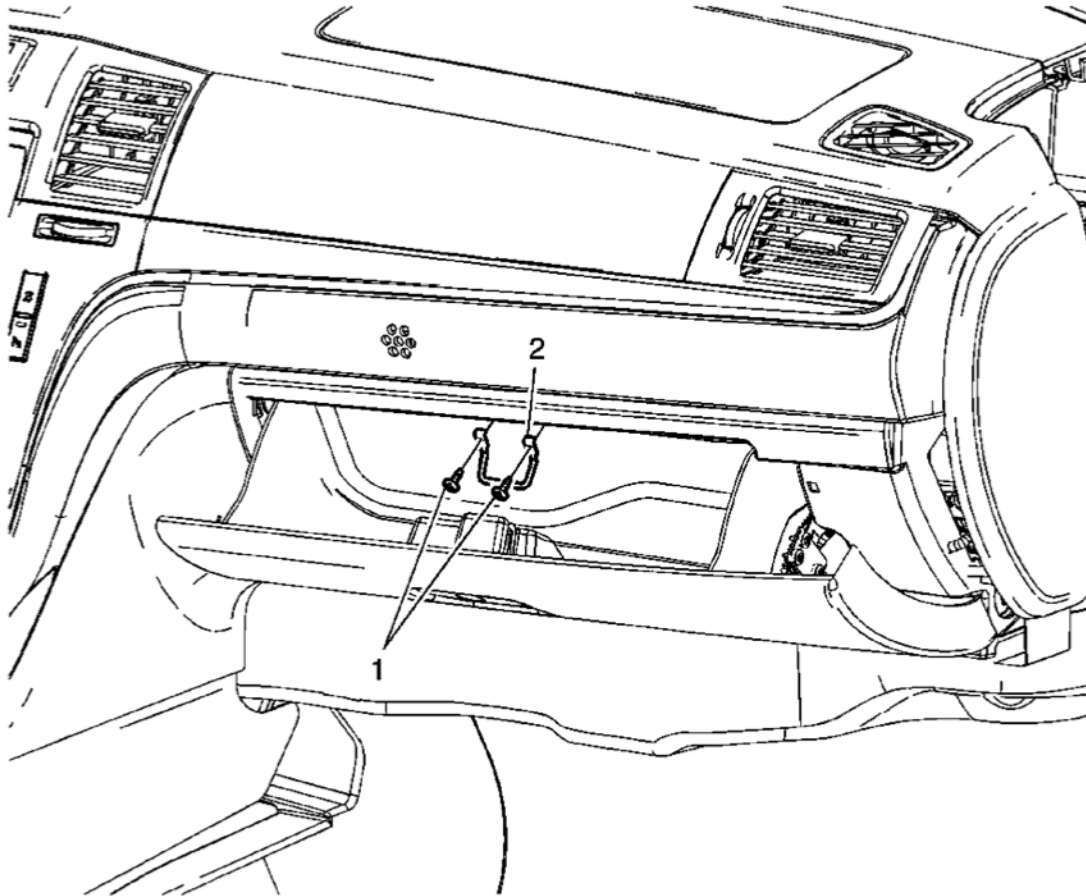


Fig. 19: View Of Instrument Panel Compartment Striker & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Lock Striker Replacement (Cadillac)

Callout	Component Name
1	Instrument Panel Compartment Striker Screws (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Compartment Striker

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

INSTRUMENT PANEL COMPARTMENT DOOR LOCK STRIKER REPLACEMENT (EXCEPT CADILLAC)

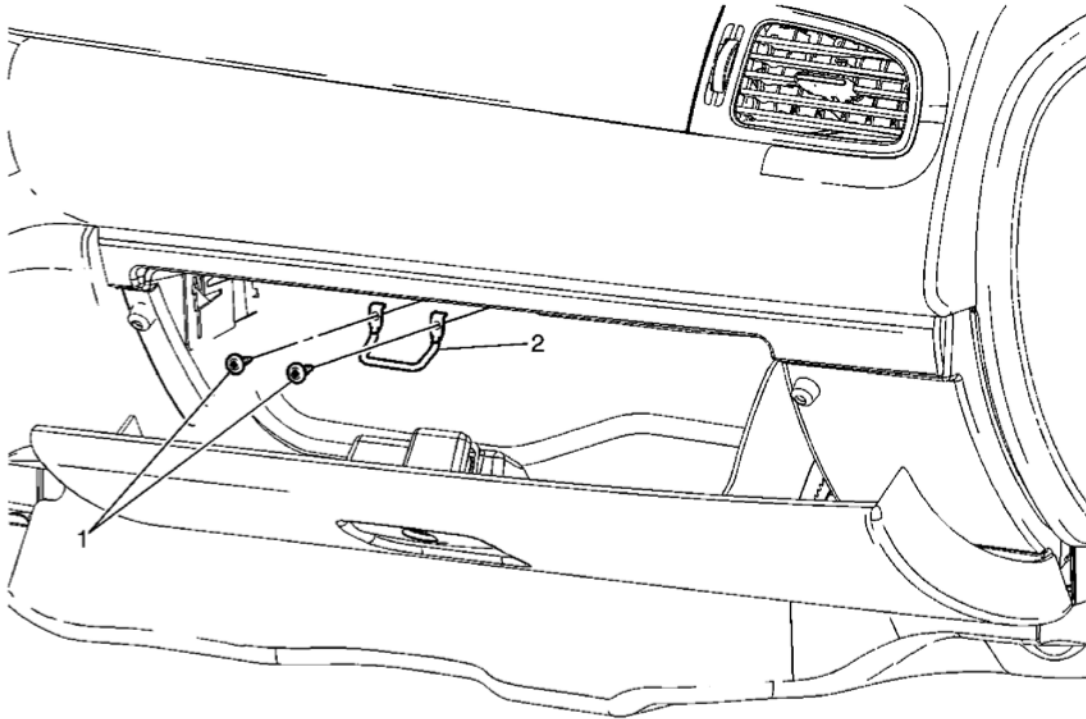


Fig. 20: View Of Instrument Panel Compartment Striker & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Lock Striker Replacement (Except Cadillac)

Callout	Component Name
1	Instrument Panel Compartment Striker Screws (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Compartment Striker

INSTRUMENT PANEL COMPARTMENT DOOR REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

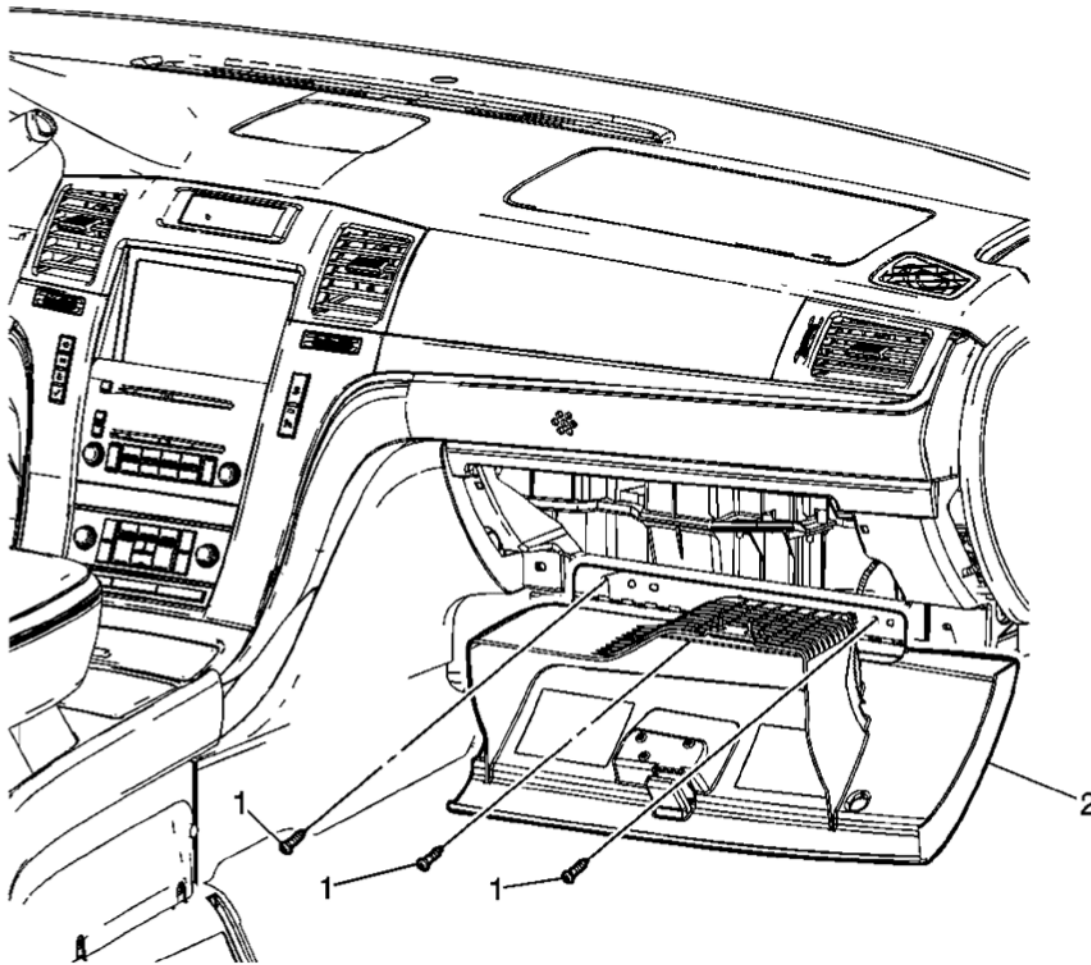


Fig. 21: View Of Instrument Panel Compartment Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Replacement (Cadillac)

Callout	Component Name
Preliminary Procedures	
1. Open the instrument panel compartment.	
2. Release the instrument panel compartment stop, allowing the compartment to fully open.	
1	Instrument Panel Compartment Screws (Qty: 5) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Compartment Assembly

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

INSTRUMENT PANEL COMPARTMENT DOOR REPLACEMENT (EXCEPT CADILLAC)

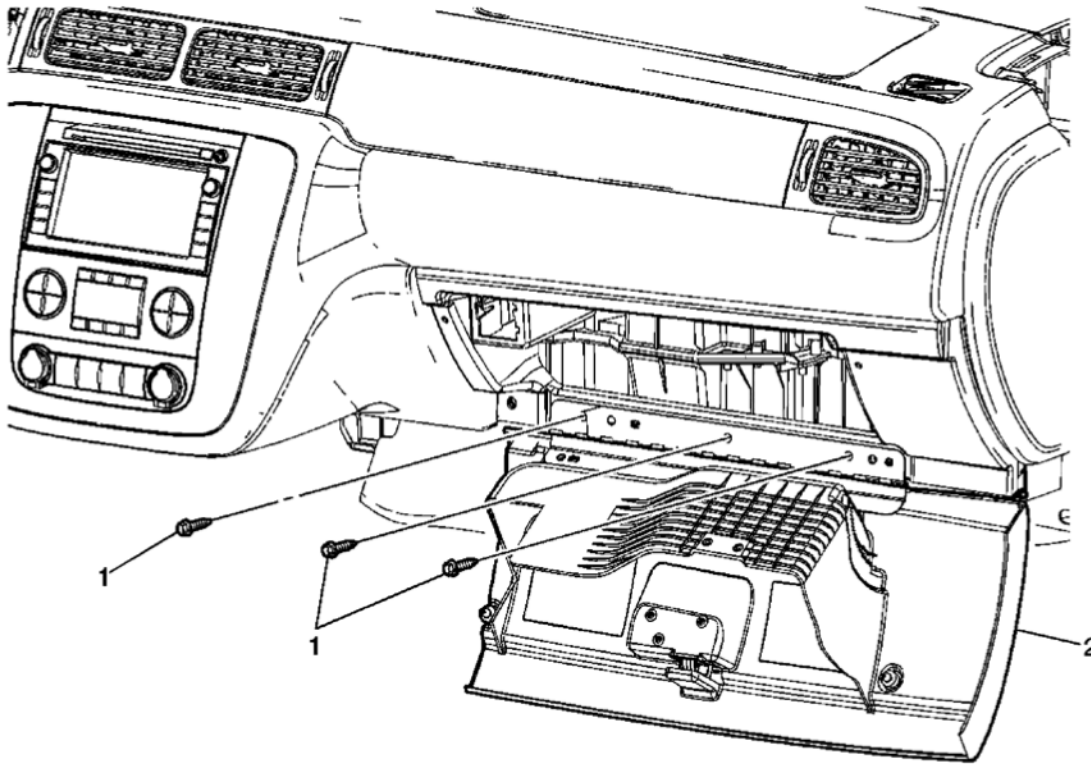


Fig. 22: View Of Instrument Panel Compartment Door Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Replacement (Except Cadillac)

Callout	Component Name
1	Instrument Panel Compartment Door Screws (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in) Tip: 1. Open the instrument panel compartment door. 2. Release the instrument panel compartment door stop. 3. Allow the instrument panel compartment door to open completely to access the screws.
2	Instrument Panel Compartment Door Assembly

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

INSTRUMENT PANEL COMPARTMENT DOOR ASSEMBLY REPLACEMENT (EXCEPT CADILLAC)

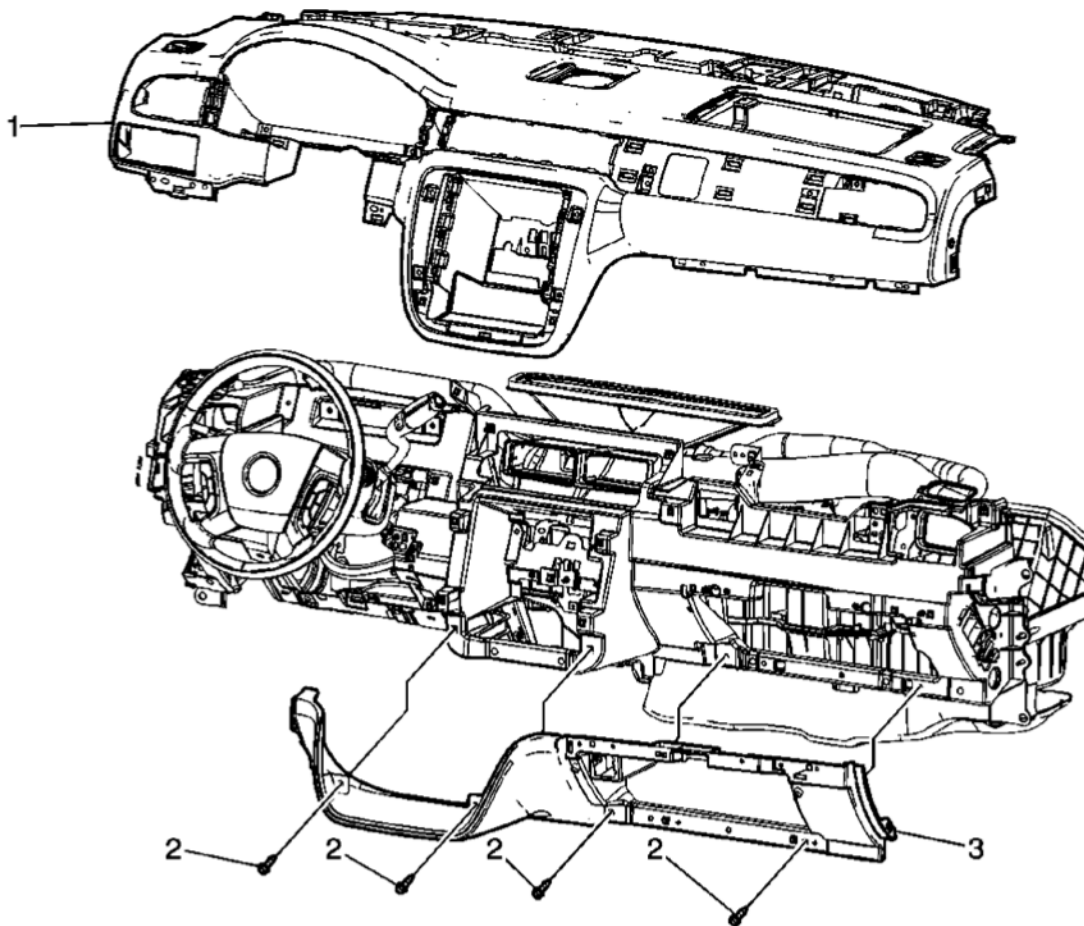


Fig. 23: View Of Instrument Panel Compartment Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Assembly Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the front floor console. Refer to <u>Console Replacement - Front Floor (Cadillac)</u> or <u>Console Replacement - Front Floor (Except Cadillac)</u> .	
1	Instrument Panel Upper Trim Panel Assembly Refer to <u>Instrument Panel Upper Trim Panel Replacement (Cadillac)</u> or <u>Instrument Panel Upper Trim Panel Replacement (Except Cadillac)</u> .
2	Instrument Panel Compartment Assembly Screws (Qty: 18) NOTE: Refer to <u>Fastener Notice</u> .

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

Tighten: 2 N.m (18 lb in)

3 Instrument Panel Compartment Assembly (Lower Trim Panel)

INSTRUMENT PANEL COMPARTMENT ACCESS HOLE COVER REPLACEMENT (CADILLAC)

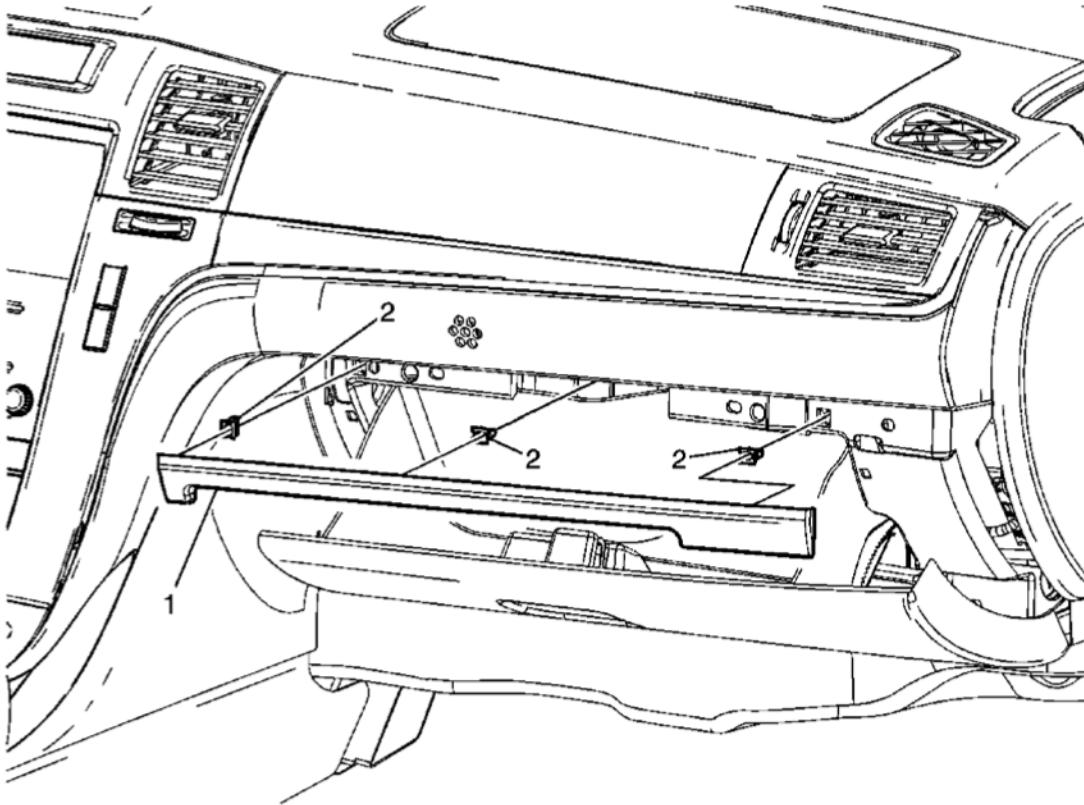


Fig. 24: View Of Instrument Panel Access Hole Cover & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Access Hole Cover Replacement (Cadillac)

Callout	Component Name
1	Instrument Panel Access Hole Cover
2	Retainer Clips (Qty: 3)

INSTRUMENT PANEL COMPARTMENT ACCESS HOLE COVER REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

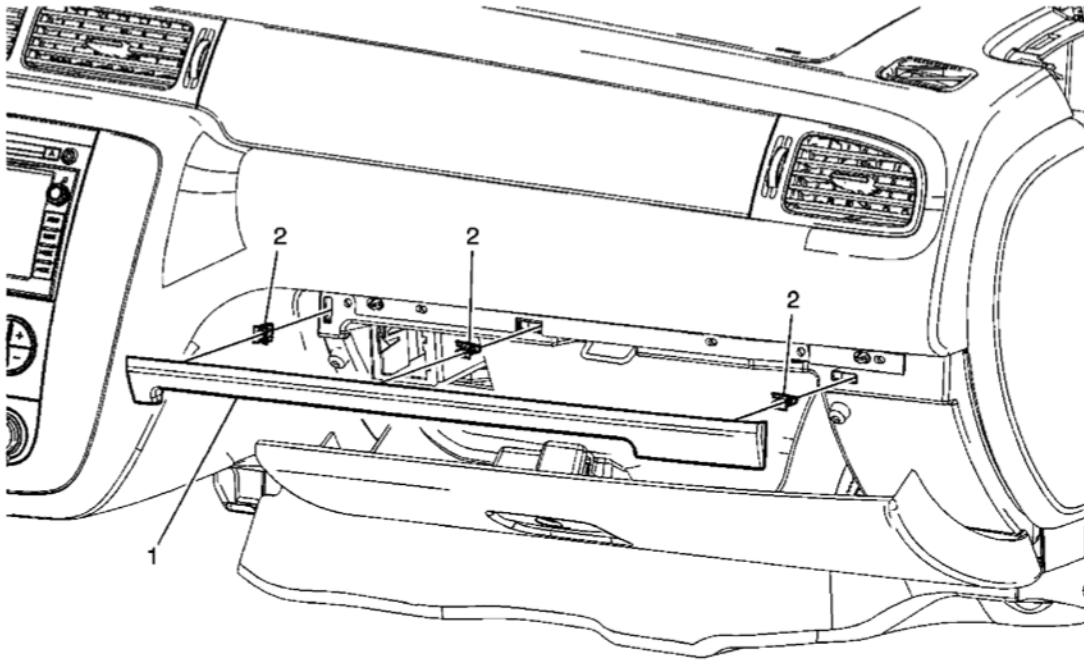


Fig. 25: View Of Instrument Panel Access Hole Cover & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Access Hole Cover Replacement (Except Cadillac)

Callout	Component Name
1	Instrument Panel Access Hole Cover
2	Retainer Clips (Qty: 3)

INSTRUMENT PANEL COMPARTMENT DOOR LATCH REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

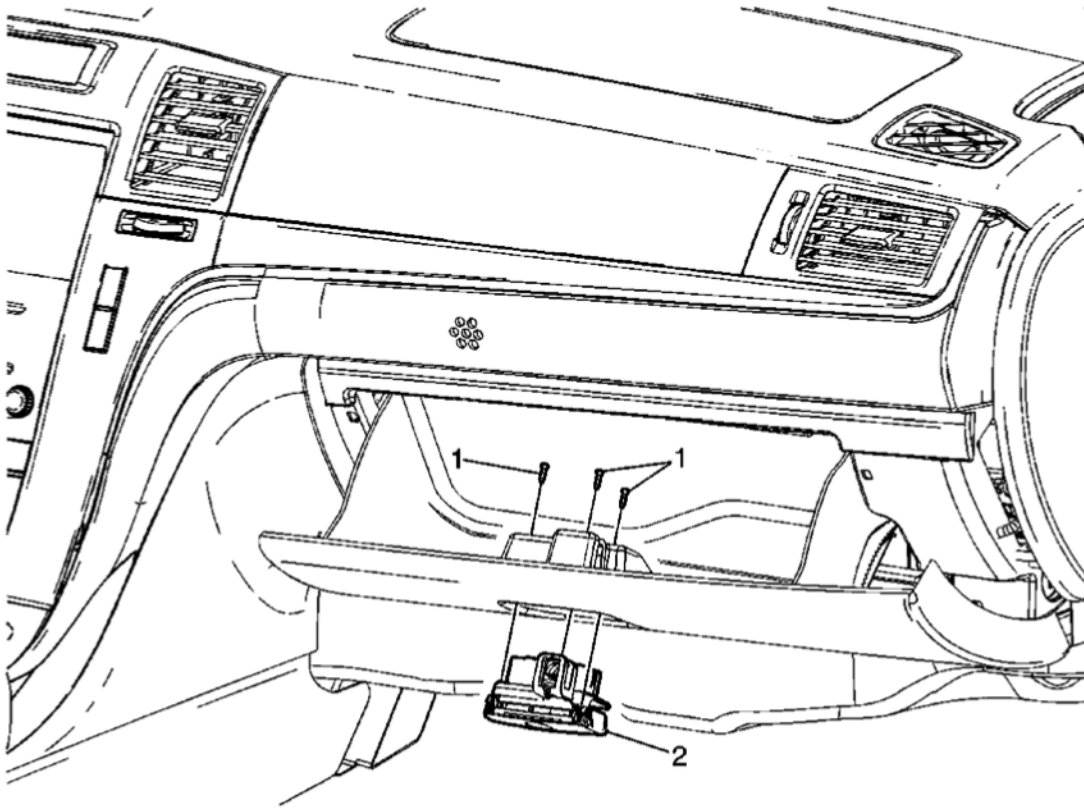


Fig. 26: View Of Instrument Panel Compartment Latch Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Latch Replacement (Cadillac)

Callout	Component Name
1	Instrument Panel Compartment Latch Screws (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Compartment Latch Assembly

INSTRUMENT PANEL COMPARTMENT DOOR LATCH REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

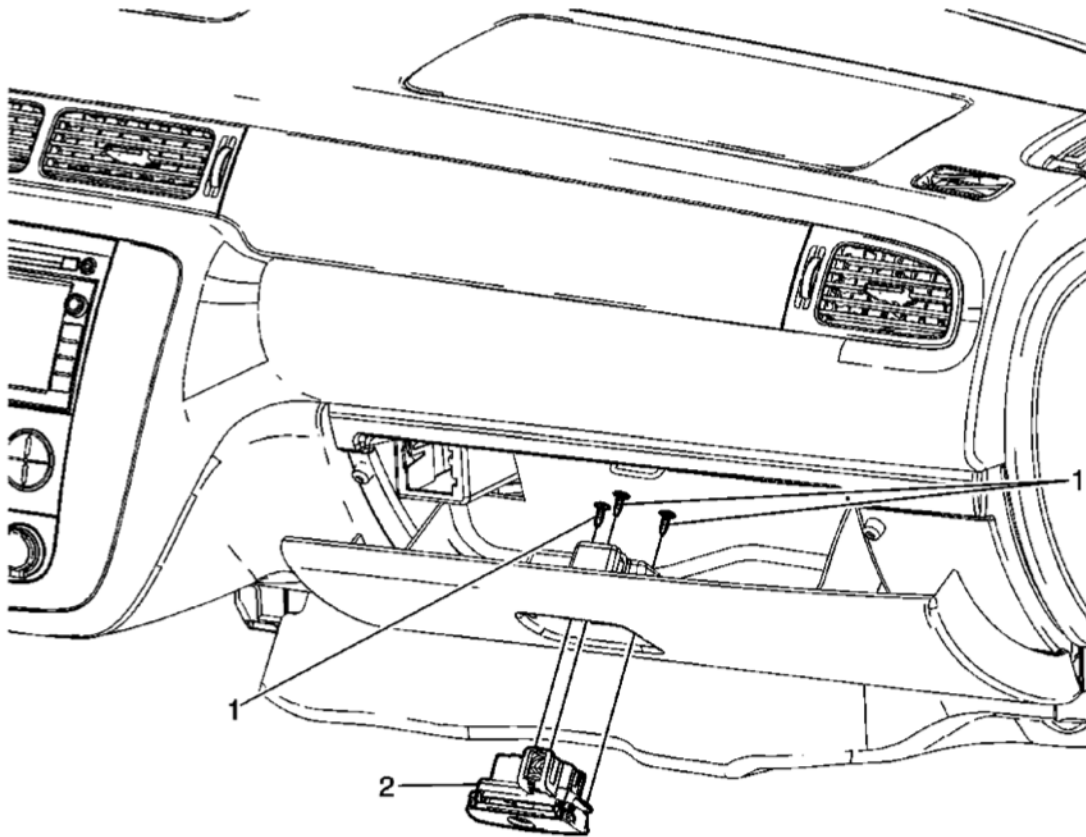


Fig. 27: View Of Instrument Panel Compartment Latch Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Compartment Door Latch Replacement (Except Cadillac)

Callout	Component Name
1	Instrument Panel Compartment Latch Screws (Qty: 3) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Compartment Latch Assembly

INSTRUMENT PANEL COMPARTMENT DOOR LOCK CYLINDER REPLACEMENT

Removal Procedure

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

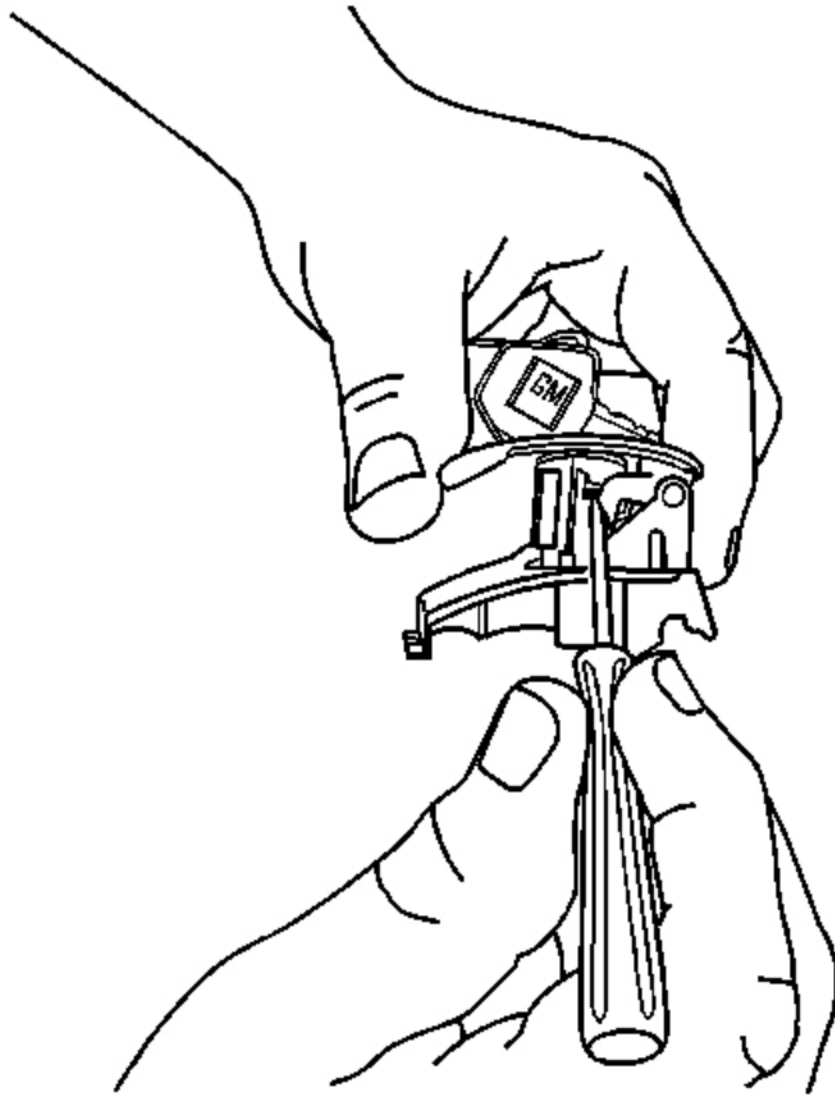


Fig. 28: Depressing Retainer Tumbler Through Poke Hole
Courtesy of GENERAL MOTORS CORP.

1. Remove the instrument panel compartment latch. Refer to **Instrument Panel Compartment Door Latch Replacement (Cadillac)** or **Instrument Panel Compartment Door Latch Replacement (Except Cadillac)**.
2. Position the instrument panel compartment latch fork bolt in the up position.
3. Insert the key into the instrument panel compartment lock cylinder.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

4. Rotate the instrument panel compartment lock cylinder clockwise to the 3 o'clock position with the key.
5. With the key in position, apply a light load and depress the retainer tumbler through the poke hole at the right hand side of the instrument panel compartment latch.

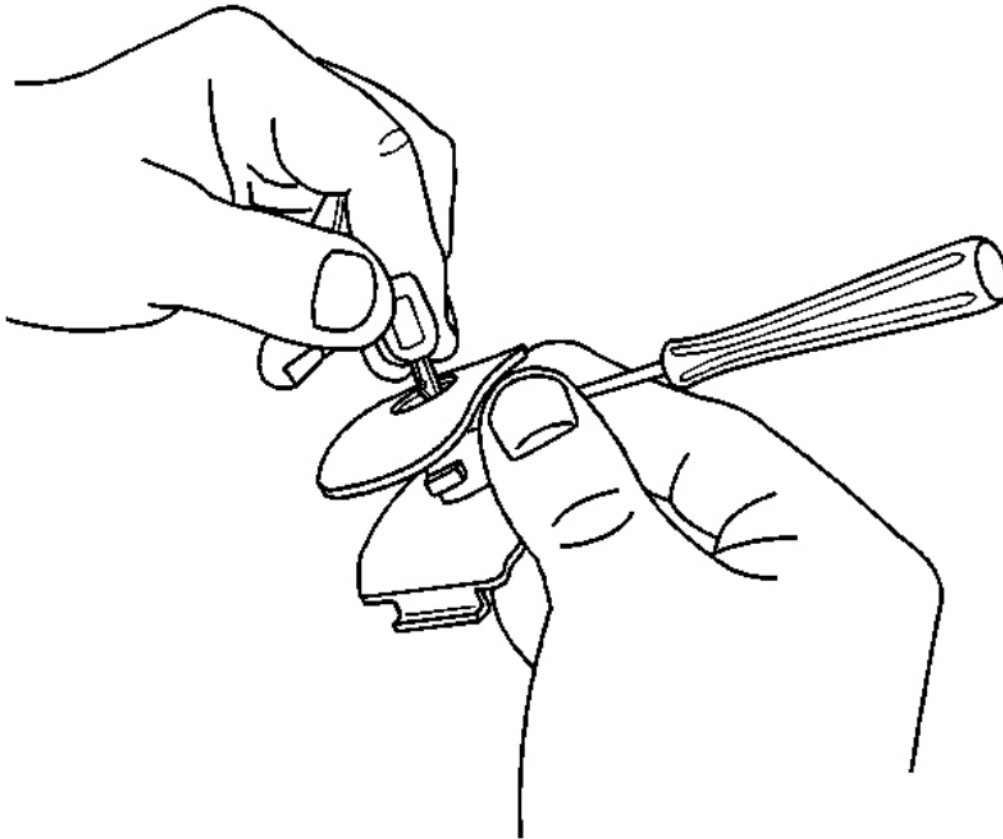


Fig. 29: Rotating Key To 5 O'Clock
Courtesy of GENERAL MOTORS CORP.

6. Rotate the key until the instrument panel compartment lock cylinder rotates to about the 5 o'clock position.

This will line up the notch at the rear of the instrument panel compartment lock cylinder with the tab in the instrument panel compartment latch housing.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

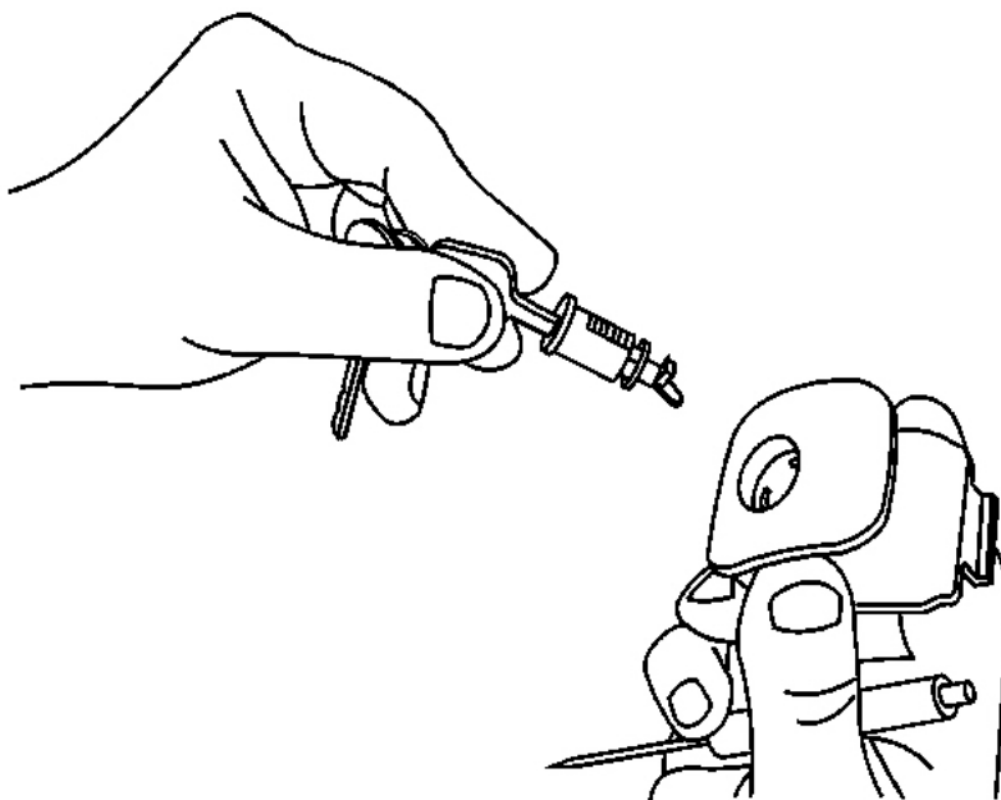


Fig. 30: Identifying I/P Compartment Door Lock Cylinder
Courtesy of GENERAL MOTORS CORP.

7. Remove the instrument panel compartment lock cylinder from the instrument panel compartment latch by pulling on the key.

Installation Procedure

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

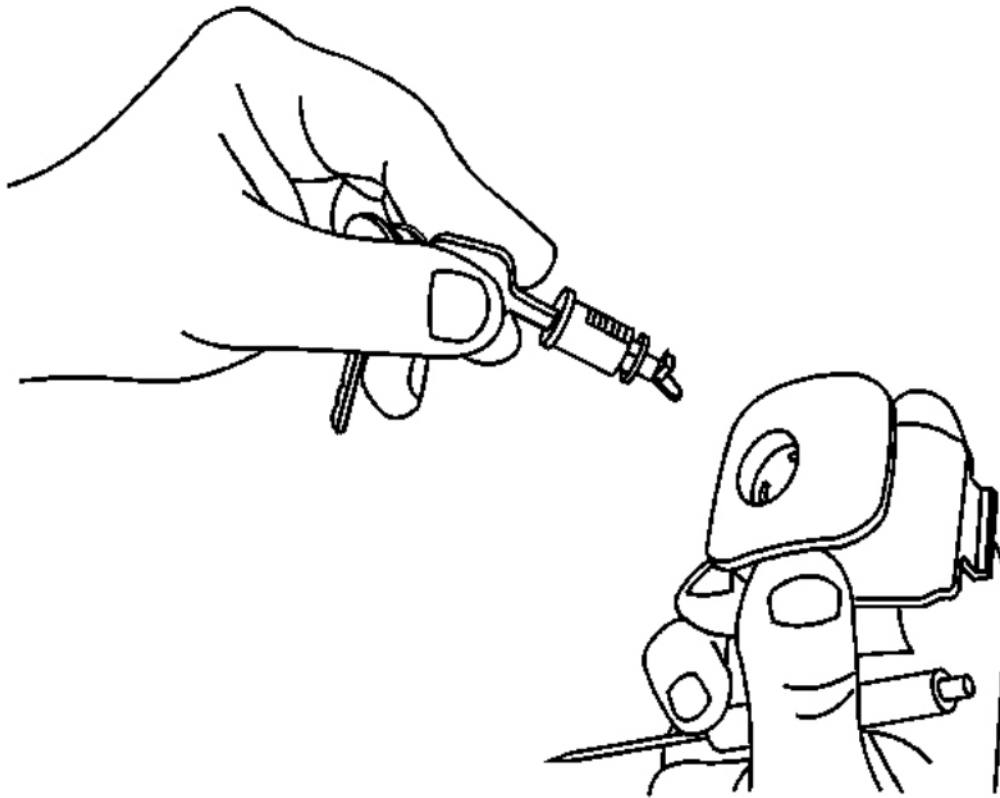


Fig. 31: Identifying I/P Compartment Door Lock Cylinder

Courtesy of GENERAL MOTORS CORP.

1. Position the instrument panel compartment latch fork bolt in the up position.
2. Grasp the instrument panel compartment lock cylinder. Depress the rear-most, light-colored tumbler that is flush with the instrument panel compartment lock cylinder surface.
3. Insert the key.

All the tumblers will now stay depressed.

4. Insert the instrument panel compartment lock cylinder, with the key inserted, into the instrument panel compartment latch housing. Ensure that the front projection pin is at the appropriate 8 o'clock position.

The instrument panel compartment lock cylinder will drop into place.

5. Rotate the key counterclockwise until the key stops.
6. Remove the key, the tumblers will now release.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

The instrument panel compartment lock cylinder is now locked into the instrument panel compartment latch housing.

7. Install the instrument panel compartment latch. Refer to **Instrument Panel Compartment Door Latch Replacement (Cadillac)** or **Instrument Panel Compartment Door Latch Replacement (Except Cadillac)**.

INSTRUMENT PANEL LOWER TRIM PANEL REPLACEMENT (CADILLAC)

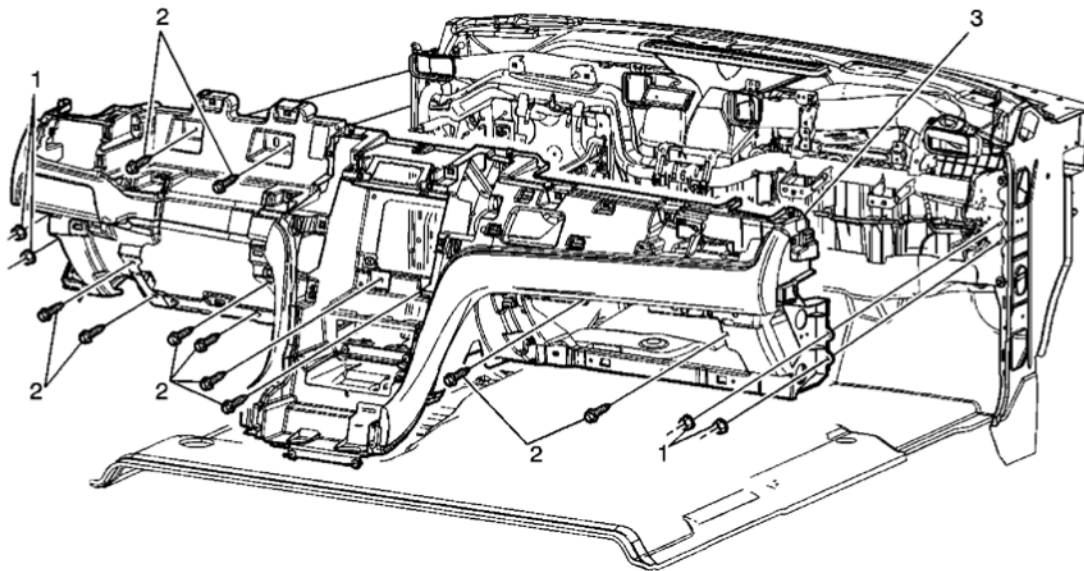


Fig. 32: View Of Instrument Panel Lower Trim Panel Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Lower Trim Panel Replacement (Cadillac)

Callout	Component Name
Preliminary Procedures	
1.	Disable the SIR system. Refer to <u>SIR Disabling and Enabling</u> .
2.	Remove the front floor console assembly. Refer to <u>Console Replacement - Front Floor (Cadillac)</u> or <u>Console Replacement - Front Floor (Except Cadillac)</u> .
3.	Remove the windshield pillar garnish moldings. Refer to <u>Garnish Molding Replacement - Windshield Pillar</u> .
4.	Remove the instrument panel upper trim panel with defroster nozzle. Refer to <u>Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Cadillac)</u> or <u>Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Except Cadillac)</u> .
5.	Remove the instrument panel upper trim panel. Refer to <u>Instrument Panel Upper Trim Panel Replacement (Cadillac)</u> or <u>Instrument Panel Upper Trim Panel Replacement (Except</u>

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

Cadillac).

6. Remove the instrument panel outer trim covers. Refer to Instrument Panel Outer Trim Cover Replacement (Cadillac) or Instrument Panel Outer Trim Cover Replacement (Except Cadillac).
7. Remove the left instrument panel deflector. Refer to Deflector Replacement - Instrument Panel Air - Left (Cadillac) or Deflector Replacement - Instrument Panel Air - Left (Except Cadillac).
8. Remove the headlamp switch bezel assembly. Refer to Headlamp Switch Bezel Replacement.
9. Remove the instrument panel cluster assembly. Refer to Instrument Cluster Replacement (Cadillac) or Instrument Cluster Replacement (Except Cadillac).
10. Remove the knee bolster assembly. Refer to Knee Bolster Replacement (Cadillac) or Knee Bolster Replacement (Except Cadillac).
11. Remove the steering column. Refer to Steering Column Replacement.
12. Remove the instrument panel center trim panel. Refer to Trim Panel Replacement - Instrument Panel (I/P) Center (Cadillac) or Trim Panel Replacement - Instrument Panel (I/P) Center (Except Cadillac).
13. Remove the instrument panel accessory trim panel. Refer to Instrument Panel Accessory Trim Plate Replacement (Cadillac) or Instrument Panel Accessory Trim Plate Replacement (Except Cadillac).
14. Remove the instrument panel clock assembly. Refer to Clock Replacement.
15. Remove the instrument panel accessory switch assembly. Refer to Accessory Switch Replacement (Cadillac) or Accessory Switch Replacement (Except Cadillac).
16. Remove the HVAC control module. Refer to HVAC Control Module Replacement.
17. Remove the radio. Refer to Radio Replacement (Cadillac) or Radio Replacement (Except Cadillac).
18. Remove the instrument panel compartment door. Refer to Instrument Panel Compartment Door Replacement (Cadillac) or Instrument Panel Compartment Door Replacement (Except Cadillac).
19. Remove the instrument panel access hole cover panel. Refer to Instrument Panel Compartment Access Hole Cover Replacement (Cadillac) or Instrument Panel Compartment Access Hole Cover Replacement (Except Cadillac).

1

Instrument Panel Lower Trim Panel Nuts (Qty: 4)

NOTE:

Refer to Fastener Notice.

Tighten: 9 N.m (80 lb in)

2

Instrument Panel Lower Trim Panel Bolts/Screws (Qty: 10)

Tighten: 2 N.m (18 lb in)

Instrument Panel Lower Trim Panel Assembly

Tip:

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

3

1. Prior to removing the trim panel from the carrier support assembly, note the routing of the wiring to aid in the reassembly.
2. Disconnect all electrical connections.
3. With the aid of an assistant, remove the trim panel from the vehicle.

INSTRUMENT PANEL UPPER TRIM PANEL WITH WINDSHIELD DEFROSTER NOZZLE GRILLE REPLACEMENT (CADILLAC)

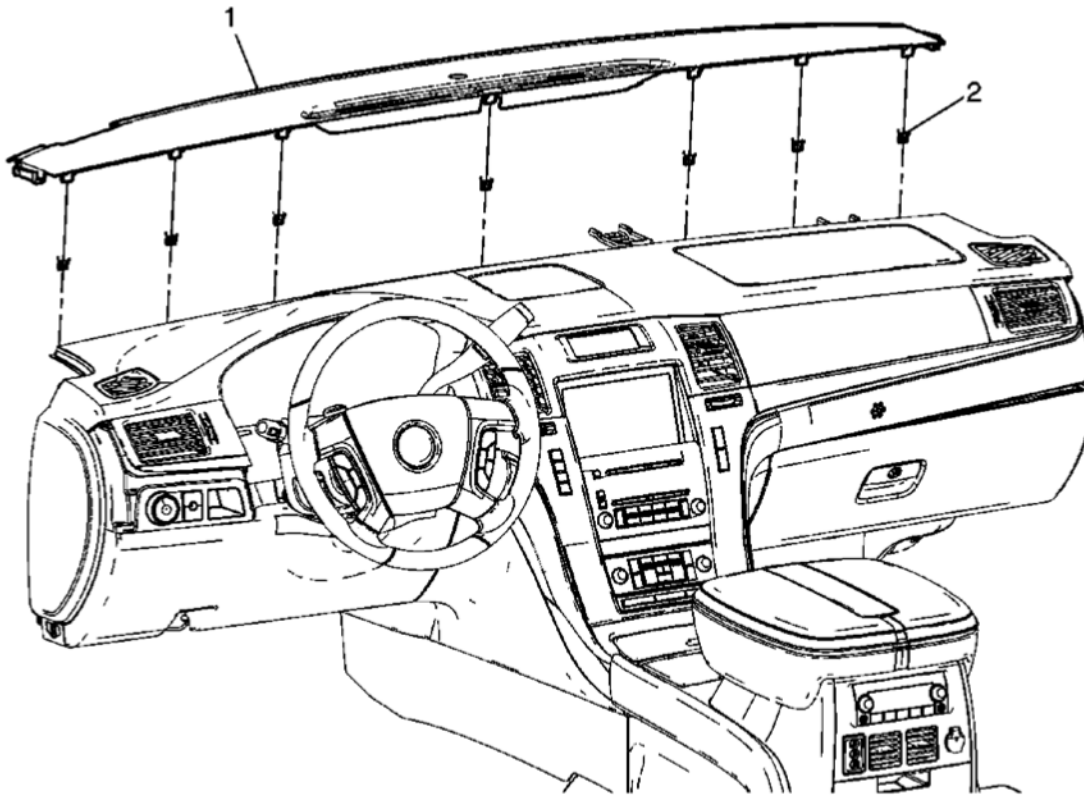


Fig. 33: View Of Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the windshield garnish moldings. Refer to <u>Garnish Molding Replacement - Windshield Pillar</u> .	
1	Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Tip: Disconnect the electrical connections.
2	Retainer Clips (Qty: 7)

INSTRUMENT PANEL UPPER TRIM PANEL WITH WINDSHIELD DEFROSTER NOZZLE

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

GRILLE REPLACEMENT (EXCEPT CADILLAC)

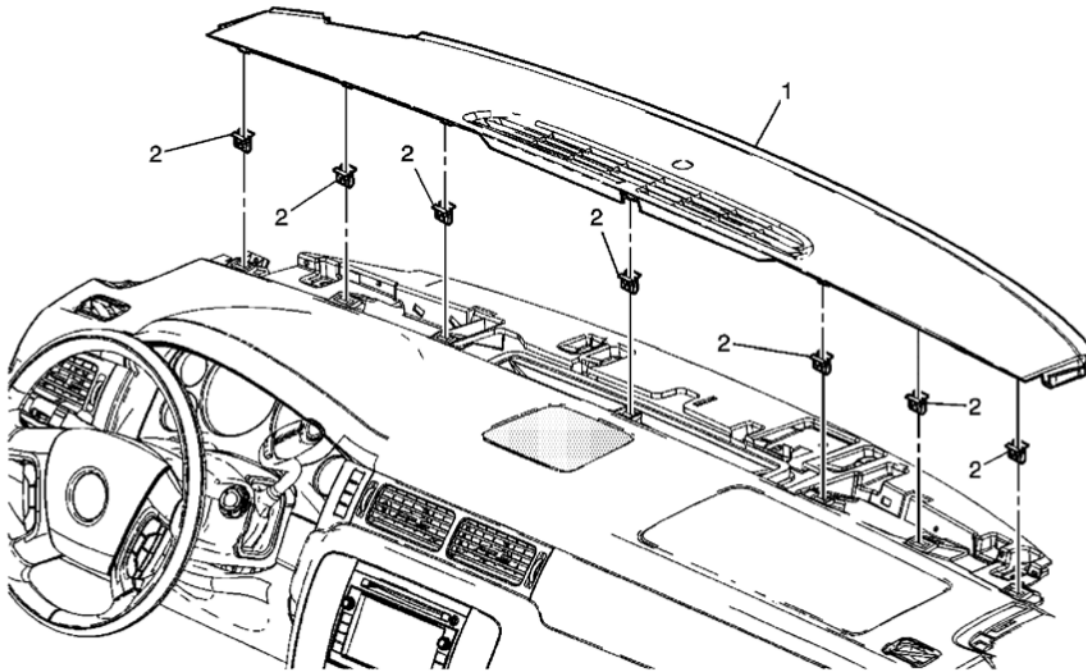


Fig. 34: View Of Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle & Clips
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Upper Trim Panel with Windshield Defroster Nozzle Grille Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the windshield garnish moldings. Refer to <u>Garnish Molding Replacement - Windshield Pillar</u> .	
1	Instrument Panel Upper Trim Panel Tip: Disconnect the electrical connections.
2	Retainer Clips (Qty: 7)

INSTRUMENT PANEL CARRIER REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

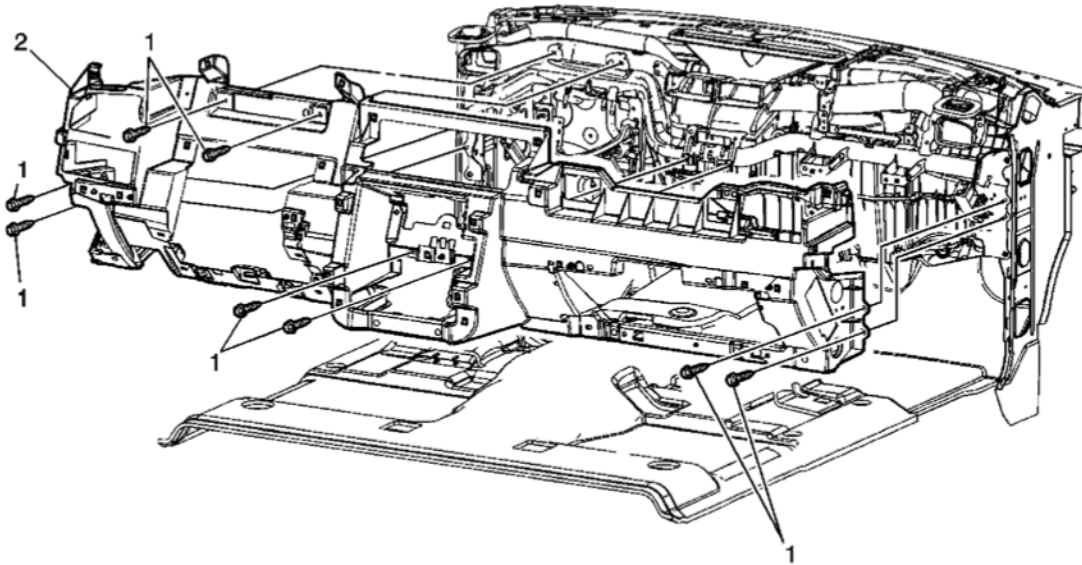


Fig. 35: View Of Instrument Panel Carrier Assembly & Bolts
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Carrier Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the instrument panel compartment assembly (I/P lower trim panel). Refer to <u>Instrument Panel Compartment Door Assembly Replacement (Except Cadillac)</u> .	
1	Instrument Panel Carrier Assembly Bolts (Qty: 8) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 9 N.m (80 lb in)
2	Instrument Panel Carrier Assembly

INSTRUMENT PANEL CARRIER SUPPORT REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

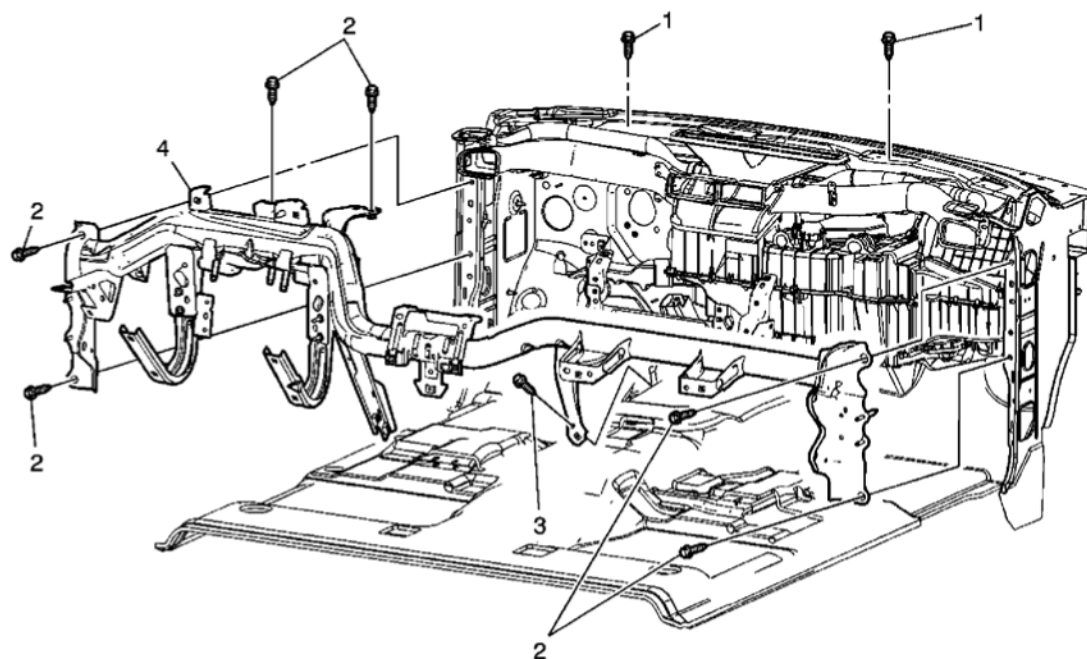


Fig. 36: View Of Instrument Panel Carrier Support Assembly & Bolts
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Carrier Support Replacement (Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the instrument panel lower trim panel assembly. Refer to <u>Instrument Panel Lower Trim Panel Replacement (Cadillac)</u> .	
1	Instrument Panel Carrier Support Assembly Bolt (Qty: 1) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Carrier Support Assembly Bolts (Qty: 4) Tighten: 22 N.m (16 lb ft)
3	Instrument Panel Carrier Support Assembly. Refer to <u>Instrument Panel Upper Trim Panel Replacement (Cadillac)</u> or <u>Instrument Panel Upper Trim Panel Replacement (Except Cadillac)</u> .

INSTRUMENT PANEL CARRIER SUPPORT REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

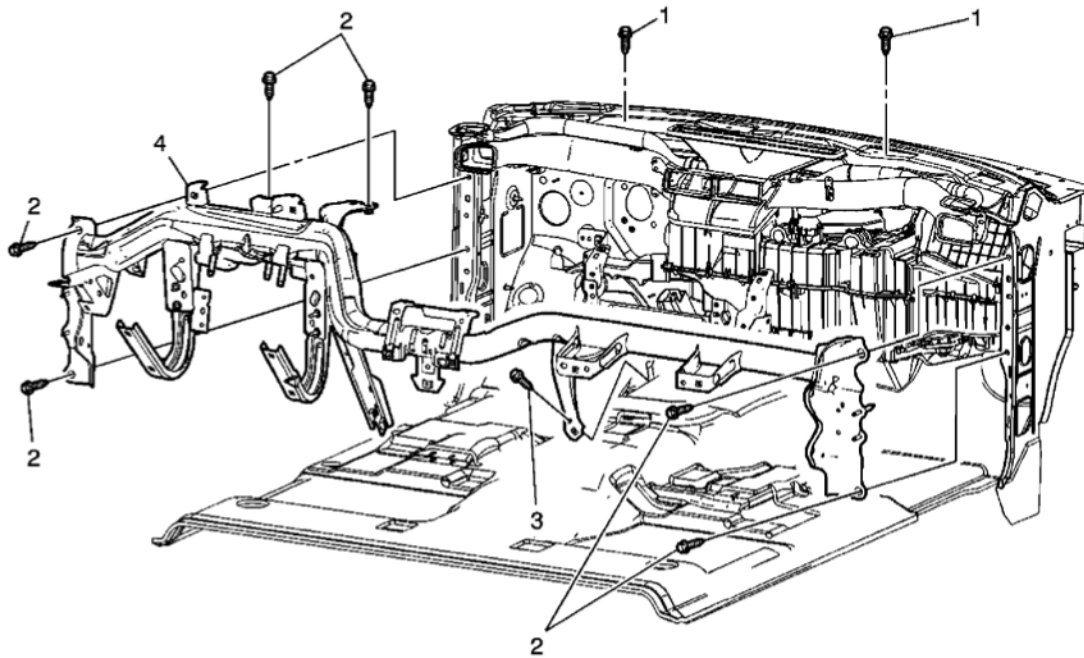


Fig. 37: View Of Instrument Panel Carrier Support Assembly & Bolts
Courtesy of GENERAL MOTORS CORP.

Instrument Panel Carrier Support Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the instrument panel carrier assembly. Refer to <u>Instrument Panel Carrier Replacement (Except Cadillac)</u> .	
1	Instrument Panel Carrier Assembly Bolt (Qty: 1) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Instrument Panel Carrier Assembly Bolts (Qty: 4) Tighten: 22 N.m (16 lb ft)
3	Instrument Panel Carrier Support Assembly Refer to <u>Instrument Panel Upper Trim Panel Replacement (Cadillac)</u> or <u>Instrument Panel Upper Trim Panel Replacement (Except Cadillac)</u> .

FRONT FLOOR CONSOLE COMPARTMENT BEZEL REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

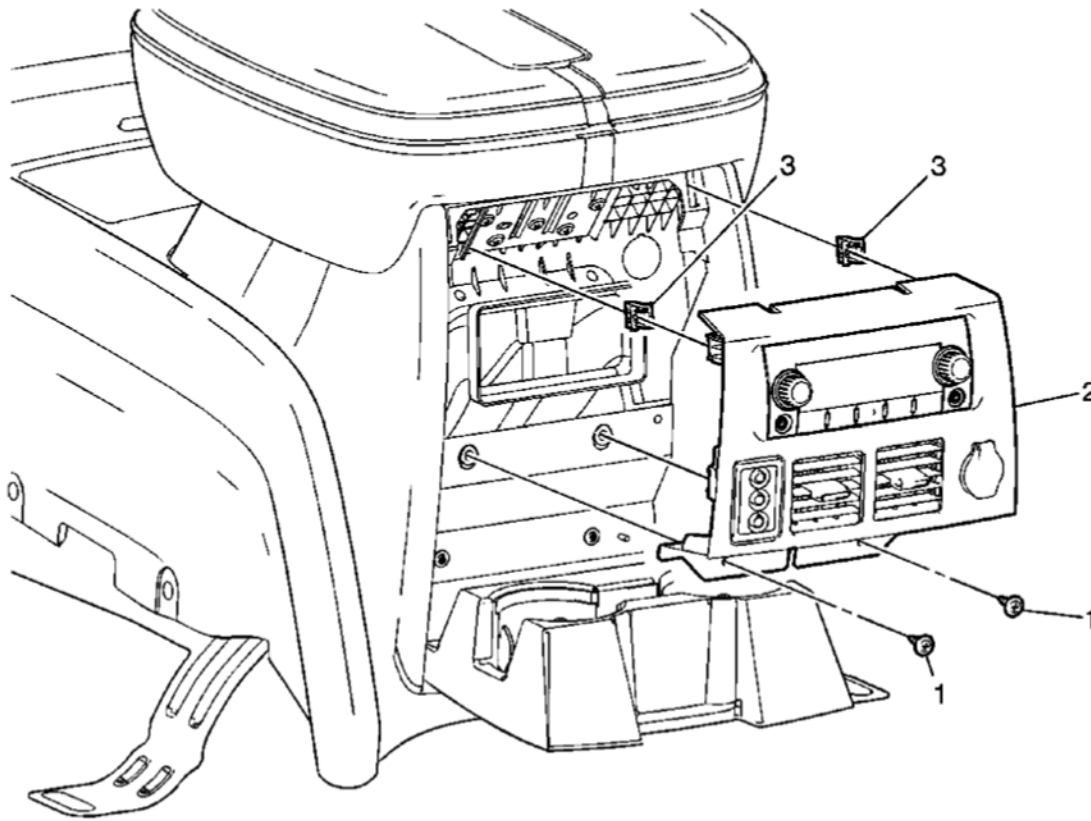


Fig. 38: View Of Heater & A/C Controller Opening Cover Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Compartment Bezel Replacement (Cadillac)

Callout	Component Name
1	Heater and A/C Controller Opening Cover Assembly Screws NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Heater and A/C Controller Opening Cover Assembly Tip: 1. Release the retainer clips at the top edge. 2. Lift the heater and A/C controller opening cover upward removing the lower tab from behind the console trim. 3. Disconnect the electrical connections. 4. If replacing the trim cover, transfer all necessary components.
3	Retainer Clips (Qty: 4)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

FRONT FLOOR CONSOLE COMPARTMENT BEZEL REPLACEMENT (EXCEPT CADILLAC)

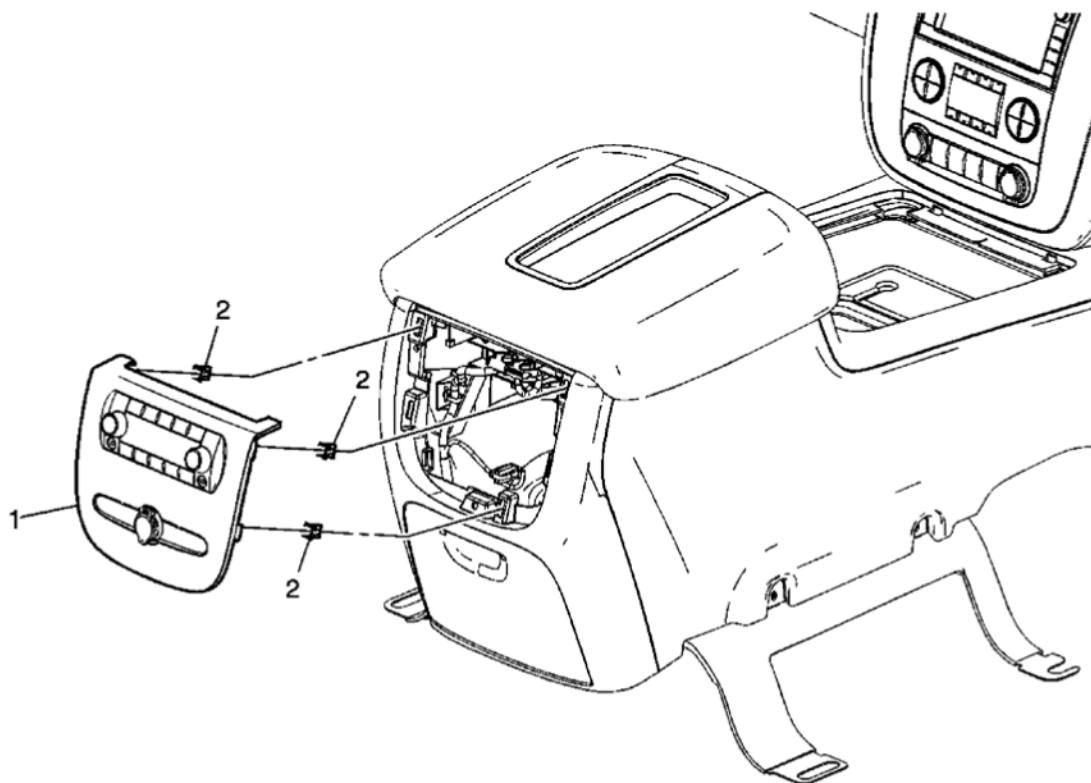


Fig. 39: View Of Front Floor Console Compartment Bezel Assembly & Clips
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Compartment Bezel Replacement (Except Cadillac)

Callout	Component Name
1	Front Floor Console Compartment Bezel Assembly Tip: Disconnect the electrical connections.
2	Retainer Clips (Qty: 4)

LATCH REPLACEMENT - CONSOLE COMPARTMENT DOOR (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

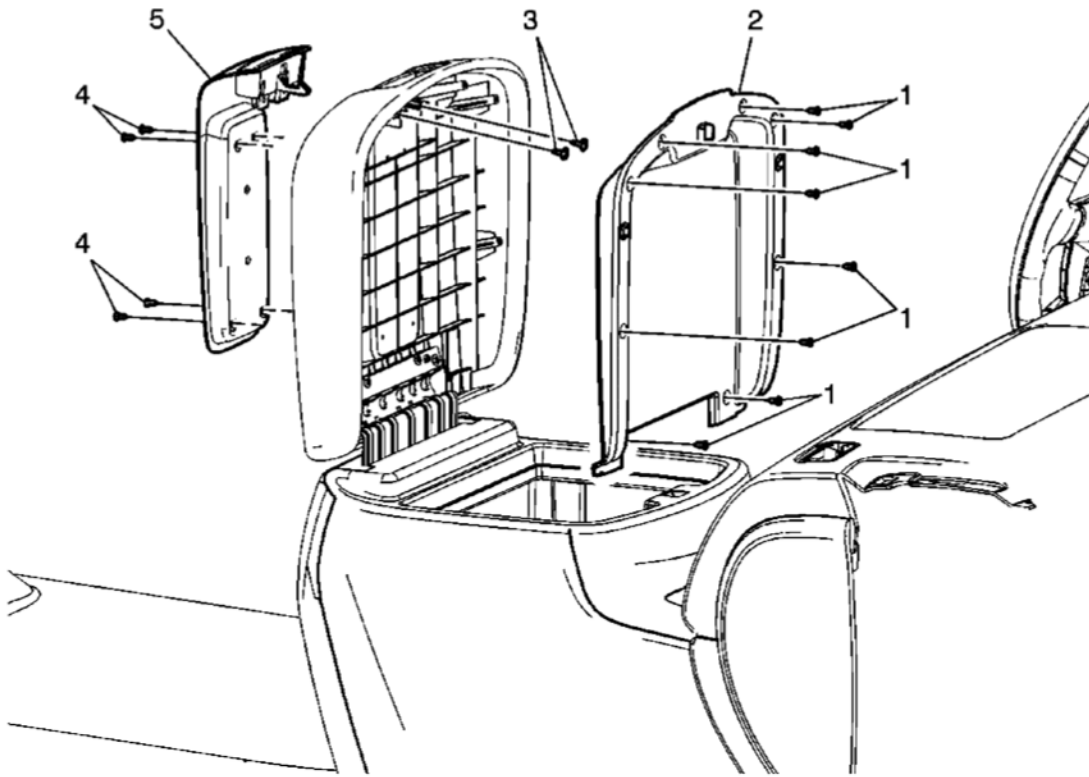


Fig. 40: View Of Front Floor Console Cover Latch Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Latch Replacement - Console Compartment Door (Except Cadillac)

Callout	Component Name
1	Front Floor Console Inner Cover Panel Screws (Qty: 8) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Inner Panel
3	Front Floor Console Latch Inner Screws (Qty: 2) Tighten: 2 N.m (18 lb in)
4	Front Floor Console Latch Outer Screws (Qty: 2) Tighten: 2 N.m (18 lb in)
5	Front Floor Console Cover Latch Assembly

FRONT FLOOR CONSOLE SIDE TRIM PANEL REPLACEMENT - RIGHT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

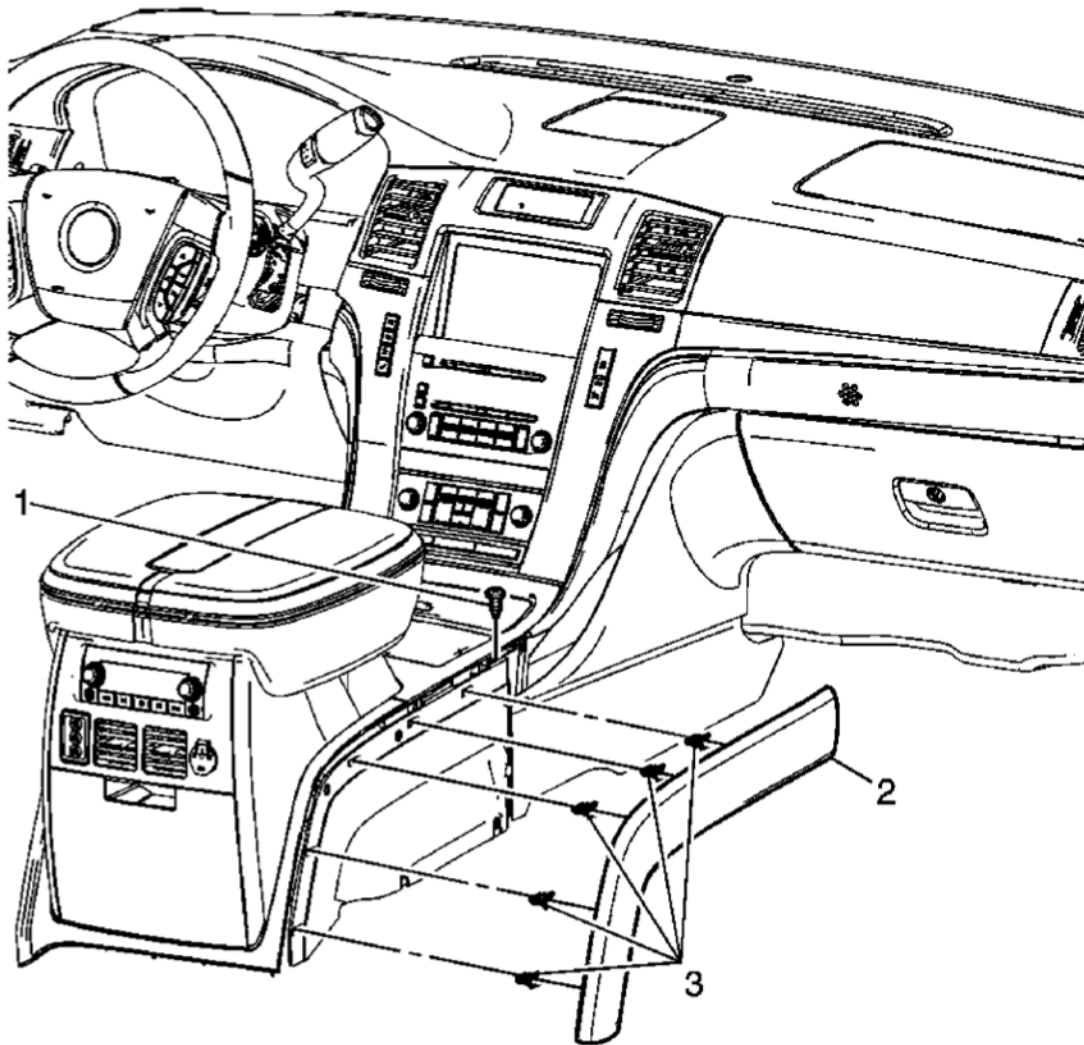


Fig. 41: View Of Front Floor Console Side Trim Panel & Components
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Side Trim Panel Replacement - Right (Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the front floor console bezel. Refer to <u>Floor Console Bezel Replacement (Cadillac)</u> or <u>Floor Console Bezel Replacement (Except Cadillac)</u> .	
1	Front Floor Console Side Trim Panel Screw NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Side Trim Panel

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

3 Retainer Clips (Qty: 5)

FRONT FLOOR CONSOLE SIDE TRIM PANEL REPLACEMENT - RIGHT (EXCEPT CADILLAC)

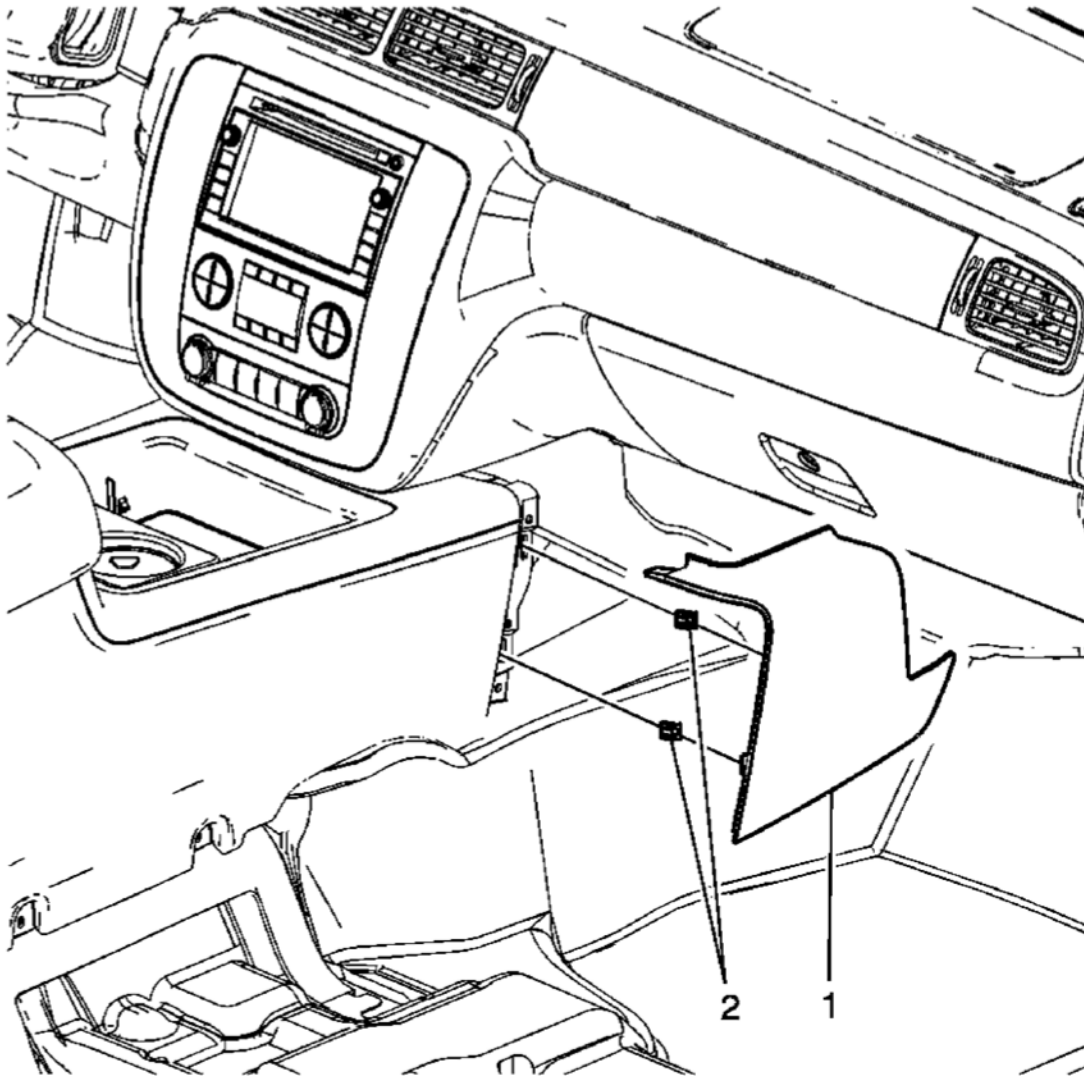


Fig. 42: View Of Console Side Trim Panel & Clips
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Side Trim Panel Replacement - Right (Except Cadillac)

Callout	Component Name
1	Console Side Trim Panel
2	Retainer Clips (Qty: 2)

FRONT FLOOR CONSOLE SIDE TRIM PANEL REPLACEMENT - LEFT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

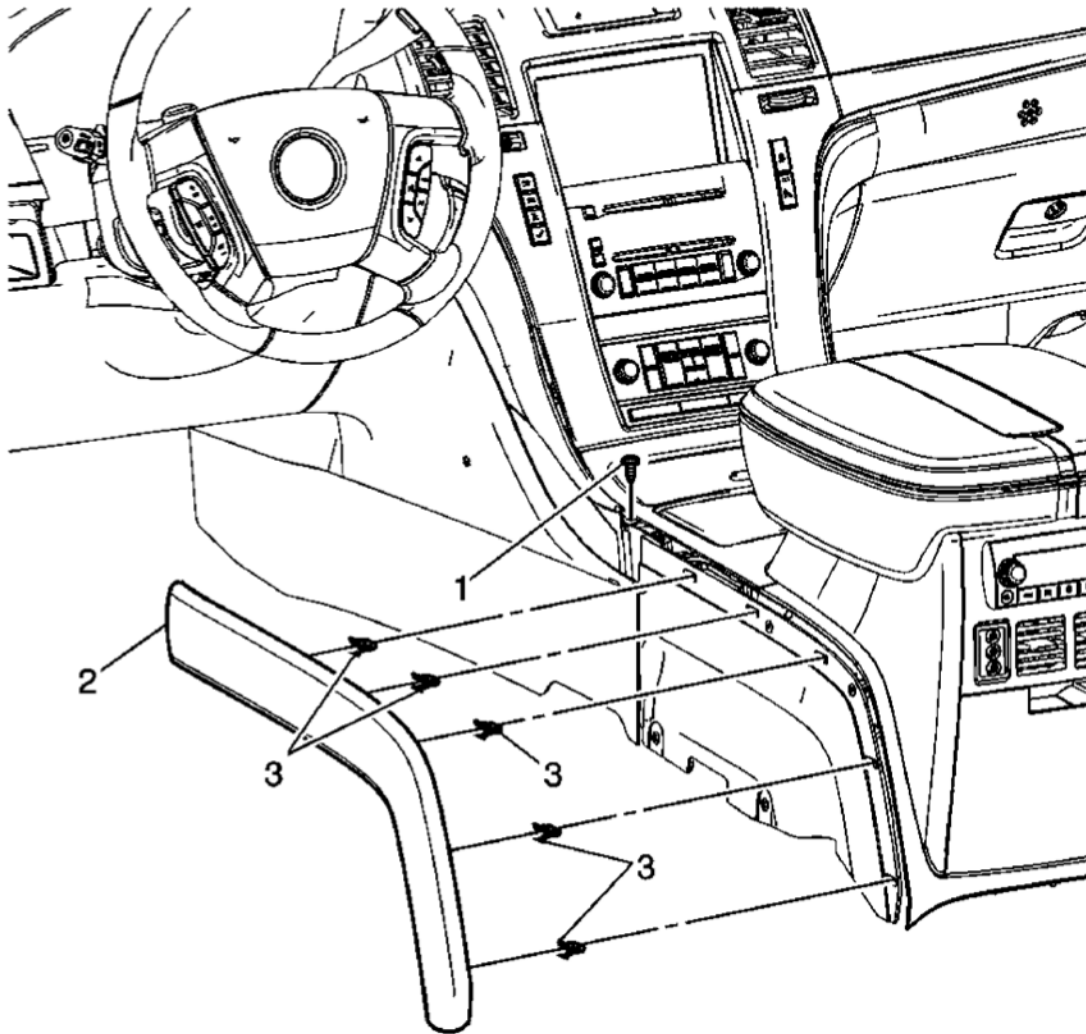


Fig. 43: View Of Console Side Trim Panel & Components
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Side Trim Panel Replacement - Left (Cadillac)

Callout	Component Name
Preliminary Procedure: Remove the front floor console bezel. Refer to <u>Floor Console Bezel Replacement (Cadillac)</u> or <u>Floor Console Bezel Replacement (Except Cadillac)</u> .	
1	Front Floor Console Side Trim Panel Screw NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Side Trim Panel

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

3 Retainer Clips (Qty: 5)

FRONT FLOOR CONSOLE SIDE TRIM PANEL REPLACEMENT - LEFT (EXCEPT CADILLAC)

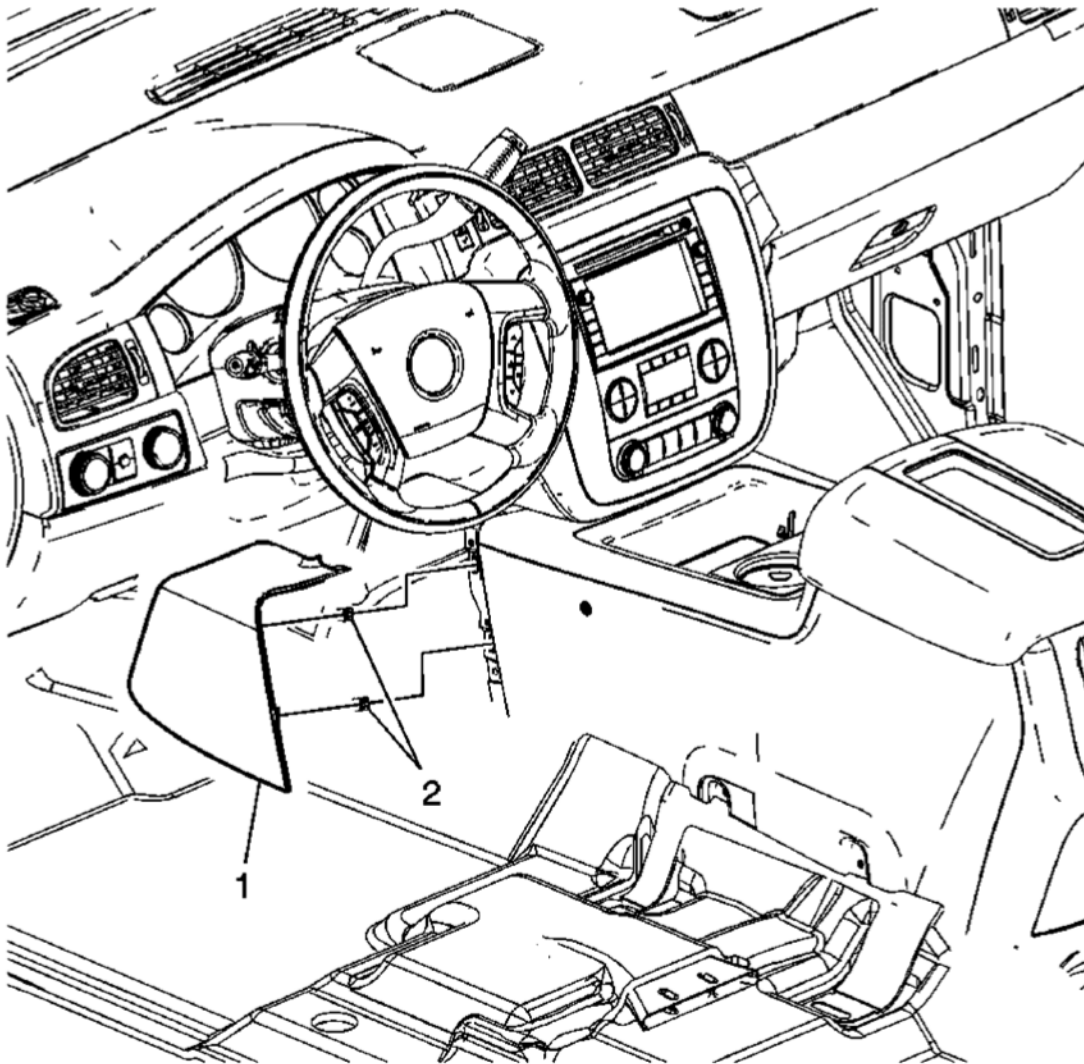


Fig. 44: View Of Console Side Trim Panel & Clips
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Side Trim Panel Replacement - Left (Except Cadillac)

Callout	Component Name
1	Console Side Trim Panel
2	Retainer Clips (Qty: 3)

FLOOR CONSOLE BEZEL REPLACEMENT (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

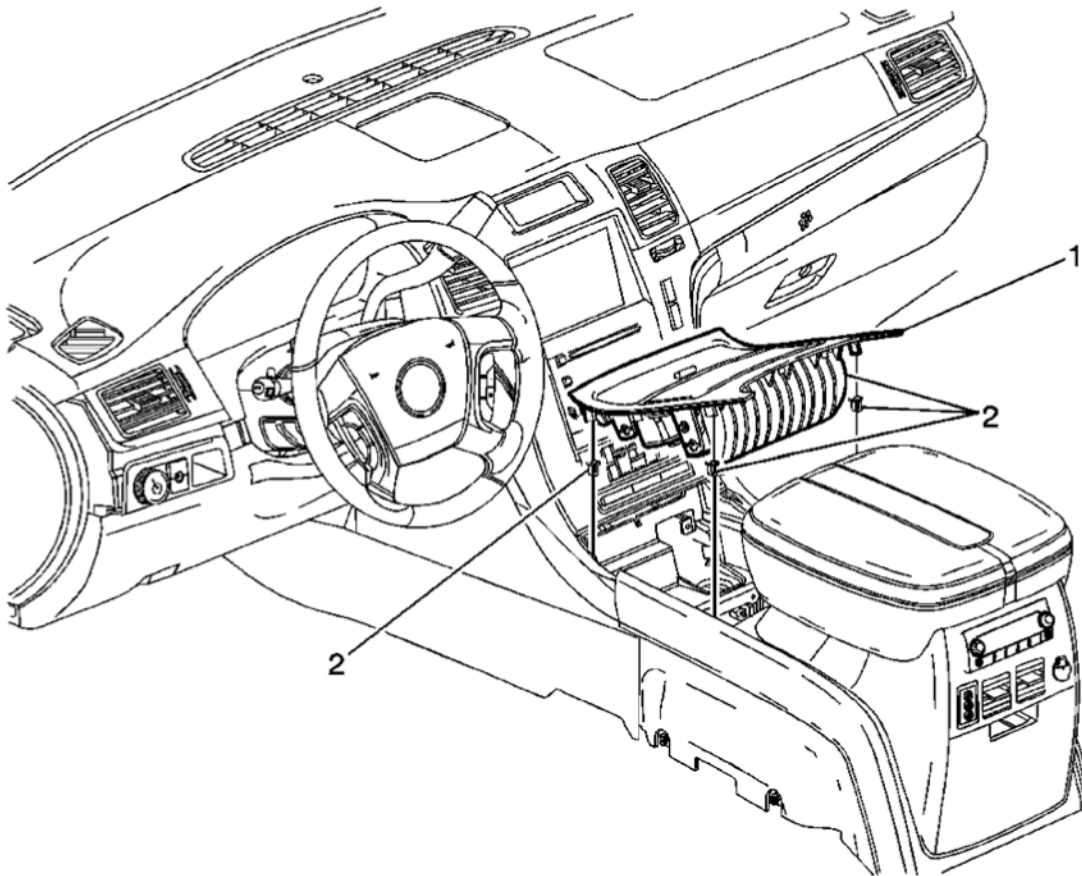


Fig. 45: View Of Front Floor Console Bezel Assembly & Clips
Courtesy of GENERAL MOTORS CORP.

Floor Console Bezel Replacement (Cadillac)

Callout	Component Name
NOTE: To prevent component damage, DO NOT use metal tools to remove the trim.	
1	Front Floor Console Bezel Assembly Tip: 1. Use a flat-bladed plastic trim tool to carefully release the retainer clips along the rear edge of the bezel. 2. Disconnect the electrical connections. 3. Lift the bezel out of the console assembly.
2	Retainer Clips (Qty: 4)

FLOOR CONSOLE BEZEL REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

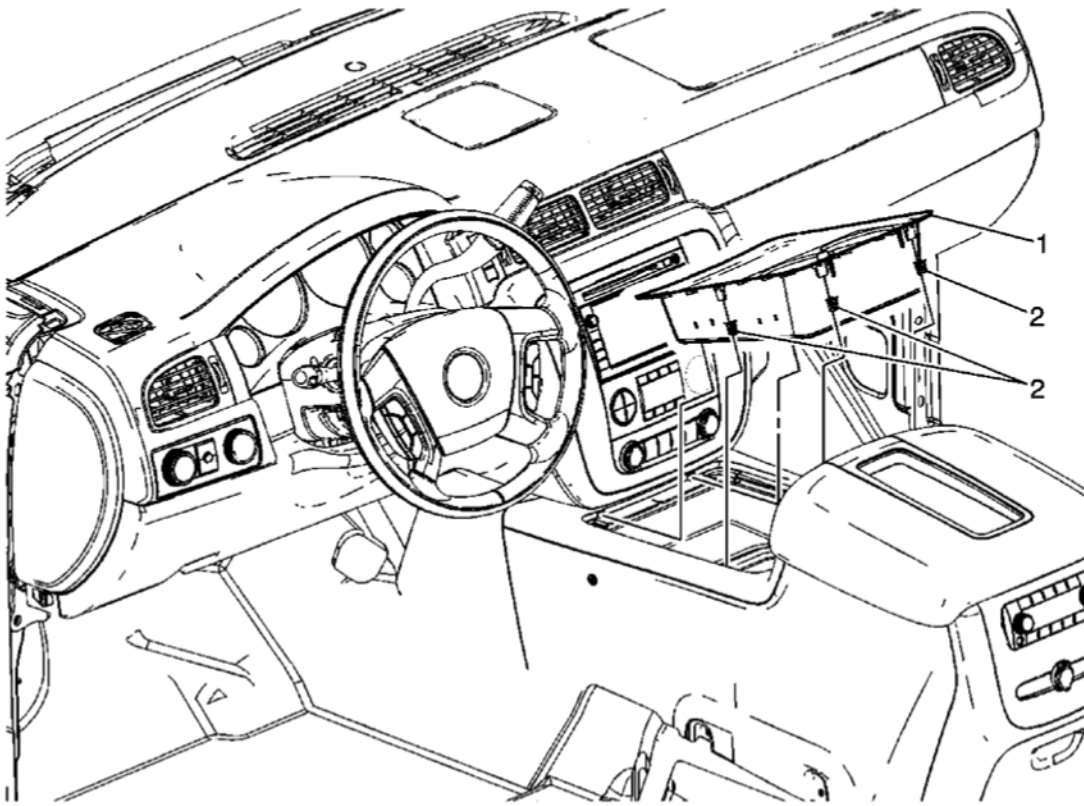


Fig. 46: View Of Front Floor Console Bezel Assembly & Clips
Courtesy of GENERAL MOTORS CORP.

Floor Console Bezel Replacement (Except Cadillac)

Callout	Component Name
1	Front Floor Console Bezel Assembly Tip: 1. Use a flat-bladed plastic trim tool to release the retainer clips along the rear edge of the bezel. 2. Lift the bezel out of the console assembly.
2	Retainer Clips (Qty: 4)

FRONT FLOOR CONSOLE COMPARTMENT REPLACEMENT (EXCEPT CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

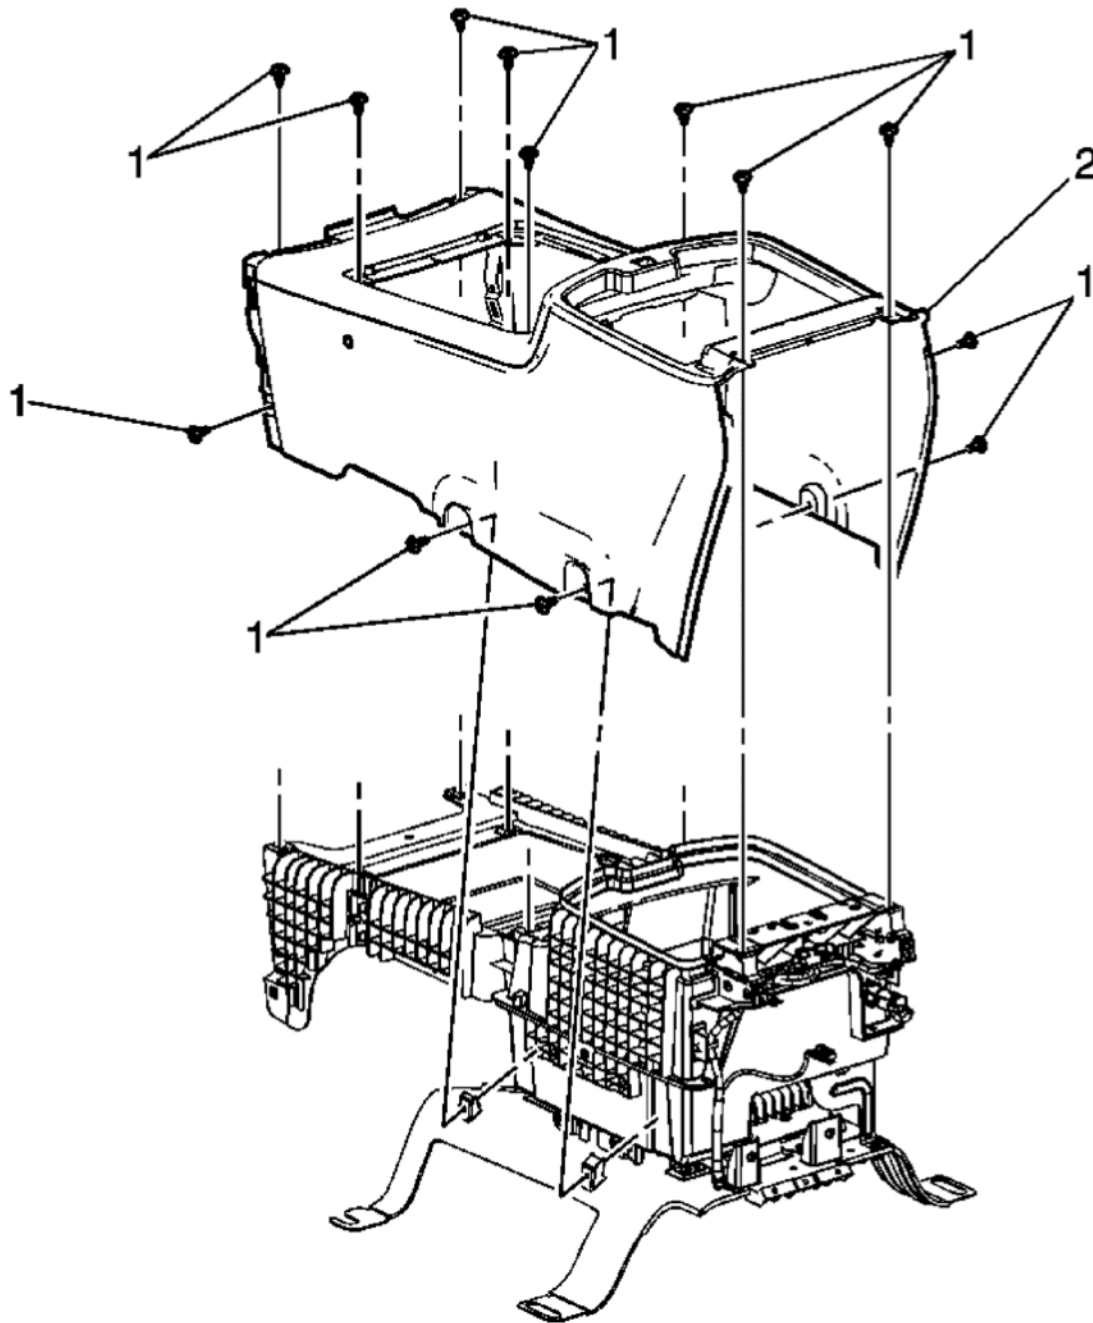


Fig. 47: View Of Front Floor Console Compartment Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Front Floor Console Compartment Replacement (Except Cadillac)

Callout	Component Name
Preliminary Procedures	

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1. Remove the front floor console. Refer to **Console Replacement - Front Floor (Cadillac)** or **Console Replacement - Front Floor (Except Cadillac)**.
2. Remove the front floor console cover assembly. Refer to **Cover Replacement - Floor Console - Rear (Cadillac)** or **Cover Replacement - Floor Console - Rear (Except Cadillac)**.
3. Remove the front floor console end panel. Refer to **Center Console End Panel Replacement**.

1	Front Floor Console Compartment Screws (Qty: 14) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Compartment Assembly

CONSOLE REPLACEMENT - FRONT FLOOR (CADILLAC)

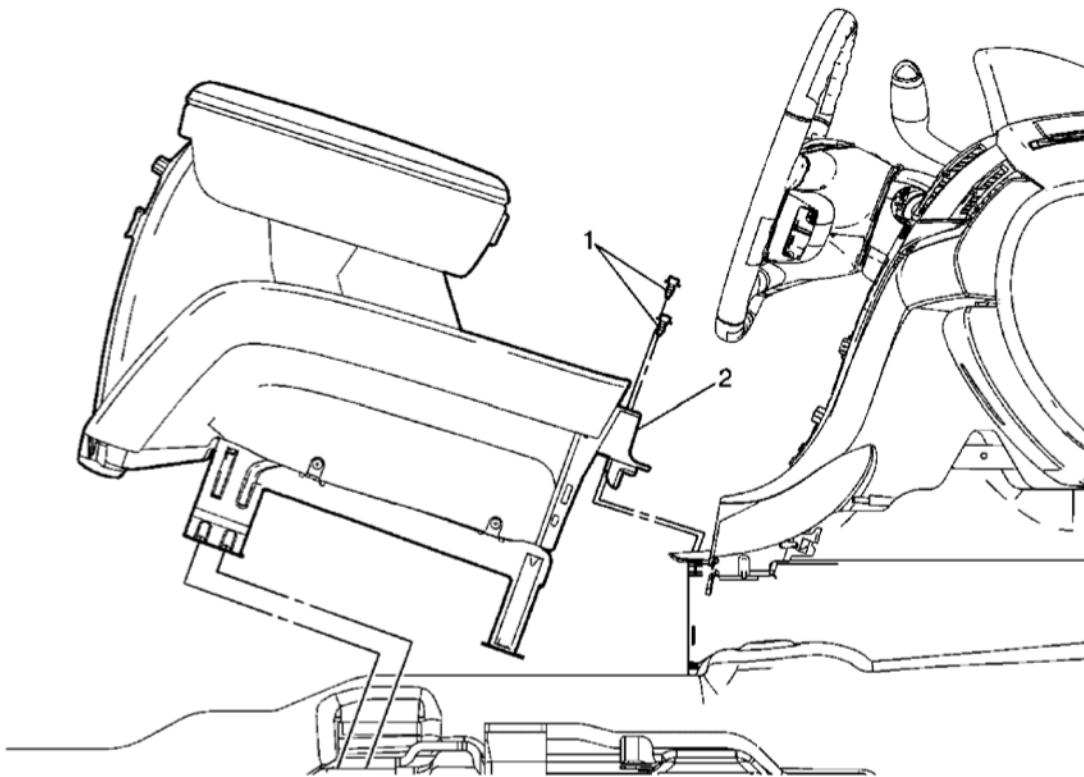


Fig. 48: View Of Front Floor Console Assembly & Bolts
Courtesy of GENERAL MOTORS CORP.

Console Replacement - Front Floor (Cadillac)

Callout	Component Name
Preliminary Procedures	

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1. Remove the 2 front seats. Refer to **Front Seat Replacement - Bucket**.
2. Remove the right and left instrument panel lower trim panels. Refer to **Trim Replacement - Instrument Panel (I/P) Lower Center (Cadillac)**.
3. Remove the front floor console bezel. Refer to **Floor Console Bezel Replacement (Cadillac)** or **Floor Console Bezel Replacement (Except Cadillac)**.

1	Front Floor Console Assembly Bolts/Screws NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Assembly Tip: 1. Disconnect the electrical connectors to the console assembly. 2. With the aid of an assistant, remove the console from the vehicle. 3. If replacing the console assembly, transfer all necessary components.

CONSOLE REPLACEMENT - FRONT FLOOR (EXCEPT CADILLAC)

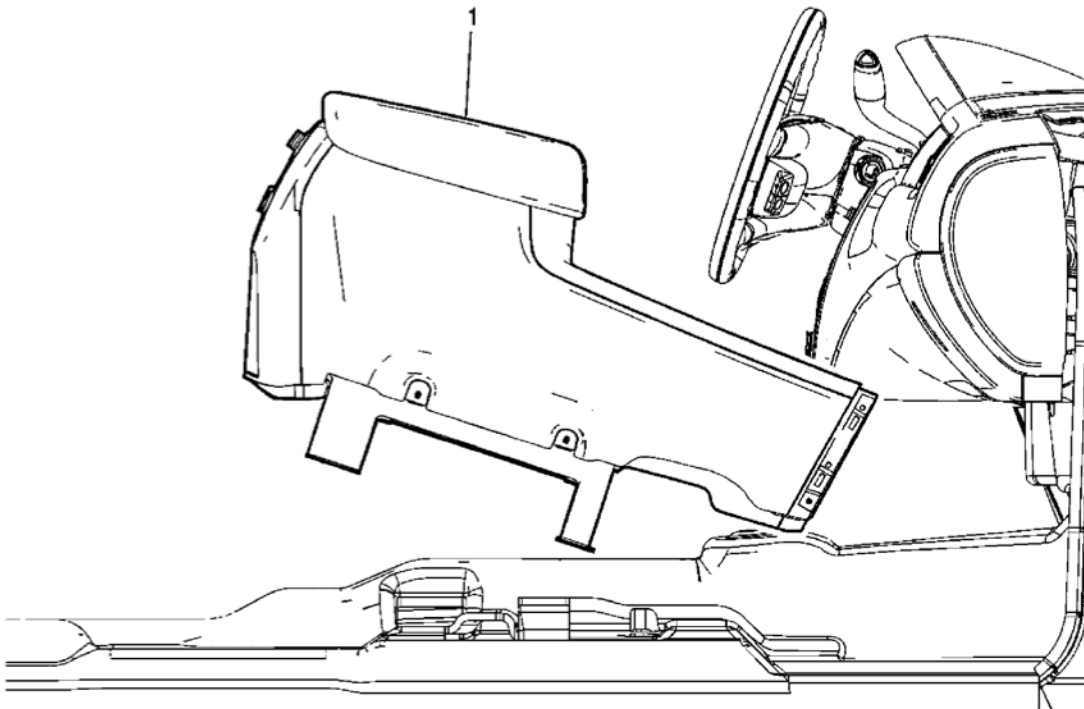


Fig. 49: View Of Front Floor Console Assembly
Courtesy of GENERAL MOTORS CORP.

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

Console Replacement - Front Floor (Except Cadillac)

Callout	Component Name
Preliminary Procedures	
1. Remove the 2 front seats. Refer to <u>Front Seat Replacement - Bucket</u> . 2. Remove the right and left front floor console trim panels. Refer to <u>Front Floor Console Side Trim Panel Replacement - Right (Cadillac)</u> or <u>Front Floor Console Side Trim Panel Replacement - Right (Except Cadillac)</u> and <u>Front Floor Console Side Trim Panel Replacement - Left (Cadillac)</u> or <u>Front Floor Console Side Trim Panel Replacement - Left (Except Cadillac)</u>. 3. Remove the front floor console bezel. Refer to <u>Floor Console Bezel Replacement (Cadillac)</u> or <u>Floor Console Bezel Replacement (Except Cadillac)</u>. 4. Disconnect the electrical connectors to the console assembly.	
1	Front Floor Console Assembly Tip: 1. With the aid of an assistant, remove the console from the vehicle. 2. When replacing the console assembly, transfer all the necessary components.

HINGE REPLACEMENT - FLOOR CONSOLE ARM REST

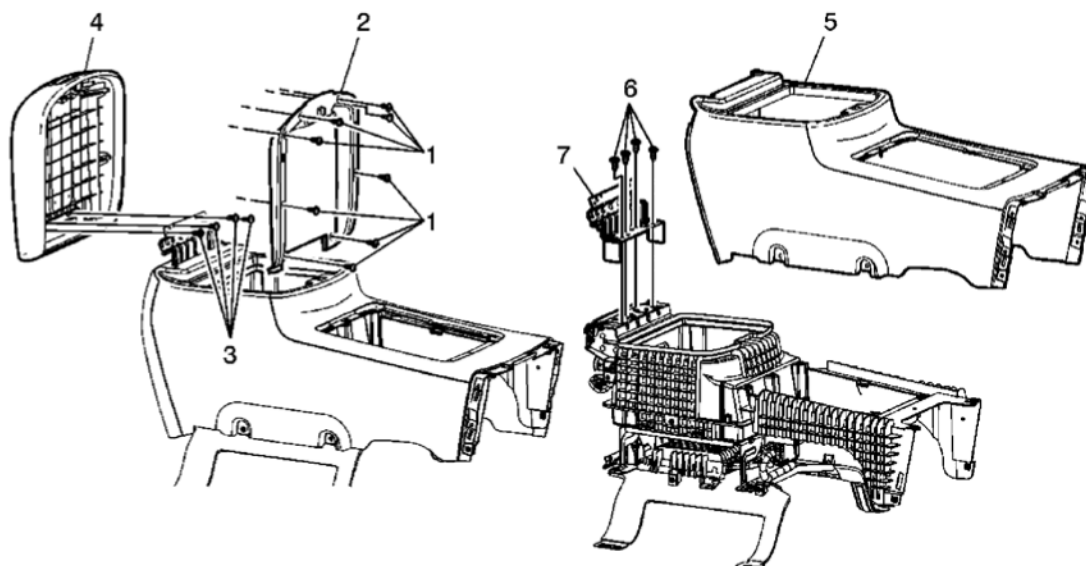


Fig. 50: View Of Front Floor Console Armrest Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Hinge Replacement - Floor Console Arm Rest

Callout	Component Name
Preliminary Procedure: Remove the Console Assembly. Refer to Console Replacement - Front Floor (Cadillac) or Console	


2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

Replacement - Front Floor (Except Cadillac).

1	Front Floor Console Armrest Inner Panel Screws (Qty: 8) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console Armrest Inner Panel
3	Front Floor Console Armrest to Hinge Screws (Qty: 4) Tighten: 2 N.m (18 lb in)
4	Front Floor Console Armrest Assembly
5	Front Floor Console Compartment Assembly Refer to <u>Front Floor Console Compartment Replacement (Except Cadillac)</u> .
6	Front Floor Console Armrest Hinge to Console Retainer Screws (Qty: 4) Tighten: 2 N.m (18 lb in)
7	Front Floor Console Armrest Hinge Assembly

CENTER CONSOLE END PANEL REPLACEMENT

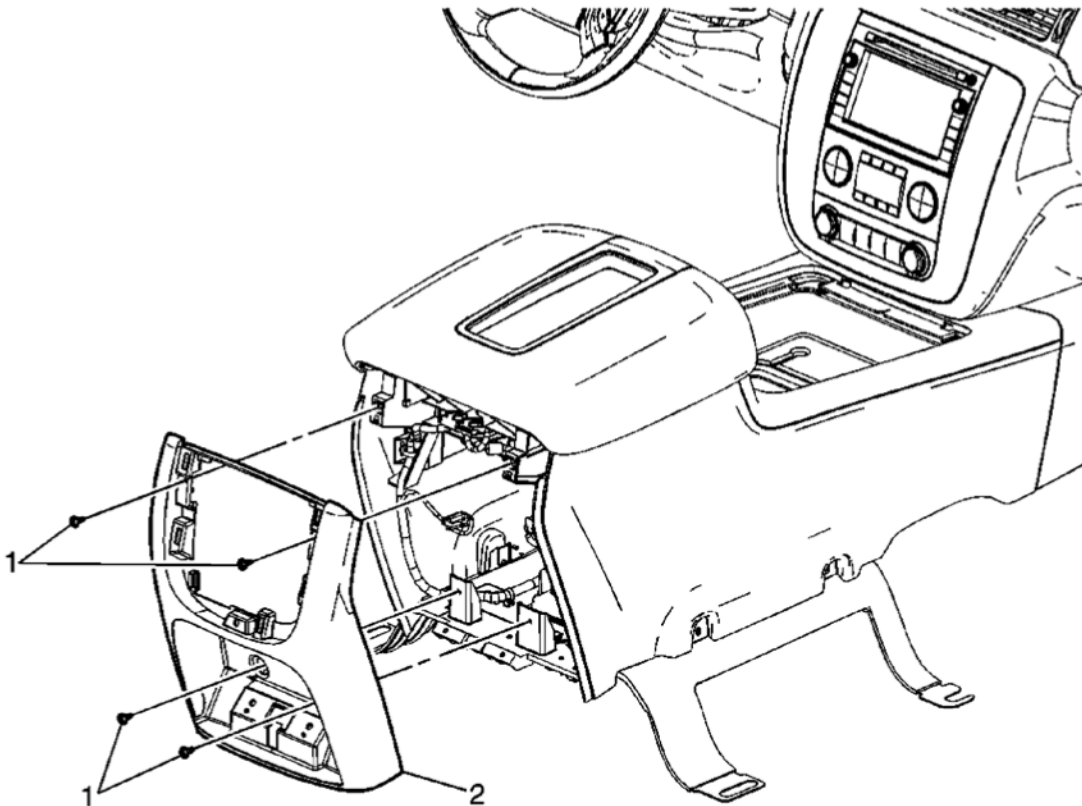

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

Fig. 51: View Of Front Floor Console End Cap Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Center Console End Panel Replacement

Callout	Component Name
Preliminary Procedures	
1. Remove the front floor console compartment bezel. Refer to <u>Front Floor Console Compartment Bezel Replacement (Cadillac)</u> or <u>Front Floor Console Compartment Bezel Replacement (Except Cadillac)</u>. 2. Remove the front floor console rear cupholder. Refer to <u>Cup Holder Replacement - Front Floor Console - Rear (Cadillac)</u> or <u>Cup Holder Replacement - Front Floor Console - Rear (Except Cadillac)</u> .	
1	Front Floor Console End Cap Screws (Qty: 4) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
2	Front Floor Console End Cap Assembly Tip: Disconnect the electrical connections.

COVER REPLACEMENT - FLOOR CONSOLE - REAR (CADILLAC)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

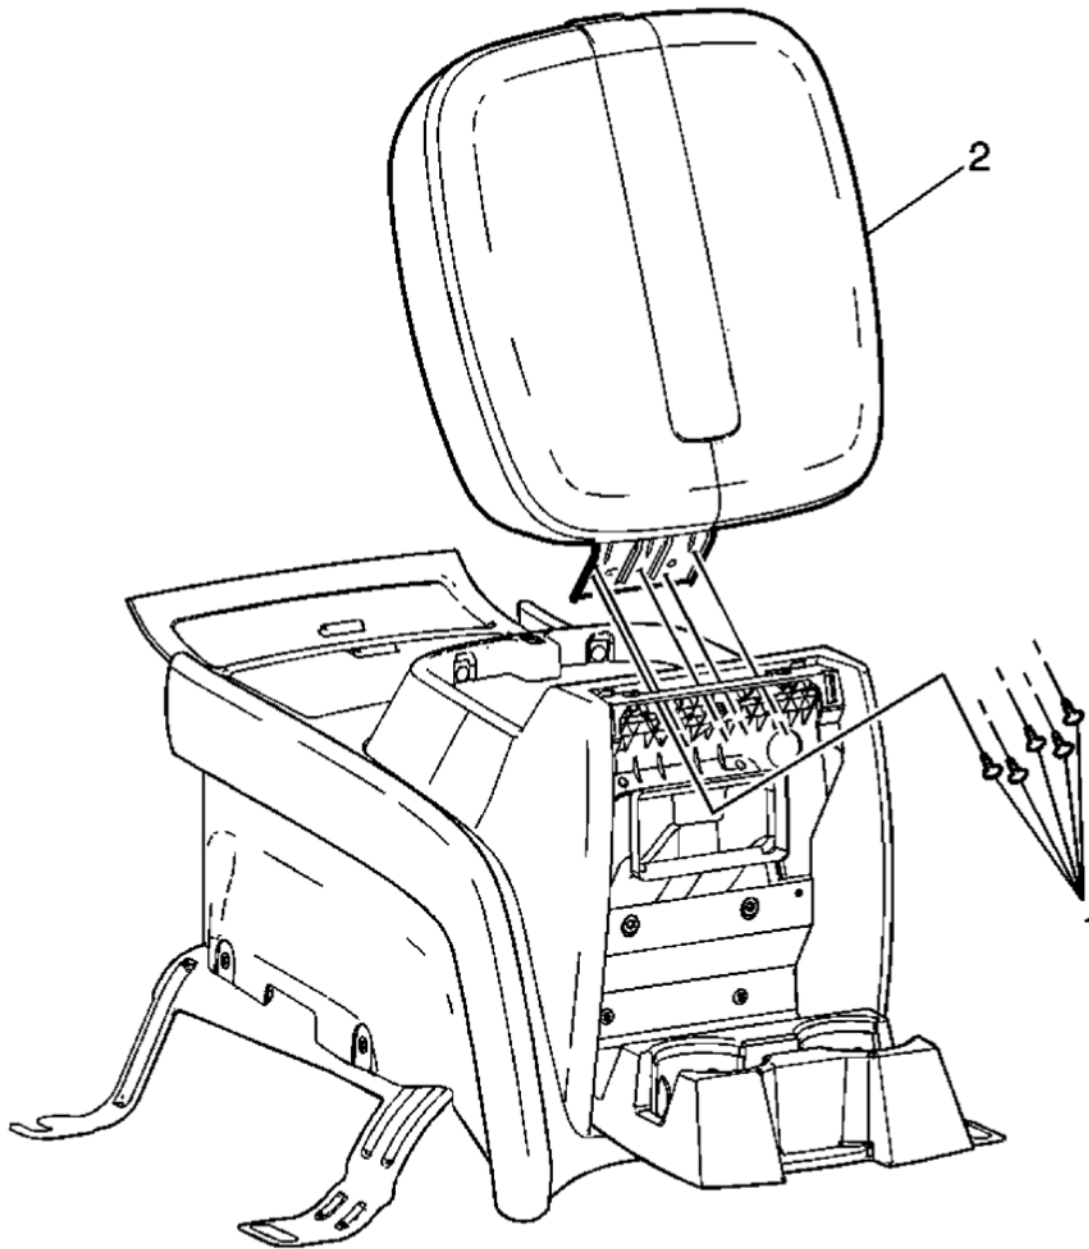


Fig. 52: View Of Front Top Storage Compartment Lid Assembly & Screws
Courtesy of GENERAL MOTORS CORP.

Cover Replacement - Floor Console - Rear (Cadillac)

Callout	Component Name
Preliminary Procedure:	
Remove the front floor console compartment bezel. Refer to <u>Front Floor Console Compartment Bezel Replacement (Cadillac)</u> or <u>Front Floor Console Compartment Bezel Replacement (Except Cadillac)</u> .	

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

1	Front Top Storage Compartment Lid Screws (Qty: 5)
	NOTE: Refer to <u>Fastener Notice</u> .
	Tighten: 2 N.m (18 lb in)
2	Front Top Storage Compartment Lid Assembly

COVER REPLACEMENT - FLOOR CONSOLE - REAR (EXCEPT CADILLAC)

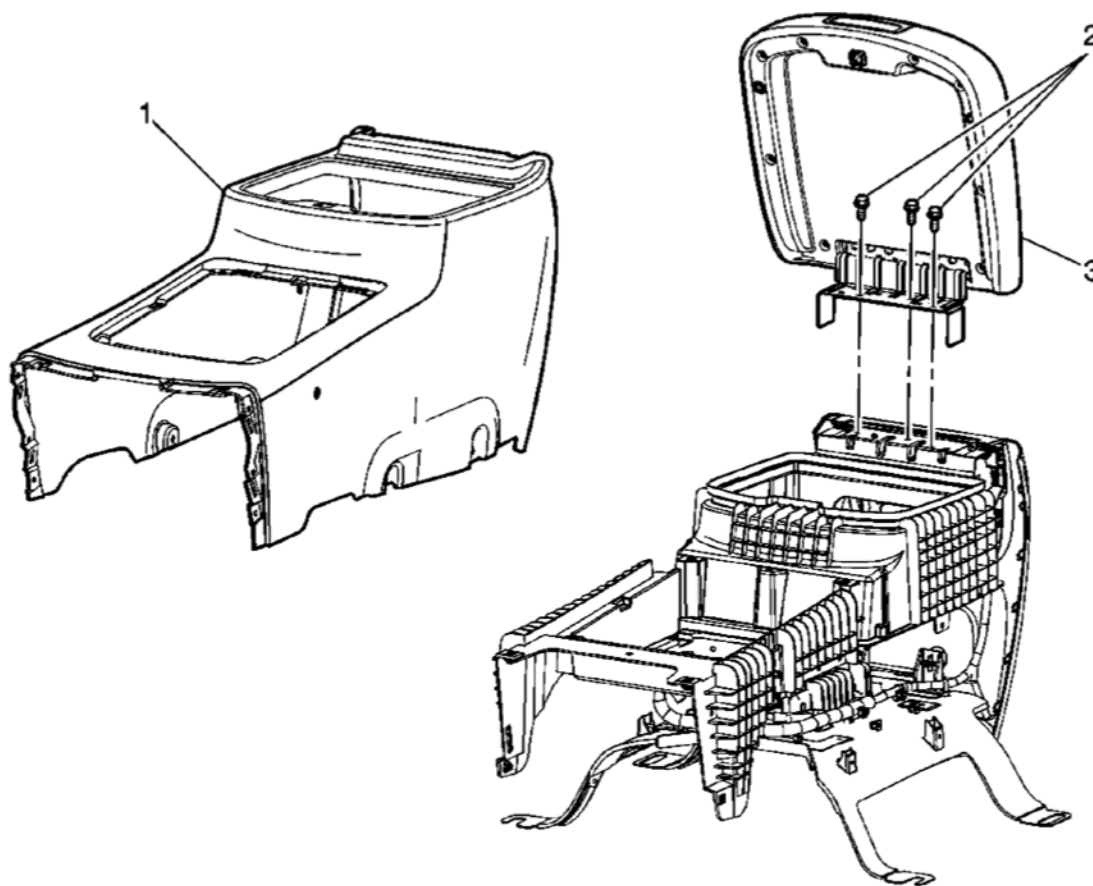


Fig. 53: View Of Front Floor Console Lid Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Cover Replacement - Floor Console - Rear (Except Cadillac)

Callout	Component Name
1	Front Floor Console Compartment Cover Assembly
	Front Floor Console Lid Assembly Screws (Qty: 3)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

2	NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
3	Front Floor Console Lid Assembly

ROOF CONSOLE REPLACEMENT

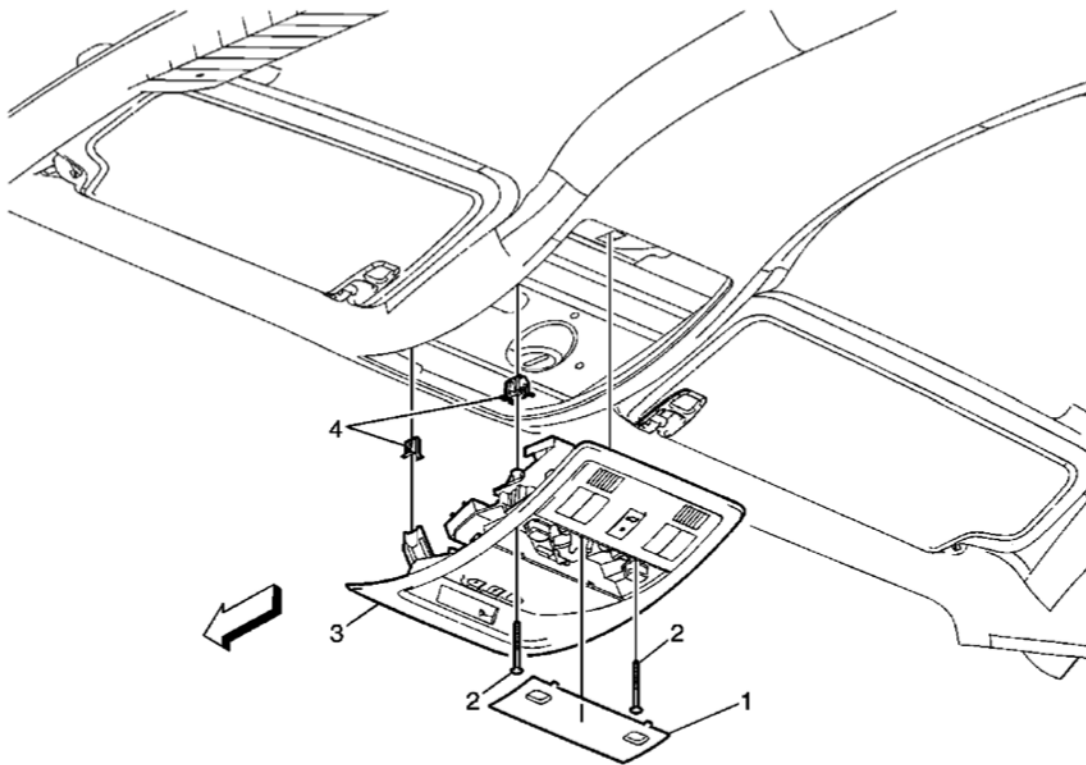


Fig. 54: View Of Roof Console Assembly & Components
Courtesy of GENERAL MOTORS CORP.

Roof Console Replacement

Callout	Component Name
1	Front Overhead Console Lens
2	Roof Console Screws (Qty: 2) NOTE: Refer to <u>Fastener Notice</u> . Tighten: 2 N.m (18 lb in)
	Roof Console Assembly Tip:

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

3	1. Disconnect the electrical connectors. 2. If replacing roof console assembly, transfer all necessary components.
4	Roof Console Retainers (Qty: 2) Tip: Pull down to disengage clips.

OVERHEAD CONSOLE REPLACEMENT - REAR (W/O DVD)

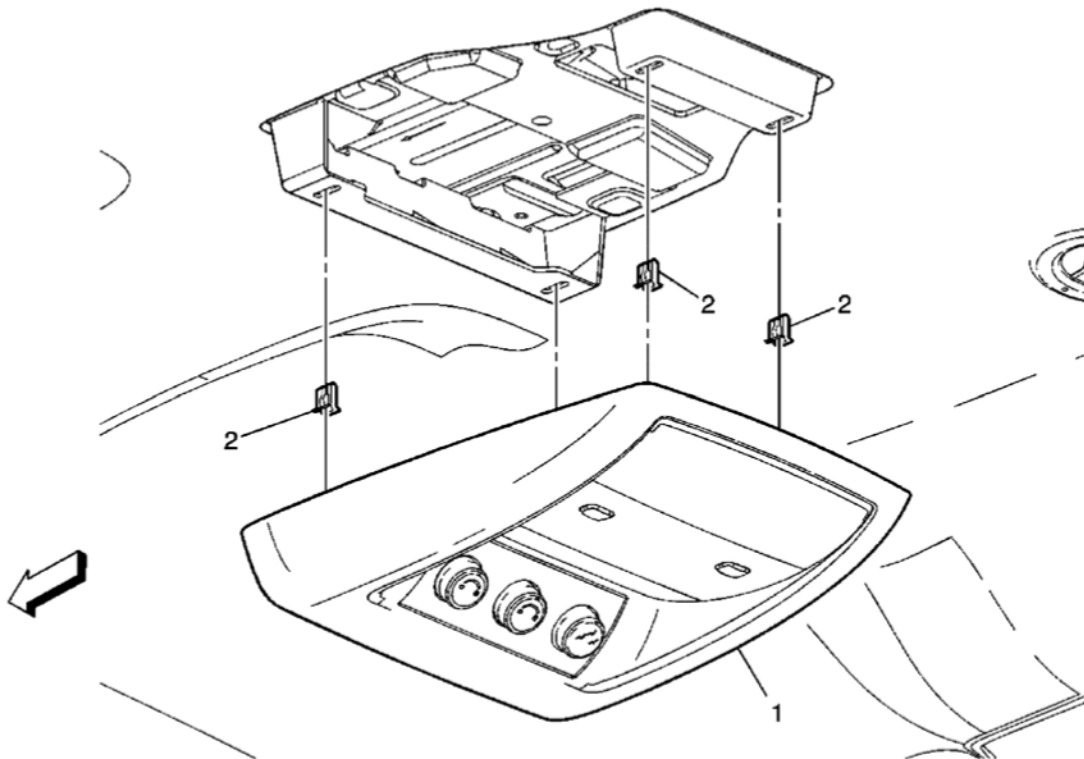


Fig. 55: View Of Rear Overhead Console Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Overhead Console Replacement - Rear (w/o DVD)

Callout	Component Name
1	Rear Overhead Console Assembly Tip: 1. Pull down to disengage clips. 2. Disconnect electrical connectors. 3. If replacing rear overhead console, transfer all necessary components.
2	Rear Overhead Console Retainer (Qty: 4)

OVERHEAD CONSOLE REPLACEMENT - REAR (WITH DVD)

2007 Cadillac Escalade

2007 ACCESSORIES & EQUIPMENT Instrument Panel and Console Trim - Avalanche, Escalade, Suburban, Tahoe & Yukon

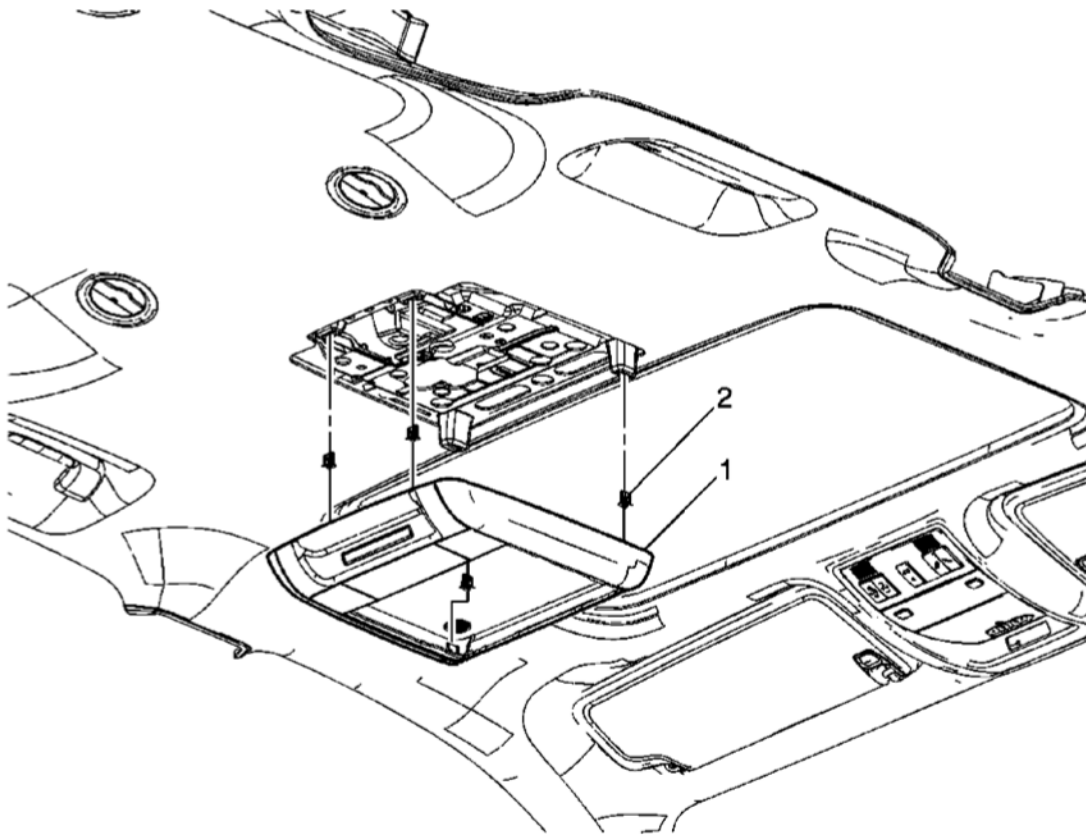


Fig. 56: View Of Roof Console Assembly & Retainers
Courtesy of GENERAL MOTORS CORP.

Overhead Console Replacement - Rear (with DVD)

Callout	Component Name
Preliminary Procedure: Remove the video display assembly. Refer to <u>Video Display Replacement (Second Row)</u> or <u>Video Display Replacement (Third Row)</u> .	
1	Roof Console Assembly Tip: 1. Pull down to disengage the retainer clips. 2. Disconnect the electrical connectors. 3. If replacing the rear roof console, transfer all necessary components.
2	Roof Console Retainer (Qty: 4)