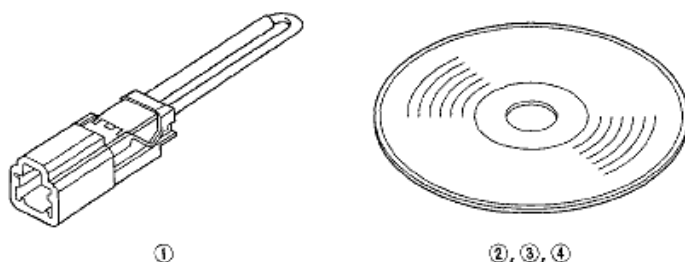


2007-2008 ACCESSORIES AND EQUIPMENT

Audio, Navigation, and Telematics - TL

SPECIAL TOOLS

Ref. No.	Tool Number	Description	Qty
①	07PAZ-0010100	SCS Service Connector	1
②	07AAZ-SDBA100	Diagnostics CD	1
③	07AAZ-SDBA200 (ABEX-TCD-725B)	Skip Test CD	1
④	07AAZ-SDBA300 (ABEX-TCD-721)	Skip Test CD	1

**Fig. 1: Identifying Special Tools**

Courtesy of AMERICAN HONDA MOTOR CO., INC.

DTC TROUBLESHOOTING INDEX

DISPLAY PANEL CONTROL UNIT

DTC TROUBLESHOOTING CHART

DTC	Description	DTC type
<u>B1701</u>	Display panel control unit CPU error	Internal error
<u>B1702</u>	Display panel control unit EEPROM error	Internal error
<u>B1705</u>	Display panel control unit lost communication with the gauge control module (Engine temperature signal)	Loss of communication
<u>B1706</u>	Display panel control unit lost communication with the gauge control module (VSP/NE signal)	Loss of communication
<u>B1725</u>	Display panel control unit temperature is too high	Internal error

ACURALINK CONTROL UNIT

DTC TROUBLESHOOTING CHART

DTC	Description	DTC type
<u>B2200</u>	B-CAN bus off	Loss of communication
<u>B2204</u>	B-CAN communication line error	Loss of communication

<u>B2205</u>	F-CAN communication line error	Loss of communication
<u>B2207</u>	Navigation unit lost communication with AcuraLink control unit (XM receiver)	Loss of communication
<u>B2208</u>	HandsFreeLink control unit lost communication with AcuraLink control unit (XM receiver)	Loss of communication
<u>B2209</u>	AcuraLink control unit internal error	Signal error
<u>B2240</u>	XM antenna error	Signal error

HANDSFREELINK CONTROL UNIT

DTC TROUBLESHOOTING CHART

DTC	Description	DTC type
<u>B1750</u>	Communication bus line error	Loss of communication
<u>B1751</u>	HandsFreeLink control unit CPU error	Internal error
<u>B1775</u>	Microphone input/output short to power/open	Signal error
<u>B1776</u>	Microphone input/output short to ground/open	Signal error
<u>B1779</u>	HFL switch (HFL TALK/HFL BACK buttons) circuit open/short	Signal error
<u>B1780</u>	HFL switch (HFL TALK/HFL BACK buttons) circuit short	Signal error
<u>B1792</u>	HandsFreeLink control unit internal error	Internal error